BOARDMAN (M5Ø) 4 SW UTC–8(–7DT) N45°48.89′ W119°49.23′ **SEATTLE**
396 B NOTAM FILE MMV **L–13A**

RWY 04–22: H4200X100 (ASPH) S–30 MIRL 0.7% up SW
RWY 22: Rgt tfc.

SERVICE: **LGT** ACTIVATE MIRL Rwy 04–22—122.9.

AIRPORT REMARKS: Unattended. Telephone avbl. Twy edge marked with blue reflectors. Rwy 04–22 cntrln in poor cond due to fading.

AIRPORT MANAGER: 541-481-7678


COMMUNICATIONS: CTAF 122.9

CLEARANCE DELIVERY PHONE: For CD ctc Seattle ARTCC at 253-351-3694.

RADIO AIDS TO NAVIGATION: NOTAM FILE PDT.

PENDLETON (VH) (H) VORTACW 114.7 PDT Chan 94 N45°41.91′ W118°56.32′ 267° 37.7 NM to fld. 1575/14E.

VOR unusable:
057°–066° byd 40 NM
067°–078° byd 40 NM blo 29,000′
096°–106° byd 40 NM blo 8,300′
096°–106° byd 48 NM blo 18,000′
107°–117° byd 40 NM
118°–128° byd 40 NM blo 12,000′
118°–128° byd 75 NM
129°–207° byd 40 NM

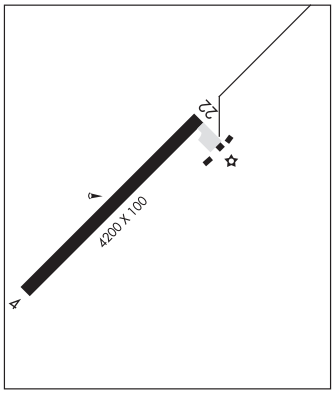

BROOKINGS (BOK)(KBOK) 1 NE UTC–8(–7DT) N42°04.44′ W124°17.39′ **KLAMATH FALLS**
462 B NOTAM FILE BOK **IAP**

RWY 12–30: H2901X60 (ASPH) S–11 MIRL 0.9% up NW
RWY 12: PAPI(P2L)—GA 4.0° TCH 40′. Rgt tfc.
RWY 30: PAPI(P2L)—GA 3.0° TCH 45′.

SERVICE: **FUEL** 100LL, JET A **LGT** ACTIVATE MIRL Rwy 12–30 and PAPI Rwy 12 and Rwy 30—CTAF.

AIRPORT REMARKS: Unattended. Deer and elk invof arpt gnds. Arpt rot bcn lgt beam obscured by taller trees northeast–southeast quadrant.

AIRPORT MANAGER: 541-661-4085

WEATHER DATA SOURCES: AWOS–3PT 132.025 (541) 412–8682.

COMMUNICATIONS: CTAF/UNICOM 122.8
SEATTLE CENTER APP/DEP CON 124.85

CLEARANCE DELIVERY PHONE: For CD ctc Seattle ARTCC at 253-351-3694.