
HOQUIAM

BOWERMAN FLD (HQM)(KHQM) 2 W UTC–8(–7DT) N46°58.27′ W123°56.19′ **SEATTLE**
18 B LRA NOTAM FILE HQM **H–1B, L–1D**
RWY 06–24: H5000X150 (ASPH) S–30, D–40, 2D–80 HIRL **IAP**
RWY 06: REIL. PAPI(P4R)—GA 3.0° TCH 40′. Rgt tfc.
RWY 24: MALSR. PAPI(P4L)—GA 3.5° TCH 55′.
SERVICE: **FUEL** 100LL, JET A **LGT** ACTIVATE HIRL Rwy 06–24, PAPI Rwy 06–24, MALSR Rwy 24 and REIL Rwy 06—CTAF.
AIRPORT REMARKS: Unattended. 100LL and Jet A avbl 24 hrs a day with major credit card. Flocks of waterfowl on and invof arpt. 103′ crane 0.2 NM southwest of AER 24. Svc road south of rwy in primary sfc. Ultralights prohibited without written permission from arpt mgr. Rwy 06–24 mrkgs faded.
AIRPORT MANAGER: 360-533-9544
WEATHER DATA SOURCES: ASOS 135.775 (360) 538–7021.
COMMUNICATIONS: CTAF/UNICOM 122.7
Ⓡ **SEATTLE CENTER APP/DEP CON** 128.3
CLEARANCE DELIVERY PHONE: For CD ctc Seattle ARTCC at 253-351-3694.
AIRSPACE: CLASS E.
RADIO AIDS TO NAVIGATION: NOTAM FILE HQM.
HOQUIAM (VH) (H) VORTACW 117.7 HQM Chan 124 N46°56.82′ W124°08.96′ 062° 8.9 NM to fld. 10/19E.
VOR unusable:
017°–024° byd 40 NM
037°–042° byd 40 NM
053°–058° byd 40 NM
066°–079° byd 40 NM
081°–091° byd 40 NM blo 4,000′
081°–091° byd 55 NM blo 5,000′
081°–091° byd 62 NM
092°–137° byd 40 NM
154°–157° byd 40 NM
195°–208° byd 40 NM
268°–273° byd 40 NM
357°–004° byd 40 NM
ILS/DME 108.7 I–HQM Chan 24 Rwy 24. Class IT.

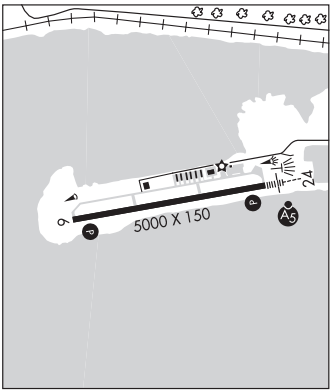

HOQUIAM N46°56.82′ W124°08.96′ NOTAM FILE HQM. **SEATTLE**
(VH) (H) VORTACW 117.7 HQM Chan 124 062° 8.9 NM to Bowerman Fld. 10/19E. **H–1B, L–1D**
VOR unusable:
017°–024° byd 40 NM
037°–042° byd 40 NM
053°–058° byd 40 NM
066°–079° byd 40 NM
081°–091° byd 40 NM blo 4,000′
081°–091° byd 55 NM blo 5,000′
081°–091° byd 62 NM
092°–137° byd 40 NM
154°–157° byd 40 NM
195°–208° byd 40 NM
268°–273° byd 40 NM
357°–004° byd 40 NM

HOSKINS FLD (See OLYMPIA on page 249)

ILWACO

PORT OF ILWACO (7W1) 2 E UTC–8(–7DT) N46°18.89′ W124°00.23′ **SEATTLE**
13 B NOTAM FILE SEA
RWY 10–28: H2080X50 (ASPH) S–5
RWY 10: Trees.
RWY 28: PAPI(P2L)—GA 4.0°. Thld dsplcd 300′. Trees.
SERVICE: **LGT** Arpt bcn pilot actvtd.
AIRPORT REMARKS: Unattended. Rwy 10 markings faded. Rwy 28 markings faded.
AIRPORT MANAGER: 360-642-3143
COMMUNICATIONS: CTAF 122.9
CLEARANCE DELIVERY PHONE: For CD ctc Seattle ARTCC at 253-351-3694.