
SEATTLE PAINE FLD INTL (See EVERETT on page 233)

SEKIU (11S) 0 NW UTC–8(–7DT) N48°15.97′ W124°18.84′ **SEATTLE**
355 B NOTAM FILE SEA
RWY 08–26: H2997X50 (ASPH) LIRL
RWY 08: Thld dsplcd 900′. Trees.
RWY 26: NSTD—GA 4.0° TCH 35′. Tree.
SERVICE: **LGT** Rwy 26 Nstd 2 box VASI left side ngts only.
AIRPORT REMARKS: Unattended. Deer on and invof arpt Sep–Mar. High ridge along N side of rwy. Turbulence on E end apch over water. Difficult apch when wind from N. Rwy 08–26 wdspr alligator and block cracking. Bathroom lock combination is 2608.
AIRPORT MANAGER: 360-417-3437
COMMUNICATIONS: CTAF 122.9
CLEARANCE DELIVERY PHONE: For CD ctc Seattle ARTCC at 253-351-3694.

SEQUIM VALLEY (W28) 4 NW UTC–8(–7DT) N48°05.88′ W123°11.28′ **SEATTLE**
151 B NOTAM FILE SEA **L–1E**
RWY 09–27: H3508X40 (ASPH) LIRL
RWY 09: Trees. Rgt tfc.
RWY 27: Trees.
SERVICE: S4 **FUEL** 100LL
AIRPORT REMARKS: Attended Mon–Fri 1700–1300Z‡. Self svc fuel avbl 24 hrs. Wildlife on and invof arpt. Rwy 09–27 has 2 inch shoulder dropoff. Ldg fee.
AIRPORT MANAGER: 360-670-3083
COMMUNICATIONS: CTAF/UNICOM 122.7
CLEARANCE DELIVERY PHONE: For CD ctc Whidbey Apch at 360-257-3310.
RADIO AIDS TO NAVIGATION: NOTAM FILE SEA.
TATOOSH (VH) (H) VORTACW 112.2 TOU Chan 59 N48°17.99′ W124°37.62′ 079° 59.0 NM to fld. 1650/22E.
VOR unusable:
020°–025° byd 40 NM
085°–090° byd 40 NM
091°–101° byd 40 NM blo 15,000′
091°–101° byd 58 NM
103°–109° byd 40 NM
356°–360° byd 40 NM

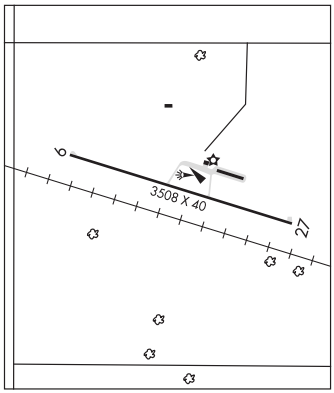

SHADY ACRES (See SPANAWAY on page 272)