
WENATCHEE

PANGBORN MEML (EAT)(KEAT) 4 E UTC–8(–7DT) N47°23.93′ W120°12.41′ **SEATTLE**
1249 B Class I, ARFF Index A NOTAM FILE EAT **H–1C, L–1D, 13A**
RWY 12–30: H7000X150 (ASPH) S–120, D–238, 2D–464, **IAP, AD**
2D/2D2–953 PCR 550 F/A/X/T HIRL
RWY 12: MALSR. PAPI(P4L)—GA 3.6° TCH 55′. Road. Rgt tfc.
RWY 30: REIL. PAPI(P4L)—GA 3.6° TCH 60′.
RUNWAY DECLARED DISTANCE INFORMATION
RWY 12: TORA–7000 TODA–7000 ASDA–7000 LDA–7000
RWY 30: TORA–7000 TODA–7000 ASDA–7000 LDA–7000
SERVICE: S4 **FUEL** 100LL, JET A **OX** 1, 2 **LGT** ACTVT MALSR Rwy 12, REIL Rwy 30, HIRL Rwy 12–30—CTAF. PAPI Rwy 12 and Rwy 30 oprr consly. Rwy 30 VGSI unusable byd 2.6 NM due to terrain.
AIRPORT REMARKS: Attended 1600–0200Z‡. Bird hazard. Glider activity from Mar–Nov. UAS activity 1.56 NM E of the EAT VOR, 400 ft and below dur dalgt hrs. 24 hr PPR for unscheduled air carrier ops with more than 30 pax seats call arpt ops, 509–860–1852. Cold temperature airport. Altitude correction required at or below –6C. Ldg fee.
AIRPORT MANAGER: 509-884-4700
WEATHER DATA SOURCES: ASOS 119.925 (509) 886–4226.
COMMUNICATIONS: CTAF/UNICOM 123.0
Ⓡ **SEATTLE CENTER APP/DEP CON** 126.1
CLEARANCE DELIVERY PHONE: For CD ctc Seattle ARTCC at 253-351-3694.
AIRSPACE: CLASS E.
RADIO AIDS TO NAVIGATION: NOTAM FILE EAT.
WENATCHEE (VL) (L) VORW/DME 114.35 EAT Chan 90(Y) N47°23.98′ W120°12.65′ at fld. 1222/15E.
VOR unusable:
041°–123° byd 20 NM
124°–132° byd 17
133°–249° byd 20
250°–262° byd 25 NM blo 12,000′
250°–262° byd 35 NM
263°–349° byd 20 NM
350°–040° byd 16 NM
DME unusable:
041°–249° byd 20 NM
250°–262° byd 25 NM blo 12,000′
250°–262° byd 35 NM
263°–349° byd 20 NM
350°–040° byd 16 NM
ILS/DME 109.35 I–ADJ Chan 30(Y) Rwy 12. Class IE. LOC unusable byd 15 NM blo 5,700′. DME unmonitored. Adj g/s unusable 5 degrees left of course NOTAM: ILS autocoupled approaches not applicable below 2,500′.

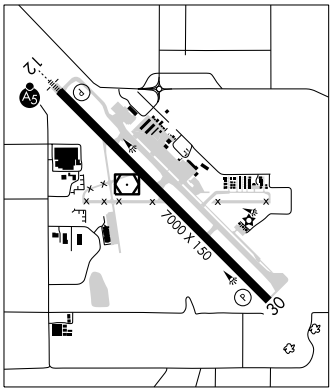

WESTPORT (14S) 1 N UTC–8(–7DT) N46°53.82′ W124°06.04′ **SEATTLE**
14 B NOTAM FILE SEA
RWY 12–30: H2318X50 (ASPH) MIRL
RWY 12: PAPI(P2L). Trees.
RWY 30: PAPI(P2L). Rgt tfc.
AIRPORT REMARKS: Unattended. Deer on and invof rwy. Large bird nesting area adjacent to Rwy 12–30. Rwy 12–30 soft shoulders. 12 ft slope 16 ft fm both sides of rwy.
AIRPORT MANAGER: 360-268-0131
COMMUNICATIONS: CTAF 122.9
CLEARANCE DELIVERY PHONE: For CD ctc Seattle ARTCC at 253-351-3694.

WHATCOM N48°56.72′ W122°34.76′ NOTAM FILE BLI. **SEATTLE**
(H) TACAN 113.0 HUH Chan 77 150° 9.3 NM to Bellingham Intl. 82/20E. **H–1B, L–1E**
TACAN AZIMUTH unusable:
155°–165° byd 15 NM blo 6,000′

WHIDBEY AIR PARK (See LANGLEY on page 241)