
WILBUR (2S8) 2 SW UTC–8(–7DT) N47°45.20´ W118°44.64´ **SEATTLE**
2183 B NOTAM FILE SEA **L–13A**
RWY 02–20: H3851X60 (ASPH) S–15.5 MIRL 0.5% up N **IAP**
RWY 02: REIL.
RWY 20: PAPI(P2L)—GA 3.0° TCH 44´.
SERVICE: S2 **FUEL** 100LL, JET A **LGT** ACTIVATE MIRL Rwy 02–20—CTAF. PAPI Rwy 20 opr continuously.
AIRPORT REMARKS: Attended Oct–Mar 1600–0100Z‡ Mon–Fri , Apr–Sep 1300–2200Z‡ Mon–Sat . Check NOTAMS for fire fighting operations in summer months. Wildlife invof runway. Pilots bring own ropes.
AIRPORT MANAGER: 509-641-2079
WEATHER DATA SOURCES: AWOS–2 124.175 (509) 647–0337.
COMMUNICATIONS: CTAF 122.9
Ⓡ **GRANT COUNTY APP/DEP CON** 126.4 (1400–0600Z‡)
Ⓡ **SEATTLE CENTER APP/DEP CON** 126.1 (0600–1400Z‡)
CLEARANCE DELIVERY PHONE: For CD ctc Seattle ARTCC at 253-351-3694.
RADIO AIDS TO NAVIGATION: NOTAM FILE EPH.
EPHRATA (VH) (H) VORTACW 112.6 EPH Chan 73 N47°22.68´ W119°25.44´ 030° 35.7 NM to fld. 1250/21E.
VOR unusable:
010°–014° byd 40 NM
042°–054° byd 40 NM
214°–228° byd 40 NM blo 7,000´
214°–228° byd 52 NM blo 10,000´
214°–228° byd 77 NM
229°–247° byd 40 NM
310°–350° byd 25 NM blo 6,500´
310°–353° byd 40 NM
358°–004° byd 40 NM
TACAN AZIMUTH unusable:
280°–295° byd 25 NM blo 7,000´
310°–350° byd 25 NM blo 6,500´
DME unusable:
280°–295° byd 25 NM blo 7,000´
310°–350° byd 25 NM blo 6,500´

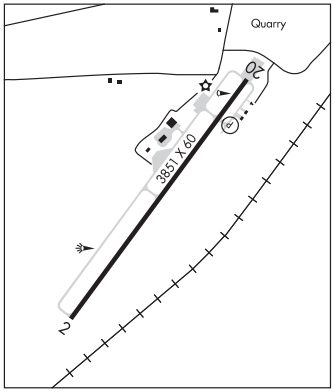

WILL ROGERS WILEY POST MEML SPB (See RENTON on page 261)

WILLAPA HARBOR (See SOUTH BEND(RAYMOND) on page 271)

WILLARD FLD (See TEKOA on page 275)

WILLIAM R FAIRCHILD INTL (See PORT ANGELES on page 255)

WILSON CREEK (5W1) 1 E UTC–8(–7DT) N47°25.11´ W119°06.55´ **SEATTLE**
1430 NOTAM FILE SEA
RWY 10–28: H2500X50 (ASPH)
AIRPORT REMARKS: Unattended. Fence south side of rwy, mid field, 70 ft fm rwy. Pilots bring own ropes.
AIRPORT MANAGER: (509) 345-2531
COMMUNICATIONS: CTAF 122.9
CLEARANCE DELIVERY PHONE: For CD ctc Grant County Apch at 509-762-2842, when Apch clsd ctc Seattle ARTCC at 253-351-3694.

