
SODA SPRINGS

ALLEN H TIGERT (U78) 1 SE UTC–7(–6DT) N42°38.91´ W111°34.91´ **SALT LAKE CITY**
5843 B NOTAM FILE BOI **L–11D**

RWY 16–34: H3500X50 (ASPH) S–12 LIRL(NSTD) 0.3% up S
RWY 16: TRCV(TRIL). Road.
RWY 34: TRCV(TRIL).
RWY 13–31: H2500X50 (ASPH) 0.4% up SE
RWY 13: Pole.
RWY 31: P–line.

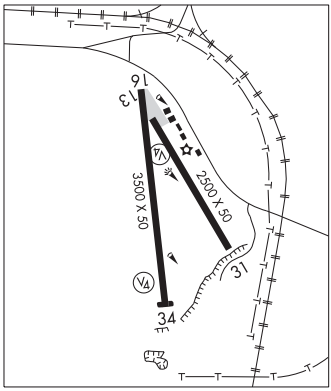

SERVICE: **FUEL** 100LL **LGT** Rwy 16 and Rwy 34 tri color VASI OTS indefly. Rwy 16–34 NSTD LIRL first 300´ Rwy 16 not lgtd. All rwy lgts OTS indefly. Rotg bcn OTS indef.

AIRPORT REMARKS: Unattended. Call 208–547–2600 or 208–221–4494 for svc. Day VFR only. Sharply dsndg trrn near end of Rwy 31 and Rwy 34. Rwy 16 dthr 300 ft at night. Nmrs obstns on apch to Rwys 13 and 16. Rwy 13–31 is very poor, full of old & untreated cracks, grass growing through them, has no markings, and many areas where the top layer of asph is flaking off. Rwy 16–34 is in rough shape: very poor markgs, untreated cracks, rough & exposed aggregate asph. Rwy 16 no markgs—paint is all gone. Rwy 34 rwy nrs are very dfclt to see—paint is 90% gone.

AIRPORT MANAGER: 208-547-2600

COMMUNICATIONS: CTAF/UNICOM 122.8

CLEARANCE DELIVERY PHONE: For CD ctc Salt Lake ARTCC at 801-320-2568.

RADIO AIDS TO NAVIGATION: NOTAM FILE MLD.

MALAD CITY (VH) (DH) VORW/DME 117.4 MLD Chan 121 N42°11.99´ W112°27.07´ 038° 47.1 NM to fld. 7330/17E.

VOR unusable:
009°–018° byd 40 NM
019°–029° byd 40 NM blo 15,000´
019°–029° byd 68 NM
030°–035° byd 40 NM
055°–068° byd 40 NM blo 18,000´
094°–104° byd 40 NM
157°–167° byd 25 NM blo 11,000´
244°–247° byd 40 NM
257°–259° byd 40 NM
301°–305° byd 40 NM
313°–319° byd 40 NM

DME unusable:
005°–025° byd 30 NM blo 14,000´
157°–167° byd 25 NM blo 11,000´