
LANAI

LANAI (LNY)(PHNY) 3 SW UTC–10 N20°47.14′ W156°57.09′ HAWAIIAN ISLANDS
1308 B TPA—See Remarks Class I, ARFF Index A NOTAM FILE LNY P–2G
RWY 03–21: H5001X150 (ASPH–GRVD) S–75, D–110, 2S–128, 2T–288, 2D–170, IAP
C5–517 PCR 317 F/B/X/T MIRL
RWY 03: PAPI(P4R)—GA 3.0° TCH 49′.
RWY 21: PAPI(P4L)—GA 3.76° TCH 45′. Antenna.
RUNWAY DECLARED DISTANCE INFORMATION
RWY 03: TORA–5000 TODA–5000 ASDA–5000 LDA–5000
RWY 21: TORA–5000 TODA–5000 ASDA–5000 LDA–5000
SERVICE: **FUEL** JET A **LGT** ACTIVATE PAPI Rwy 03 and Rwy 21, MIRL Rwy 03–21—CTAF. Rwy 21 PAPI unusable byd 2 NM due to terrain.
AIRPORT REMARKS: Attended 1600–0400Z. Jet A fuel 5000 gal. POC (808) 286–7075. 24 hrs PPR for Division 1.1, 1.2, 1.3 explosives and 4 hrs PPR for hazardous material in/out of arpt ctc (808) 565–7941/7943. Arpt CLOSED to air carrier ops with more than 10 passenger seats 0530–1600Z except PPR, call (808) 565–7942. TPA—small acft 2100 (792) large acft 2800 (1492). Possible severe updrafts/downdrafts from 2 mile final apch to Rwy 3 thld. Due to ramp limitations all acft parking limited to one hour except via PPR call (808) 565–7942, FAX (808) 565–7940 or (808) 872–3880. Jet parking SW side of ramp is conc. Fixed wing transient parking SW side of ramp is asph. NOTE: See Area Notices—TRAFFIC ADVISORIES AT NON–TOWER ARPTS.
AIRPORT MANAGER: 808-281-8801
WEATHER DATA SOURCES: AWOS–3P 118.375 (808) 565–6586.
COMMUNICATIONS: CTAF 122.9
Ⓡ **HCF CENTER APP/DEP CON** 119.3
CLEARANCE DELIVERY PHONE: For CD ctc HCF center at 808-840-6262.
AIRSPACE: CLASS E svc continuous.
RADIO AIDS TO NAVIGATION: NOTAM FILE LNY.
(H) (H) VORTACW 117.7 LNY Chan 124 N20°45.87′ W156°58.13′ 027° 1.6 NM to fld. 1252/11E.
TACAN unusable:
005°–063° byd 20 NM blo 15,000′
VOR unusable:
020°–060° byd 27 NM blo 5,000′
ILS/DME 111.1 I–LNY Chan 48 Rwy 03. Class IT. Autopilot coupled apch NA blw 2,300 MSL. Unmonitored

MAUI

HANA (HNM)(PHHN) 3 NW UTC–10 N20°47.74′ W156°00.87′ HAWAIIAN ISLANDS
78 B TPA—See Remarks NOTAM FILE HNM P–2G
RWY 08–26: H3606X100 (ASPH) S–34, D–48, 2D–80 MIRL IAP
0.7% up W
RWY 08: PAPI(P2L)—GA 3.6° TCH 26′.
RWY 26: Rgt tfc.
SERVICE: **LGT** Dusk–dawn. ACTVT MIRL (only high intst avbl) Rwy 08–26—CTAF. Rwy 08 PAPI dalgt opns only. Rwy 08 PAPI OTS indef.
AIRPORT REMARKS: Attended 1745–0230Z. Wild boars on and invof arpt. Parachute ldg area on east infield btn Twy B and C. Helicopter pilot training maneuvers will be conducted at the approach end of Rwy 26 only. Ultralights on and invof arpt. 24 hrs PPR for Division 1.1, 1.2, 1.3 explosives and 4 hrs PPR for other hazardous cargo in/out of arpt ctc (808) 248–4861 or (808) 872–3880. Rwy 08–26 35′ trees along both sides of rwy 200′ from centerline. Helicopter parking on grass infield areas between ramp and runway. TPA—Small acft 800 (722) large acft 1500 (1422). Lgtd wind sock lctd Rwy 08 and Rwy 26 end. NOTE: See Area Notices—TRAFFIC ADVISORIES AT NON–TOWER AIRPORTS.
AIRPORT MANAGER: 808-872-3808
WEATHER DATA SOURCES: AWOS–3PT 118.325 (808) 248–4864.
COMMUNICATIONS: CTAF 122.9
Ⓡ **HCF CENTER APP/DEP CON** 118.45 278.3

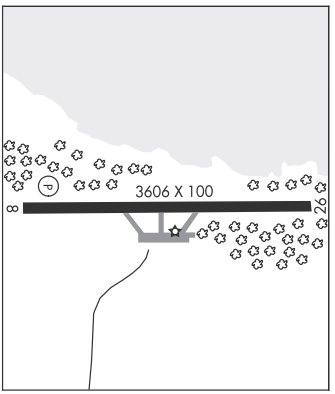

CONTINUED ON NEXT PAGE

CONTINUED FROM PRECEDING PAGE

CLEARANCE DELIVERY PHONE: For CD ctc Honolulu Control Facility at 808-840-6262.

RADIO AIDS TO NAVIGATION: NOTAM FILE OGG.

MAUI (H) (H) VORTACW 115.1 OGG Chan 98 N20°54.39′ W156°25.26′ 095° 23.8 NM to fld. 24/11E.

VOR unusable:
060°–085° byd 24 NM blo 9,000′
095°–163° byd 15 NM
164°–195° byd 25 NM blo 7,000′
205°–223° byd 22 NM
224°–242° byd 14 NM blo 20,000′
224°–242° byd 15 NM blo 25,000′
243°–246° byd 16 NM blo 25,000′
247°–274° byd 15 NM blo 25,000′
275°–285° byd 22 NM
300°–315° byd 15 NM
316°–330° byd 29 NM

TACAN AZIMUTH unusable:
095°–163° byd 15 NM
164°–195° byd 25 NM blo 7,000′
205°–223° byd 22 NM
224°–242° byd 14 NM blo 20,000′
224°–242° byd 15 NM blo 25,000′
243°–246° byd 16 NM blo 25,000′
247°–274° byd 15 NM blo 25,000′
275°–285° byd 22 NM

DME unusable:
095°–163° byd 15 NM
164°–195° byd 25 NM blo 7,000′
205°–223° byd 22 NM
224°–242° byd 14 NM blo 20,000′
224°–242° byd 15 NM blo 25,000′
243°–246° byd 16 NM blo 25,000′
247°–274° byd 15 NM blo 25,000′
275°–285° byd 22 NM

KAHULUI (OGG)(PHOG) 3 E UTC–10 N20°53.92′ W156°25.83′ **HAWAIIAN ISLANDS**
55 B LRA ARFF Index—See Remarks NOTAM FILE OGG **P–2G**
RWY 02–20: H6998X150 (ASPH–GRVD) S–130, D–170, 2D–360, 2D/2D2–750 PCR 480 F/D/X/T HIRL 0.6% up SW **IAP, AD**
RWY 02: MALSR. PAPI(P4R)—GA 3.0° TCH 77′. Stack. Rgt tfc.
RWY 20: PAPI(P4L)—GA 3.0° TCH 76′. Bldg.
RWY 05–23: H4980X150 (ASPH–GRVD) S–130, D–170, 2D–270 PCR 670 F/A/X/T MIRL
RWY 05: PAPI(P4L)—GA 3.0° TCH 40′. Trees.
RWY 23: Pole. Rgt tfc.

RUNWAY DECLARED DISTANCE INFORMATION
RWY 02: TORA–6995 TODA–6995 ASDA–6995 LDA–6995
RWY 20: TORA–6995 TODA–6995 ASDA–6995 LDA–6995

SERVICE: S2 **FUEL** 100, JET A **LGT** When twr clsd ACTIVATE MALSR Rwy 02, PAPI Rwy 20 and Rwy 05, HIRL Rwy 02–20, MIRL Rwy 05–23—CTAF. Rwy 05 PAPI unusable byd 4 NM from thld due to rapidly rising terrain.

NOISE: NOTE: See Area Notices—Landing Rights Airports–Hazards, Cautions and Warnings—CLASS C Airspace–Arrival/Departure Routes—Noise Sensitive Areas—Informal Runway Use Program.

AIRPORT REMARKS: Attended continuously. Class I, ARFF Index D, however, can accommodate Index E as required, call arpt manager prior to arrival. 24 hrs PPR for Division 1.1, 1.2, 1.3 explosives and 4 hrs PPR for other hazardous cargo in/out of arpt; ctc (808) 872–3830 1745–0230Z other times (808) 872–3888. SAID in use. Operate transponders with altitude reporting mode and ADS–B (if equipped) enabled on all airport surfaces. Lighted tower 570′ MSL approximately 3 miles west of airport. Migratory bird activity blo 1500′ within 5 NM radius of arpt during August—May. Acft over 30,000 lbs ldg on Rwy 02–20 unable to turn off onto Rwy 05–23 due to pavement condition. Due to nonvisibility twr unable to provide ATC svc between acft and ground vehicles on the commuter air terminal S of Taxiway F and the helicopter air terminal E of apch end Rwy 02. Due to non–visibility twr unable to determine if following area is clear of obstructions and/or tfc: portion of Taxiway F between the commuter air terminal and apch end Rwy 05. Ramp area E side Rwy 02 under state authority. FAA not responsible for direction and control gnd tfc in area. Transient parking located on northeast section of E ramp. Area E of apch end Rwy 02 designated as helicopter operations area. No fixed wing acft may operate on helipad during operational hours SR–SS. PPR for fixed wing acft operations on helipad during nonoperational hours call (808) 872–3880 1515–0800Z. Access to helipad from Twy C only. Mil hel ops with PPR rstrd to the SW corner of Hot Cargo Apron (HAZMAT) N of Rwy 05–23. Commuter terminal ramp restricted to acft 140,000 lbs or less. Jet A fuel avbl 1700–0400Z, other times by prior arrangement with FBO 24 hrs, (808) 871–5572, or (808) 873–6060. 100 octane fuel avbl 24 hrs self–service. Commuter air trml rstrd to Part 121 and Part 135 oprs only. Acft at the trml shall call the twr on 121.9 prior to pushback. Flight Notification Service (ADCUS) available. NOTE: See General Notices—Entry and Departure Requirements.

CONTINUED ON NEXT PAGE