MOLOKAI
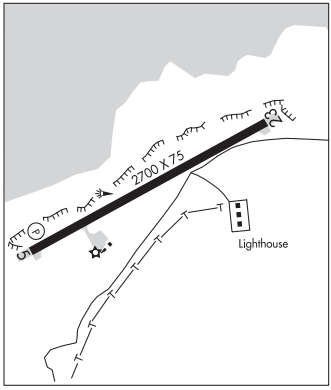
KALAUPAPA (LUP)(PHLU) 2 N UTC–10 N21°12.66′ W156°58.42′
24 B TPA—800(776) NOTAM FILE MKK
RWY 05–23: H2700X75 (ASPH) S–17 MIRL
RWY 05: PAPI(P2L)—GA 3.0° TCH 19′.
RWY 23: Rgt tfc.
SERVICE: **LGT** ACTVT MIRL Rwy 05–23 med intst only—CTAF. PAPI Rwy 05 daytime VFR use only. Rwy 05 PAPI unusbl byd 2.2 NM. Terrain penetrates PAPI safety slope at 2.7 NM. PAPI OTS indefly.
AIRPORT REMARKS: Attended Mon–Fri 1700–0130Z. PPR from State Department of Health, Communicable Disease Division to enter settlement area phone Honolulu (808) 586–4580. 24 hrs PPR for Division 1.1, 1.2, 1.3 explosives and 4 hrs PPR for other hazardous material in/out of arpt ctc (808) 567–9660/9663. Deer and wild animals on and invof arpt at night. Oct–May large waves impacting shoreline resulting in salt water sprays 40′ high. NOTE: See Area Notices—TRAFFIC ADVISORIES AT NON–TOWER ARPTS.
AIRPORT MANAGER: 808-872-3830
COMMUNICATIONS: CTAF 122.9
Ⓡ **HCF CENTER APP/DEP CON** 124.1
CLEARANCE DELIVERY PHONE: For CD ctc Honolulu Control Facility at 808-840-6262.
RADIO AIDS TO NAVIGATION: NOTAM FILE MKK.
MOLOKAI (H) (H) VORTACW 116.1 MKK Chan 108 N21°08.29′ W157°10.05′ 057° 11.7 NM to fld. 1421/11E. VORTAC unusable:
275°–285° byd 25 NM blo 3,500′