
HOBART RGNL (HBR)(KHBR) 3 SE UTC–6(–5DT) N34°59.40′ W99°03.18′
1563 B NOTAM FILE HBR MON Airport
RWY 17–35: H5507X100 (ASPH) S–20 MIRL 0.4% up S
RWY 17: PAPI(P4L)—GA 3.0° TCH 35′.
RWY 35: PAPI(P4L)—GA 3.0° TCH 42′.
RWY 03–21: H2975X60 (ASPH) S–9.4 0.5% up SW
SERVICE: **FUEL** 100LL, JET A+
AIRPORT REMARKS: Attended Mon–Fri 1400–2200Z‡. Fuel avbl 24 hr self svc with major credit card. Rwy 03 and Rwy 21 mrkgs svrly faded.
AIRPORT MANAGER: 580-726-2719
WEATHER DATA SOURCES: **ASOS** 133.325 (580) 726–6651.
COMMUNICATIONS: **CTAF/UNICOM** 122.8
Ⓡ **ALTUS APP/DEP CON** 125.1 (Mon–Fri 1500–0830Z‡, clsd weekends and holidays. Other times ctc)
Ⓡ **FORT WORTH CENTER APP/DEP CON** 128.4
CLEARANCE DELIVERY PHONE: For CD ctc Fort Worth ARTCC at 817-858-7584.
AIRSPACE: **CLASS E**.
RADIO AIDS TO NAVIGATION: NOTAM FILE HBR.
(VL) (L) VORTACW 115.85 HBR Chan 105(Y) N34°51.99′ W99°03.80′ 354° 7.4 NM to fld. 1472/10E.
VOR unusable:
045°–070° byd 40 NM
071°–079° byd 54 NM blo 7,000′
071°–079° byd 66 NM
080°–120° byd 10 NM
355°–360° byd 15 NM blo 4,500′
TACAN AZIMUTH unusable:
050°–055° byd 21 NM blo 4,500′
050°–055° byd 26 NM blo 5,500′
050°–055° byd 33 NM blo 7,500 . 080–120 byd 10 NM′
245°–270° byd 33 NM blo 3,500′
DME unusable:
080°–120° byd 10 NM
355°–360° byd 15 NM blo 4,500′

DALLAS–FT WORTH
H–6H, L–17B
IAP



HOLDENVILLE MUNI (F99) 1 NW UTC–6(–5DT) N35°05.15′ W96°25.00′
861 B NOTAM FILE MLC
RWY 17–35: H3251X100 (CONC) S–30, D–42 MIRL(NSTD)
SERVICE: **LGT** Rwy 17–35 intens rwy lgts nstd dist fm rwy edge.
AIRPORT REMARKS: Unattended. 125′ AGL silo, .3 nm W Rwy 35 thld.
AIRPORT MANAGER: 254-368-4635
COMMUNICATIONS: **CTAF** 122.9
Ⓡ **FORT WORTH CENTER APP/DEP CON** 132.2
CLEARANCE DELIVERY PHONE: For CD ctc Fort Worth ARTCC at 817-858-7584.
RADIO AIDS TO NAVIGATION: NOTAM FILE OKM.
OKMULGEE (VH) (DH) VORW/DME 114.9 OKM Chan 96 N35°41.58′ W95°51.96′ 209° 45.3 NM to fld. 774/8E.

DALLAS–FT WORTH
L–17D
IAP

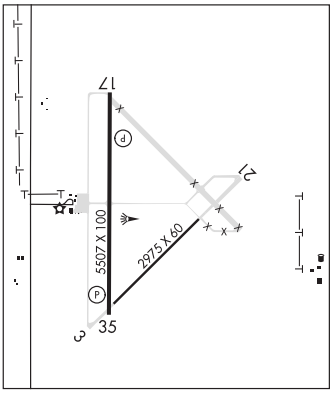