
WESTPORT (4F1) 2 E UTC–6(–5DT) N36°13.29′ W96°20.79′ **KANSAS CITY**
901 TPA—1501(600) NOTAM FILE MLC
RWY 03–21: H2900X42 (ASPH) S–10, D–12.5 MIRL 1.0% up NE
RWY 21: Tree.
SERVICE: **LGT** ACTIVATE MIRL Rwy 03–21—CTAF. ACTIVATE rwy lgts for all ops day & night. Use highest ints for daytime ops.
AIRPORT REMARKS: Attended irregularly. Rwy 21 steep uphill slope up to +60′ hill at rwy end and 50′ right of centerline. Gross weight limited by airport operator to 6000 lbs single wheel gear.
AIRPORT MANAGER: 918-358-6031
COMMUNICATIONS: CTAF 122.9
CLEARANCE DELIVERY PHONE: For CD ctc Tulsa Apch at 918-831-6714/6720.

WILBURTON MUNI (HØ5) 4 W UTC–6(–5DT) N34°55.21′ W95°23.63′ **DALLAS–FT WORTH**
670 B NOTAM FILE MLC **L–17D**
RWY 17–35: H3000X60 (ASPH) S–2 MIRL
RWY 17: PAPI(P2L)—GA 3.0° TCH 40′. Trees.
RWY 35: PAPI(P2L)—GA 3.0° TCH 40′. Trees.
SERVICE: **LGT** ACTIVATE MIRL Rwy 17–35—CTAF.
AIRPORT REMARKS: Unattended. Deer on and invof rwy. Parl twy pavement failed; use south cnctr twy to apn.
AIRPORT MANAGER: 918-465-5361
COMMUNICATIONS: CTAF 122.9
CLEARANCE DELIVERY PHONE: For CD ctc Fort Worth ARTCC at 817-858-7584.
RADIO AIDS TO NAVIGATION: NOTAM FILE MLC.
MC ALESTER (L) TACAN Chan 57 MLC (112.0) N34°50.97′ W95°46.94′ 069° 19.6 NM to fld. 782/8E.

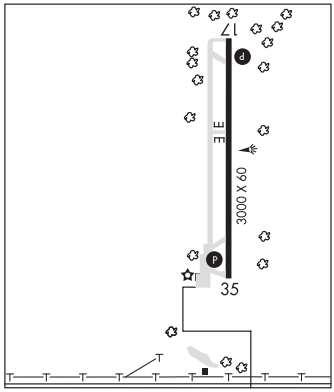

WILEY POST (See OKLAHOMA CITY on page 236)

WILLIAM R POGUE MUNI (See SAND SPRINGS on page 243)

WOODRING N36°22.43′ W97°47.29′ NOTAM FILE WDG. **WICHITA**
(T) (T) VORW/DME 109.0 ODG Chan 27 at Enid Woodring Rgnl. 1150/8E. **L–15D**