BISHOP–WINDHAM (Ø7R) 3 NE UTC–6(–5DT) N27°36.61′ W97°45.15′ **BROWNSVILLE**
55 B NOTAM FILE SJT **L–20H, 21A**

RWY 15–33: H3200X50 (ASPH) S–12.5 MIRL
RWY 15: Road.
RWY 33: Road.

SERVICE: **LGT** Rwy 15–33 MIRLs OTS indefly.

AIRPORT REMARKS: Unattended. Intensive mil jet tfc 1300 ft AGL and abv from Kingsville NAS (NQI) 7 NM SW. Ctc Kingsville apch 119.9 for instrns.


AIRPORT MANAGER: 361-584-2567

COMMUNICATIONS: CTAF 122.9

CLEARANCE DELIVERY PHONE: For CD ctc Houston ARTCC at 281-230-5622.

RADIO AIDS TO NAVIGATION: NOTAM FILE CRP.

CORPUS CHRISTI (VH) (H) VORTACW 115.5 CRP Chan 102
N27°54.23′ W97°26.69′ 214° 24.0 NM to fld. 60/9E.
TACAN AZIMUTH & DME unusable:
024°–036° byd 35 NM blo 1,700′
037°–023° byd 35 NM blo 2,000′
265°–275°
VOR unusable:
340°–005° byd 40 NM blo 7,000′
340°–005° byd 84 NM
Byd 30 NM blo 1,500′
TACAN AZIMUTH unusable:
080°–085° byd 30 NM

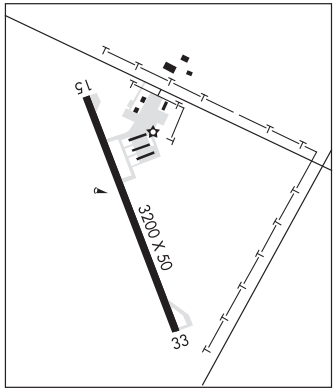

BOERNE STAGE AIRFIELD (See SAN ANTONIO on page 427)

BOLIVAR

BAR V K (T38) P 1 N UTC–6(–5DT) N33°22.58′ W97°14.61′ **DALLAS–FT WORTH**
765 NOTAM FILE FTW

RWY 18–36: 2900X100 (TURF) LIRL
RWY 18: Thld dsplcd 200′. Road.
RWY 36: Thld dsplcd 200′. Trees.

SERVICE: **LGT** ACTVT LIRL Rwy 18–36—122.825.

AIRPORT REMARKS: Unattended. Arpt clsd at ngt to non–residents. Wildlife on and invof rwy. Glider actvt on and invof arpt. PAEW on rwy. Grass mower will clear rwy aft low apch. No fuel or otr svcs avbl. Do not mistake north end 1400 ft long turf twy as rwy. Rwy soft when wet, call for ficons. Cell twr midfield inside downwind for Rwy 36. Ditch on both sides of rwy mid field outside of rwy lgts.

AIRPORT MANAGER: 940-453-5256

COMMUNICATIONS: CTAF 122.85

CLEARANCE DELIVERY PHONE: For CD ctc Lone Star Apch at 972-615-2799.

BONHAM

JONES FLD (FØØ) 2 N UTC–6(–5DT) N33°36.79′ W96°10.76′ **DALLAS–FT WORTH**
618 B NOTAM FILE FTW **L–17D, A**
IAP

RWY 17–35: H4000X75 (ASPH) S–12.5 MIRL
RWY 17: PAPI(P2L)—GA 3.0° TCH 37′. Trees.
RWY 35: PAPI(P2L)—GA 3.0° TCH 37′. Antenna.

SERVICE: S4 **FUEL** 100LL, JET A+ **LGT** MIRL Rwy 17 and 35 SS–SR preset low; to ACTVT or incr intst—CTAF. PAPI Rwy 17 and PAPI Rwy 35 opr consly.


AIRPORT REMARKS: Unattended. For arpt attendant call 903–583–7555 Mon–Fri 1400–2300Z‡. Aft hrs call Bonham Police Dept. 903–583–2141. 100LL self–serv. Jet A full serv. Call 903–227–5199. Extensive aerial AG ops Apr–Aug. Otr times ireg. For airframe repairs call 903–640–0233 or 903–583–5119.

AIRPORT MANAGER: 903-583-8623

WEATHER DATA SOURCES: AWOS–3PT 118.05 (903) 583–2082.

COMMUNICATIONS: CTAF/UNICOM 122.8
Ⓡ**FORT WORTH CENTER APP/DEP CON** 124.875

CLEARANCE DELIVERY PHONE: For CD ctc Fort Worth ARTCC at 817-858-7584.

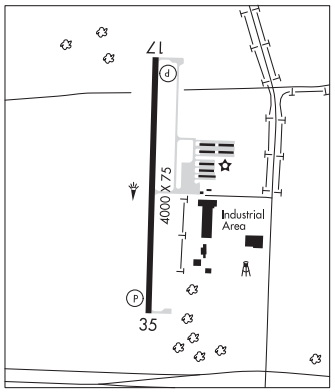


CONTINUED ON NEXT PAGE

CONTINUED FROM PRECEDING PAGE

RADIO AIDS TO NAVIGATION: NOTAM FILE FTW.
BONHAM (VH) (H) VORTACW 114.6 BYP Chan 93 N33°32.25′ W96°14.05′ 025° 5.3 NM to fld. 700/6E.
COMM/NAV/WEATHER REMARKS: UNICOM unmonitored.

BORGER

HUTCHINSON CO (BGD)(KBGD) 2 N UTC–6(–5DT) N35°42.05′ W101°23.62′ **DALLAS–FT WORTH H–6G, L–15B IAP**
3055 B NOTAM FILE BGD
RWY 17–35: H6299X100 (ASPH) S–60, D–100 MIRL 0.9% up S
RWY 17: PAPI(P4L)—GA 3.0° TCH 58′. Pole.
RWY 35: PAPI(P4R)—GA 3.0° TCH 41′. Trees.
RWY 03–21: H3897X100 (ASPH) S–60, D–100 MIRL 0.5% up SW
SERVICE: **FUEL** 100LL, JET A+ **LGT** ACTVT PAPI Rwys 17 and 35; MIRL Rwys 03–21 and 17–35—CTAF.
AIRPORT REMARKS: Attended 1400–0000Z‡. Rwy 21, 100′ drop–off, 95′ dstc. Rwy 3, 40′ drop–off, 150′ dstc.
AIRPORT MANAGER: 806-273-0137
WEATHER DATA SOURCES: ASOS 118.325 (806) 274–7318.
COMMUNICATIONS: CTAF/UNICOM 123.0
Ⓡ**AMARILLO APP/DEP CON** 119.5 (1200–0600Z‡)
Ⓡ**ALBUQUERQUE CENTER APP/DEP CON** 127.85 (0600–1200Z‡)
CLEARANCE DELIVERY PHONE: For CD ctc Albuquerque ARTCC at 505-856-4861.
RADIO AIDS TO NAVIGATION: NOTAM FILE BGD.
BORGER (L) TACAN Chan 23 BGD (108.6) N35°48.42′ W101°22.93′ 174° 6.4 NM to fld. 3130/11E.
TACAN AZIMUTH unusable:
220°–320° byd 10 NM blo 12,000′

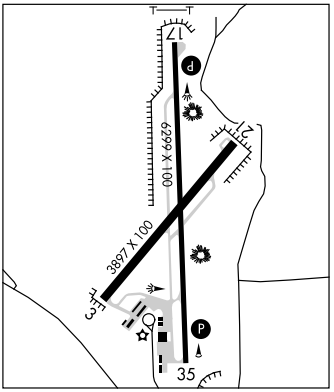

BORGER N35°48.42′ W101°22.93′ NOTAM FILE BGD. **DALLAS–FT WORTH H–6G, L–15B**
(L) TACAN 108.6 BGD Chan 23 174° 6.4 NM to Hutchinson Co. 3130/11E.
TACAN AZIMUTH unusable:
220°–320° byd 10 NM blo 12,000′

BOURLAND FLD (See FORT WORTH on page 329)

BOWIE MUNI (ØF2) 4 NE UTC–6(–5DT) N33°36.10′ W97°46.53′ **DALLAS–FT WORTH L–17C, A IAP**
1101 B NOTAM FILE FTW
RWY 17–35: H3603X60 (ASPH) S–12.5 MIRL 0.5% up N
RWY 17: PAPI(P2L)—GA 3.0° TCH 35′. Pole.
RWY 35: PAPI(P2L)—GA 3.0° TCH 40′. Trees.
SERVICE: **FUEL** 100LL, JET A **LGT** Dusk–dawn. ACTVT PAPI Rwy 17 and 35; MIRL 17–35—CTAF.
AIRPORT REMARKS: Attended Mon–Fri 1330–2230Z‡. For arpt attendant after hrs call 940–841–4156. Deer on and invof arpt. Crop dusting Jan–Apr. 100LL and Jet A 24 hr self–serve. Rwy 35 has 30 ft drop–off 190 ft dstc, both sides. Rwy 17–35 pvmt lip 1.5 inches abv grade.
AIRPORT MANAGER: 940-841-4156
WEATHER DATA SOURCES: AWOS–3PT 118.75 (940) 872–2366.
COMMUNICATIONS: CTAF/UNICOM 122.8
Ⓡ**FORT WORTH CENTER APP/DEP CON** 127.95
CLEARANCE DELIVERY PHONE: For CD ctc Fort Worth ARTCC at 817-858-7584.
RADIO AIDS TO NAVIGATION: NOTAM FILE FTW.
(H) (H) VORTACW 117.15 UKW Chan 118(Y) N33°32.15′ W97°49.28′ 024° 4.6 NM to fld. 1102/6E.

