FORT WORTH

BOURLAND FLD (5ØF) 17 SW UTC–6(–5DT) N32°34.91′ W97°35.45′
873 B NOTAM FILE FTW

RWY 17–35: H4049X60 (ASPH) MIRL(NSTD) 0.9% up N
RWY 17: VASI(V2L)—GA 3.0° TCH 23′. Thld dsplcd 392′. Road.
RWY 35: VASI(V2L)—GA 3.5° TCH 28′. Thld dsplcd 215′. Trees.

SERVICE: **FUEL** 100LL, JET A **LGT** ACTVT MIRL Rwy 17–35—CTAF. Rwy 17–35 nstd lgt spacing, 100′ between rwy lts.

AIRPORT REMARKS: Attended Mon–Sat dalgt hours. For svcs aft hrs call 817–752–4701. Deer and wildlife on and invof rwy. 100LL self serve. Arpt clsd to tsnt student tfc. Acft ovr 12,500 lb max GWT prohibited. Rwy 17 dthr lts and mkgs not coincident.


AIRPORT MANAGER: 682-260-3778

COMMUNICATIONS: CTAF/UNICOM 123.0
Ⓡ **LONE STAR APP/DEP CON** 135.975

CLEARANCE DELIVERY PHONE: For CD ctc Lone Star Apch at 972-615-2799.

RADIO AIDS TO NAVIGATION: NOTAM FILE FTW.

MILLSAP (VH) (H) VORTACW 117.7 MQP Chan 124 N32°43.57′ W97°59.85′ 104° 22.3 NM to fld. 900/9E.
VOR unusable:
004°–009° byd 40 NM
010°–054° byd 40 NM blo 3,800′
010°–054° byd 46 NM blo 5,000′
010°–054° byd 56 NM
055°–066° byd 40 NM blo 3,800′
055°–066° byd 50 NM
230°–247° byd 40 NM
248°–258° byd 40 NM blo 3,700′
248°–258° byd 53 NM
259°–270° byd 40 NM blo 6,000′
259°–270° byd 63 NM
271°–285° byd 40 NM
312°–316° byd 40 NM
325°–340° byd 40 NM blo 3,000′
325°–340° byd 46 NM blo 5,000′
325°–340° byd 66 NM
353°–003° byd 40 NM blo 18,000′

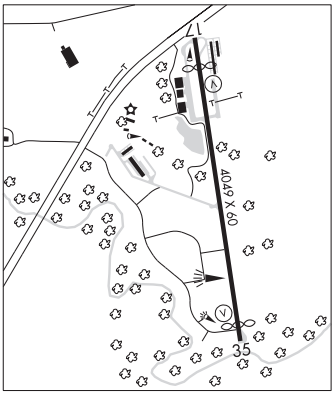

DALLAS–FT WORTH
COPTER
L–17C, A
IAP