
MASON CO (T92) 3 SE UTC–6(–5DT) N30°43.93′ W99°11.04′ **SAN ANTONIO**
1514 B NOTAM FILE SJT **L–19C**
RWY 18–36: H3716X50 (ASPH) LIRL **IAP**
RWY 18: PAPI(P2L)—GA 3.25° TCH 48′. Trees.
RWY 36: PAPI(P2L)—GA 3.0° TCH 44′.
SERVICE: **FUEL** 100LL
AIRPORT REMARKS: Unattended. Deer on and invof rwy. 100LL 24 hrs self serve. For assistance call 325–347–5252 (County Sheriff). Hvy tsnt tfc Nov–Jan.
AIRPORT MANAGER: 325-347-5556
COMMUNICATIONS: CTAF 122.9
Ⓡ **HOUSTON CENTER APP/DEP CON** 132.35
CLEARANCE DELIVERY PHONE: For CD ctc Houston ARTCC at 281-230-5622.
RADIO AIDS TO NAVIGATION: NOTAM FILE AQO.
LLANO (L) TACAN Chan 19 LLO (108.2) N30°47.78′ W98°47.24′ 251° 20.9 NM to fld. 1207/8E.

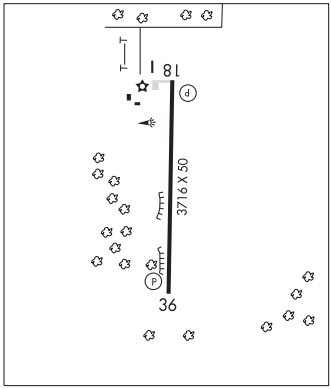

MAVERICK CO MEML INTL (See EAGLE PASS on page 321)

MAVERICK N32°52.15′ W97°02.43′ NOTAM FILE FTW. **DALLAS–FT. WORTH**
(VH) (H) VORW/DME 113.1 TTT Chan 78 359° 1.7 NM to Dallas–Fort Worth Intl. 536/6E. **COPTER**
All acft arriving DFW are requested to turn DME off until departure due to traffic overload of Maverick DME **H–6H, L–17C, A**
DME unusable:
180°–190° byd 10 NM
240°–260° byd 20 NM blo 3,500′
VOR unusable:
105°–110° byd 40 NM