
WACO RGNL (ACT)(KACT) 5 NW UTC–6(–5DT) N31°36.73′ W97°13.82′ **SAN ANTONIO**
516 B ARFF Index—See Remarks NOTAM FILE ACT **H–6H, L–19D, A**
IAP, AD

RWY 01–19: H7107X150 (ASPH–GRVD) S–120, D–220, 2S–121, 2T–276, 2D–166, 2D/2D2–882, C5–466 PCR 547 F/B/W/T HIRL
RWY 01: PAPI(P4R)—GA 3.0° TCH 55′. RVR–R Thld dsplcd 102′. Road.
RWY 19: MALSR. RVR–T
RWY 14–32: H5103X150 (ASPH–GRVD) S–114, D–190, 2S–104, 2D–332, 2D/2D2–773 PCR 462 F/B/W/T MIRL
RWY 14: REIL. PAPI(P4L)—GA 3.0° TCH 58′.
RWY 32: PAPI(P4L)—GA 3.0° TCH 58′. Road.
RUNWAY DECLARED DISTANCE INFORMATION
RWY 01: TORA–7107 TODA–7107 ASDA–7107 LDA–7005
RWY 14: TORA–5103 TODA–5103 ASDA–5103 LDA–5103
RWY 19: TORA–7107 TODA–7107 ASDA–6605 LDA–6605
RWY 32: TORA–5103 TODA–5103 ASDA–5103 LDA–5103

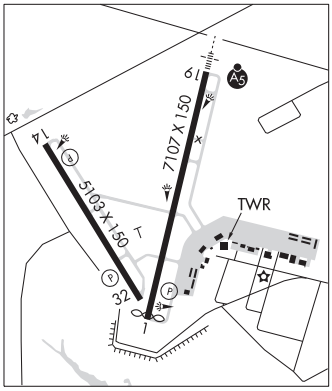

SERVICE: S4 **FUEL** 100LL, JET A, UL94 **OX** 1 **LGT** When ATCT clsd: MALSR Rwy 19; HIRL Rwy 01–19 preset low intst, to incr intst ACTVT—CTAF. REIL Rwy 14; MIRL Rwy 14–32; twy lgts preset low intst when wind favors, otrw not avbl.
AIRPORT REMARKS: Attended 1200–0400Z‡. Class I, ARFF Index B. PPR for unsked air carrier ops call arpt manager 254–750–8657. PPR rqrd for unsked ACR opns. Call arpt ops at 254–750–8656. NOTE: See Special Notices—Model Aircraft Activity. Landing fee for acft ovr 7500 lbs.
AIRPORT MANAGER: 254-750-8656
WEATHER DATA SOURCES: ASOS (254) 218–3267
COMMUNICATIONS: CTAF 119.3 **ATIS** 123.85 **UNICOM** 122.95
RCO 122.6 (FORT WORTH RADIO)
Ⓡ **APP CON** 127.65 (1200–0600Z‡)
Ⓡ **DEP CON** 126.125 (1200–0600Z‡)
Ⓡ **FORT WORTH CENTER APP/DEP CON** 133.3 (0600–1200Z‡)
TOWER 119.3 (1200–0600Z‡) **GND CON** 121.9
CLEARANCE DELIVERY PHONE: For CD ctc waco Apch at 121.9 or ctc Fort Worth ARTCC at 817-858-7584.
AIRSPACE: CLASS D svc 1200–0600Z‡; other times CLASS E.
RADIO AIDS TO NAVIGATION: NOTAM FILE ACT.
(VH) (H) VORTACW 115.3 ACT Chan 100 N31°39.73′ W97°16.14′ 137° 3.6 NM to fld. 507/9E.
VOR unusable:
125°–149° byd 40 NM
149°–159° byd 47 NM
159°–187° byd 40 NM
188°–198° byd 40 NM blo 12,000′
199°–234° byd 40 NM
235°–245° byd 50 NM
246°–256° byd 40 NM blo 18,000′
246°–256° byd 52 NM
257°–267° byd 58 NM
268°–282° byd 51 NM
270°–335° byd 35 NM blo 4,000′
283°–293° byd 40 NM blo 6,000′
283°–293° byd 58 NM
294°–330° byd 40 NM
ILS/DME 109.7 I–ACT Chan 34 Rwy 19. Class IE. ILS/DME unmonitored when ATCT closed.
ASR (1200–0600Z‡)

WINGS FOR CHRIST INTL FLT ACADEMY (73F) 8 NE UTC–6(–5DT) N31°37.43′ W97°01.35′ **SAN ANTONIO**
455 NOTAM FILE FTW
RWY 16–34: 3000X80 (TURF) RWY LGTS(NSTD)
RWY 16: Thld dsplcd 315′. Fence.
RWY 34: Trees. Rgt tfc.
SERVICE: S2 **LGT** ACTVT LIRL Rwy 16–34—CTAF.
AIRPORT REMARKS: Attended continuously. 4′ fence along both sides of rwy 70′ from cntrln south half of rwy. Rwy 34 40′ trees 90′ fm thr.
AIRPORT MANAGER: 254-723-3277
COMMUNICATIONS: CTAF 122.9
CLEARANCE DELIVERY PHONE: For CD ctc Fort Worth ARTCC at 817-858-7584.
COMM/NAV/WEATHER REMARKS: Arpt inside Class D airspace. Ctc TSTC twr 124.0.