
COBB CO INTL/MCCOLLUM FLD (RYY)(KRYY) 21 NW UTC–5(–4DT) N34°00.79´ W84°35.82´ **ATLANTA**
1040 B LRA NOTAM FILE RYY **H–9A, 12F, L–18I, A**
RWY 09–27: H6295X100 (CONC–GRVD) PCN 50 R/C/W/T HIRL **IAP, AD**
0.7% up W
RWY 09: PAPI(P4L)—GA 4.0° TCH 46´. Thld dsplcd 1062´. Road. Rgt tfc.
RWY 27: MALSF. PAPI(P4L)—GA 3.0° TCH 45´. Trees.
RUNWAY DECLARED DISTANCE INFORMATION
RWY 09: TORA–6311 TODA–6311 ASDA–6311 LDA–5233
RWY 27: TORA–6311 TODA–6311 ASDA–5374 LDA–5374
SERVICE: S4 **FUEL** 100LL, JET A+ **OX** 1, 2 **LGT** When twr clsd, ACTIVATE MALSF Rwy 27; HIRL Rwy 09–27—CTAF.
NOISE: Turbine/jet aircraft operators are requested to use NBAA noise abatement program procedures or comparable procedures of aircraft manufacturer.
AIRPORT REMARKS: Attended 1100–0500Z‡. For svc after hrs call 24 hrs prior, 770–422–2345/4300. Coyotes on and invof arpt. Arpt mowing in progress spring thru autumn. Rwy 09 is calm wind rwy in VFR cond. Index B acft rescue and fire fighting equipment available upon request. 24 hr prior permission required. Ctc arpt manager 770–528–1615. Blasting SR–SS Mon–Fri 2000´ AER 27. Twy B clsd from Twy B5 to B6 to acft with wingspans of 79´ or greater. N apron at Twy A1 connector is rstd to Group 1 acft only. Ldg fee for tsnt acft over 6000 lbs and all tsnt acft btwn 0200–1100Z‡.

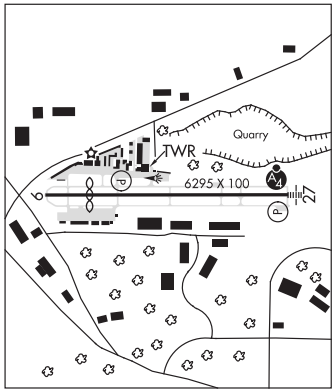

AIRPORT MANAGER: 770-528-8220
WEATHER DATA SOURCES: AWOS–3PT (770) 425–3406 LAWRS.
COMMUNICATIONS: CTAF 125.9 **ATIS** 128.125 **UNICOM** 122.7
Ⓡ **ATLANTA APP/DEP CON** 121.0 **CLNC DEL** 121.0 (when twr clsd)
MC COLLUM TOWER 125.9 (1200–0400Z‡) **GND CON** 119.0 **CLNC DEL** 119.0
AIRSPACE: CLASS D svc 1200–0400Z‡; other times CLASS G.
RADIO AIDS TO NAVIGATION: NOTAM FILE RMG.
ROME (VH) (H) VORTACW 115.4 RMG Chan 101 N34°09.75´ W85°07.16´ 108° 27.5 NM to fld. 1148/1E.
ILS/DME 111.9 I–RYY Chan 56 Rwy 27. Class IA. LOC unusable byd 20° right of course. Glideslope unmonitored whent ATCT clsd.