ERWIN

HARNETT RGNL JETPORT (HRJ)(KHRJ) 4 NW UTC–5(–4DT) N35°22.81′ W78°43.93′ **CHARLOTTE**
202 B NOTAM FILE HRJ **H–9C, 12H, L–35B, 36F**
IAP

RWY 05–23: H5005X75 (ASPH) S–45, D–60 MIRL 0.3% up NE
RWY 05: REIL. PAPI(P2L)—GA 3.0° TCH 39′.
RWY 23: REIL. PAPI(P2L)—GA 3.0° TCH 39′.

SERVICE: S4 **FUEL** 100LL, JET A1+ **OX** 4 **LGT** ACTVT REIL Rwy 05 & Rwy 23; MIRL Rwy 05–23—CTAF; PAPI Rwy 05 & Rwy 23 on consly.

AIRPORT REMARKS: Attended 1300–2200Z‡. Unatndd Thanksgiving and Christmas. Svc avbl 24/7 with prior arngmnts. GPU and bulk oil avbl. 100LL 24 hr. self svc with credit card. Rwy 05, 60 ft drop–off 550 ft fm thr and Rwy 23, 25 ft drop–off 70 ft left of cntrln. Arpt located 18 NM NE of Pope Army Airfield, low level mil act invof arpt.

AIRPORT MANAGER: 910-814-2740

WEATHER DATA SOURCES: AWOS–3 119.025 (910) 814–3946.

COMMUNICATIONS: CTAF/UNICOM 122.7


Ⓡ **FAYETTEVILLE APP/DEP CON** 125.175

CLEARANCE DELIVERY PHONE: For CD ctc Fayetteville Apch at 910-484-8012.

RADIO AIDS TO NAVIGATION: NOTAM FILE FAY.

FAYETTEVILLE (L) (DH) VORW/DME 114.85 FAY Chan 95(Y)
N34°59.13′ W78°52.50′ 021° 24.7 NM to fld. 187/4W.
VOR unusable:
058°–068° blo 4,000′
090°–100°
DME unusable:
090°–100°

LOC/DME 108.35 I–HRJ Chan 20(Y) Rwy 05.

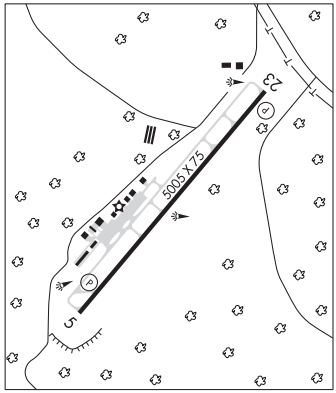

FARMVILLE

FLANAGAN FLD (NØ8) 3 SE UTC–5(–4DT) N35°33.40′ W77°33.63′ **CHARLOTTE**
75 NOTAM FILE RDU

RWY 03–21: 2500X100 (TURF)
RWY 03: Trees.
RWY 21: Thld dsplcd 300′. Trees.

AIRPORT REMARKS: Unattended. Livestock and wildlife invof arpt. +4′ fence along hwy at NE end of Rwy 21 mkd with yellow fence cap and Rwy 03 has 3′ unmarked electric fence at rwy end. Rwy 21 no dsplcd thr mkgs. Rwy 03–21 mkd with yellow cones. Rwy 03–21 mkrs show 75′ rwy width.

AIRPORT MANAGER: 252-341-2697

COMMUNICATIONS: CTAF 122.9

CLEARANCE DELIVERY PHONE: For CD ctc Washington ARTCC at 703-771-3587.