
## MONROE

**CHARLOTTE/MONROE EXEC** (EQY)(KEQY) 5 NW UTC–5(–4DT) N35°01.04′ W80°37.32′ **CHARLOTTE**
683 B LRA NOTAM FILE EQY **H–9B, 12G, L–25D, 36E**
**RWY 05–23:** H7001X100 (ASPH) S–35, D–68.5 HIRL 0.3% up SW **IAP**
**RWY 05:** MALSR. PAPI(P4L)—GA 3.0° TCH 46′. Trees.
**RWY 23:** REIL. PAPI(P4L)—GA 3.0° TCH 40′. Trees.
**SERVICE:** S4 **FUEL** 100LL, JET A1+ **OX** 3, 4 **LGT** ACTVT MALSR Rwy 05; REIL Rwy 23; HIRL Rwy 05–23—CTAF. All lights oper dusk–0500Z‡. After 0500Z‡, ACTVT—122.7. PAPI Rwy 05 & 23 oper consly.
**AIRPORT REMARKS:** Attended 1200–0000Z‡. Deer, wildlife, and birds on and invof arpt. Fuel 24 hr credit card svc avbl. Right side of Twy A at Rwy 23 has steep shoulder drop–off btn rwy and Twy A.
**AIRPORT MANAGER:** 704-282-4730
**WEATHER DATA SOURCES: ASOS** 135.775 (704) 283–5185.
**COMMUNICATIONS: CTAF/UNICOM** 122.7
Ⓡ **CHARLOTTE APP/DEP CON** 120.05
**CLNC DEL** 132.55
**CLEARANCE DELIVERY PHONE:** For CD ctc Charlotte Apch at 704-359-0241.
**RADIO AIDS TO NAVIGATION:** NOTAM FILE CLT.
**(L) (L) VORW/DME** 115.0 CLT Chan 97 N35°11.42′ W80°57.11′ 127° 19.3 NM to fld. 732/5W.
DME portion unusable:
015°–050° byd 25 NM blo 3,000′
050°–100° byd 25 NM blo 2,500′
185°–202° byd 15 NM
203°–220°
270°–350° byd 20 NM blo 5,000′
VOR/DME controlled by Charlotte ATCT
VOR unusable:
203°–220°
**ILS/DME** 109.75 I–EQY Chan 34(Y) Rwy 05. Class IA. LOC unmonitored 2200–1300Z‡. LOC unusable byd 30° left of course.
**COMM/NAV/WEATHER REMARKS:** Arpt phone number 704–282–4730.

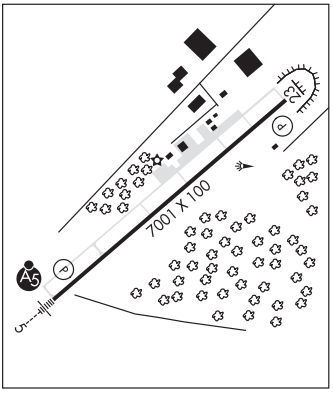


**MONTGOMERY CO** (See STAR on page 371)

**MOORE CO** (See PINEHURST/SOUTHERN PINES on page 357)