
MOUNT OLIVE MUNI (W4Ø) 3 NE UTC–5(–4DT) N35º13.29´ W78º02.32´ **CHARLOTTE**
167 B NOTAM FILE RDU **H–9C, L–35B, 36F**
RWY 05–23: H5254X75 (ASPH) S–20 MIRL **IAP**
RWY 05: PAPI(P2L)—GA 3.5º TCH 43´. Trees.
RWY 23: PAPI(P2L)—GA 3.5º TCH 43´. Thld dsplcd 254´. Road.
SERVICE: S4 **FUEL** 100LL, JET A1+ **OX** 3, 4 **LGT** After SS ACTVT and incr intst MIRL Rwy 05–23—CTAF. ACTVTPAPI Rwy 05 and Rwy 23—CTAF.
AIRPORT REMARKS: Attended 1300–2300Z‡. Unattended on major hol. For svc after hrs call 252–234–7778 or 252–289–7778. For AVGAS and Jet A – 24 hr self svc with credit card. –5´ drainage ditch 100´ left of cntrln of Rwy 05. Rwy 05 +200´ AM radio twr aprx 6000´ SW of rwy end on cntrln. Low level mil activity near arpt. For collision avoidance ctc Seymour AFB 119.7.
AIRPORT MANAGER: 919-635-1471
WEATHER DATA SOURCES: AWOS–3P 120.075 (919) 658–8067.
COMMUNICATIONS: CTAF/UNICOM 122.8
Ⓡ **SEYMOUR JOHNSON APP/DEP CON** 119.7 (1200–0400Z‡) other times ctc
Ⓡ **WASHINGTON CENTER APP/DEP CON** 123.85
CLEARANCE DELIVERY PHONE: For CD ctc Washington ARTCC at 703-771-3587.

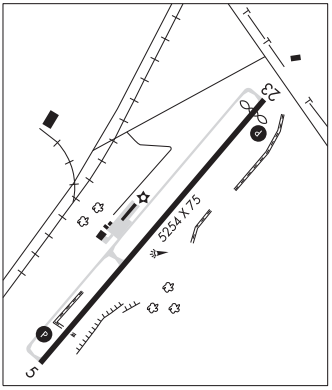

RADIO AIDS TO NAVIGATION: NOTAM FILE ISO.
KINSTON (VL) (L) VORTACW 117.5 ISO Chan 122 N35º22.26´ W77º33.50´ 254º 25.2 NM to fld. 70/5W.
VOR unusable:
020º–025º byd 40 NM
040º–115º byd 40 NM
145º–155º byd 40 NM
175º–185º byd 40 NM
183º–215º byd 30 NM blo 5,000´
200º–206º byd 40 NM
207º–214º byd 59 NM
215º–238º blo 3,500´
215º–238º byd 6 NM
238º–258º byd 30 NM blo 5,000´
239º–265º byd 40 NM
280º–290º byd 40 NM
295º–308º byd 22 NM blo 3,000´
295º–308º byd 32 NM
309º–319º byd 31 NM
320º–325º byd 40 NM
335º–340º byd 40 NM
345º–347º byd 40 NM
348º–358º byd 20 NM
TACAN AZIMUTH unusable:
183º–215º byd 30 NM blo 5,000´
DME unusable:
183º–215º byd 30 NM blo 5,000´