
PINEHURST/SOUTHERN PINES

MOORE CO (SOP)(KSOP) 3 N UTC–5(–4DT) N35°14.25′ W79°23.34′ **CHARLOTTE**
459 B NOTAM FILE SOP **H–9C, 12H, L–35A, 36F**
IAP

RWY 05–23: H6503X150 (ASPH–GRVD) S–100, D–162 PCN 27 F/A/X/T HIRL 0.4% up SW
RWY 05: MALSR. PAPI(P4L)—GA 3.0° TCH 40′. Thld dsplcd 600′. Trees.
RWY 23: REIL. PAPI(P4R)—GA 3.0° TCH 41′. Thld dsplcd 400′. Trees.

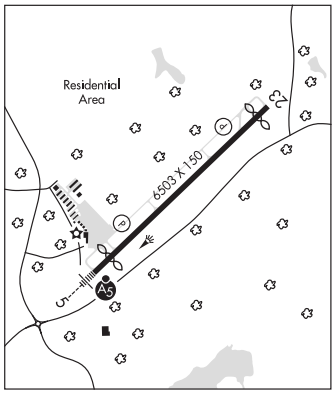

RUNWAY DECLARED DISTANCE INFORMATION
RWY 05: TORA–6502 TODA–6502 ASDA–6102 LDA–5502
RWY 23: TORA–6502 TODA–6502 ASDA–6102 LDA–5722

SERVICE: S4 **FUEL** 100LL, JET A+ **OX** 3 **LGT** ACTVT MALSR Rwy 05; REIL Rwy 23; HIRL Rwy 05–23; twy lgts—CTAF. PAPI Rwy 05 & 23 opers consly. Rwy 23 PAPI unusbl byd 8 deg left of cntrln.
NOISE: Noise abatement procs in effect. Ctc amgr 910–692–3212.
AIRPORT REMARKS: Attended 1300–0100Z‡. Bird activity on and invof arpt Apr–Oct. Fixed wing acft opns not auth from any grass/turf sfc. Clsd to unscheduled air carrier oper with more than 30 passenger seats, call arpt mgr 910–692–3212. 12 hr PPR for jet ops conducted 0400–1100Z‡, ctc arpt mgr 910–692–3212. Maint avbl. Flt trng avbl.
AIRPORT MANAGER: 910-692-3212
WEATHER DATA SOURCES: AWOS–3PT 127.575 (910) 692–4287.
COMMUNICATIONS: CTAF/UNICOM 123.05
Ⓡ **FAYETTEVILLE APP/DEP CON** 127.8
CLNC DEL 127.0
CLEARANCE DELIVERY PHONE: For CD ctc Fayetteville Apch 910-484-8012.
RADIO AIDS TO NAVIGATION: NOTAM FILE RDU.
SANDHILLS (L) (L) VORTACW 111.8 SDZ Chan 55 N35°12.93′ W79°35.28′ 085° 9.9 NM to fld. 588/3W.
VOR unusable:
075°–143°
144°–154° blo 6,000′
144°–154° byd 23 NM
155°–179° blo 5,000′
180°–264° blo 8,000′
301°–019° byd 10 NM blo 10,000′
DME unusable:
041°–092° blo 3,000′
TAC AZM unusable:
016°–050° byd 28 NM blo 3,000′
ILS/DME 111.5 I–SOP Chan 52 Rwy 05. Class IT. LOC unmonitored 0100–1300Z‡. Autopilot cpd apch NA blw 700′ MSL.

PITT–GREENVILLE (See GREENVILLE on page 330)

PLYMOUTH

DONALD'S AIR PARK INC (7NC) 8 SE UTC–5(–4DT) N35°43.90′ W76°40.28′ **CHARLOTTE**
18 NOTAM FILE RDU
RWY 05–23: 4195X100 (TURF) LIRL(NSTD)
RWY 05: Brush.
RWY 23: Pole.
SERVICE: S3 **LGT** LIRL Rwy 05–23 on cont day and night; Rwy 05 lgtd thld relocated 250 ft and Rwy 23 lgtd thld relocated 1000 ft; 2750 ft of rwy usbl at night. Rwy 05–23 NSTD LIRL due to spacing of rwy lgts and no end lgts.
AIRPORT REMARKS: Attended Mon–Sat 1300–2200Z‡, Sun 1800–2200Z‡. Heavy agricultural acft ops Mar–Nov. Parallel turf rwy arpt within 3/4 mile NW. Rwy 23 has unmkd p–line 60′ +/– each side of thld with p–line buried acrs rwy width at thld. Addnl unmkd 50′ p–line 1200′ from Rwy 23 thld. Rwy 05 and Rwy 23 mkd with yellow cones. Rwy 5 has 8′ ditch 12′ from thld both sides cntrln.
AIRPORT MANAGER: 252-809-9010
COMMUNICATIONS: CTAF 122.9
CLEARANCE DELIVERY PHONE: For CD ctc Washington ARTCC at 703-771-3587.
COMM/NAV/WEATHER REMARKS: Mnt freq 122.8 for tfc adzy.