
ROCKINGHAM

RICHMOND CO (RCZ)(KRCZ) 3 S UTC–5(–4DT) N34°53.48´ W79°45.58´ **CHARLOTTE**
358 B NOTAM FILE RCZ **H–9C, 12H, L–25E, 35A, 36E**
RWY 14–32: H5001X100 (ASPH) S–30 MIRL **IAP**
RWY 14: PAPI(P2L)—GA 3.0° TCH 24´. Thld dsplcd 150´. Trees.
RWY 32: REIL. PAPI(P2L)—GA 3.0° TCH 40´. Thld dsplcd 201´. Railroad.
RWY 04–22: 3009X490 (TURF) 0.3% up SW
RWY 04: Trees.

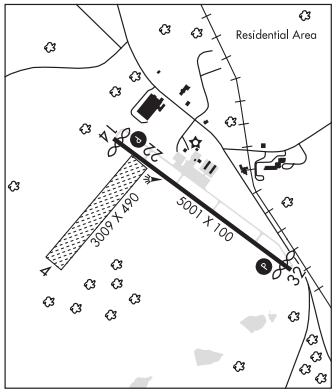

SERVICE: **FUEL** 100LL, JET A1+ **LGT** ACTVT dusk to dawn. REIL Rwy 32; PAPI Rwy 14 and Rwy 32; MIRL Rwy 14–32—CTAF.
AIRPORT REMARKS: Attended Mon–Fri 1300–2200Z‡, unatndd Sat, Sun and Federal Hols. For arpt attendant nights and Sun call 910–997–5071. 100LL and Jet A–24 hr self–svc with credit card. A1+:Jet–A fuel truck avbl. Rwy 04–22 not in use when wet—turbine eng acft and acft over 10k lbs. Call 910–997–5071 for rwy conds bfr ldg. Rwy 14 has 60 ft drop–off 350 ft from dthr all sides. Rwy 32 has nmrs obstns in apch incIng 5 ft fence, 12 ft road, and 20 ft rlrd.
AIRPORT MANAGER: 910-997-5071
WEATHER DATA SOURCES: AWOS–3 118.775 (910) 997–4093.
COMMUNICATIONS: CTAF/UNICOM 122.8
Ⓡ **FAYETTEVILLE APP/DEP CON** 127.8
CLEARANCE DELIVERY PHONE: For CD ctc Washington ARTCC at 703-771-3587.
RADIO AIDS TO NAVIGATION: NOTAM FILE RDU.
SANDHILLS (L) (L) VORTACW 111.8 SDZ Chan 55 N35°12.93´ W79°35.28´ 207° 21.2 NM to fld. 588/3W.
VOR unusable:
075°–143°
144°–154° blo 6,000´
144°–154° byd 23 NM
155°–179° blo 5,000´
180°–264° blo 8,000´
301°–019° byd 10 NM blo 10,000´
DME unusable:
041°–092° blo 3,000´
TAC AZM unusable:
016°–050° byd 28 NM blo 3,000´

ROCKINGHAM CO HELIPORT (See EDEN on page 318)

ROCKINGHAM CO NC SHILOH (See REIDSVILLE on page 361)