
BEAUFORT EXEC (ARW)(KARW) 3 SE UTC–5(–4DT) N32º24.73´ W80º38.06´ **CHARLOTTE**
9 B NOTAM FILE AND **L–24H**
RWY 07–25: H3434X75 (ASPH) S–35, D–52 PCN 13 F/C/X/T MIRL **IAP**
RWY 07: PAPI(P2L)—GA 3.05º TCH 30´. Pole. Rgt tfc.
RWY 25: REIL. PAPI(P2L)—GA 3.0º TCH 25´.

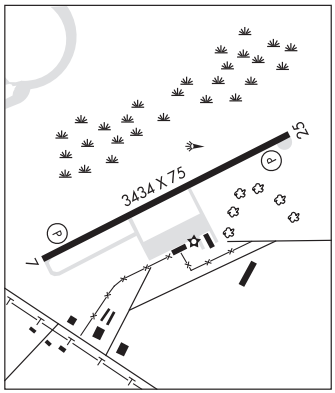

SERVICE: S4 **FUEL** 100LL, JET A **LGT** MIRL Rwy 07–25 preset low intst, to incr intst—CTAF.
AIRPORT REMARKS: Attended 1230–2230Z‡. FBO clsd Christmas and Thanksgiving. Fuel 24 hr credit card svc avbl. Parachute Jumping. Deer, seagulls and geese on and invof arpt. P–lines 100´ lctd 2400´ SW AER 07.
AIRPORT MANAGER: 843-592-1378
WEATHER DATA SOURCES: AWOS–3 119.675 (843) 524–1000.
COMMUNICATIONS: CTAF/UNICOM 122.7
Ⓡ **APP/DEP CON** 125.125 (1200–0400Z‡), Holidays (1500–2300Z‡)
JACKSONVILLE CENTER APP/DEP CON 132.925 (0400–1200Z‡), Holidays (2300–1500Z‡)
CLNC DEL 121.725
CLEARANCE DELIVERY PHONE: For CD ctc Beaufort Apch at 843-228-6298, when Apch clsd ctc Jacksonville ARTCC at 904-845-1592.
RADIO AIDS TO NAVIGATION: NOTAM FILE SAV.
SAVANNAH (VH) (H) VORTACW 115.95 SAV Chan 106(Y)
N32º08.78´ W81º11.95´ 067º 32.8 NM to fld. 22/6W.
DME unusable:
085º–100º byd 39 NM blo 3,000´
126º–132º byd 33 NM blo 3,000´
342º–343º byd 30 NM
TACAN AZIMUTH unusable:
248º–251º byd 31 NM blo 3,000´
342º–343º byd 30 NM
VOR unusable:
042º–047º blo 3,000´
075º–089º byd 40 NM
098º–108º byd 40 NM
126º–130º byd 40 NM
271º–281º byd 40 NM
ASR (Mon–Fri 1100–0500Z‡, Sat 1300–2100Z‡, Sun 2000–0400Z‡)