
COLUMBIA

COLUMBIA METRO (CAE)(KCAE) 5 SW UTC–5(–4DT) N33°56.33′ W81°07.17′ **CHARLOTTE**
236 B LRA Class I, ARFF Index B NOTAM FILE CAE MON Airport **H–9B, 12G, L–24I**
IAP, AD

RWY 11–29: H8601X150 (CONC–GRVD) S–120, D–239, 2S–175, 2D–478, 2D/2D2–700 PCR 740 R/A/W/T HIRL CL
RWY 11: ALSF2. TDZL. PAPI(P4L)—GA 3.0° TCH 71′. RVR–TMR
RWY 29: MALSR. PAPI(P4L)—GA 3.0° TCH 78′. RVR–TMR 0.5% up.
RWY 05–23: H8001X150 (ASPH–CONC–GRVD) S–120, D–242, 2S–175, 2D–487, 2D/2D2–675 PCR 750 R/A/W/T HIRL
RWY 05: MALSR. PAPI(P4R)—GA 3.0° TCH 73′. RVR–T 0.4% down.
RWY 23: REIL. PAPI(P4L)—GA 3.0° TCH 69′. RVR–T Thld dsplcd 1000′. Tree.

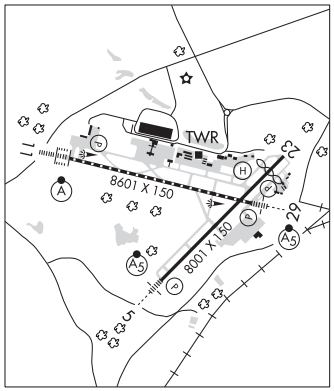

RUNWAY DECLARED DISTANCE INFORMATION
RWY 05: TORA–8001 TODA–8001 ASDA–7001 LDA–7001
RWY 11: TORA–8601 TODA–8601 ASDA–8601 LDA–8601
RWY 23: TORA–8001 TODA–8001 ASDA–8001 LDA–7001
RWY 29: TORA–8601 TODA–8601 ASDA–8506 LDA–8506

SERVICE: S4 **FUEL** 100LL, JET A **OX** 1, 3 **LGT** Rwy 11 ALSF2 also operates as SSALR.
NOISE: Noise abatement proc: No turns blw 1000 ft for turbine eng acft unless dctd by ATC.
AIRPORT REMARKS: Attended continuously. For PPR or other afld related questions please call arpt ops at 803–822–5050. Acft ldg with explosives obtain PPR from arpt ops 803–822–5050. Due to proximity and rwy alnmt aircrews have mistaken CUB (Rwy 13–31) for CAE (Rwy 11–29) which is 6 miles NE. Rwy 05–23 cntr 75 ft is conc, entire len of rwy. Helipad H1 located north of Taxilane E, east of Twy E3. Oprn of ultralight vehicles prohibited. Sports complex with numerous flood lgts aprxly 6500 ft from apch end Rwy 11. Rwy 05 200 ft x 200 ft blast pad. Rwy 11 220 ft x 400 ft blast pad; Rwy 29 220 ft x 400 ft blast pad. Fee for coml acft over 15,000 lbs.
AIRPORT MANAGER: 803-822-5078
WEATHER DATA SOURCES: ASOS (803) 369–6879 LLWAS.
COMMUNICATIONS: ATIS 120.15 **UNICOM** 122.95
Ⓡ **COLUMBIA APP/DEP CON** 124.15 (110°–289°) 133.4 (290°–109°)
TOWER 119.5 **GND CON** 121.9 **CLNC DEL** 119.75
AIRSPACE: CLASS C svc ctc **APP CON**.
RADIO AIDS TO NAVIGATION: NOTAM FILE CAE.
(VH) (H) VORTACW 114.7 CAE Chan 94 N33°51.44′ W81°03.23′ 328° 5.9 NM to fld. 404/2W.
VOR unusable:
000°–073° byd 35 NM blo 6,000′
200°–234° byd 12 NM blo 3,000′
235°–245° byd 12 NM blo 6,000′
246°–289° byd 12 NM blo 3,000′
290°–305° byd 12 NM blo 2,400′
306°–344° byd 30 NM
345°–359° byd 10 NM blo 5,000′
ILS 108.95 I–GJC Rwy 05. Class IE.
ILS/DME 110.3 I–CAE Chan 40 Rwy 11. Class IIIE.
ILS 108.3 I–VYK Rwy 29. Class IE.

HELIPAD H1: H50X50 (CONC) PERIMETER LGTS