
LANCASTER

KIRK AIR BASE (T73) 5 SE UTC–5(–4DT) N34°40.46′ W80°40.94′ **CHARLOTTE**
578 NOTAM FILE AND
RWY 15–33: H2600X40 (ASPH) S–8 LIRL
RWY 33: Tree.
SERVICE: S4 **FUEL** 100LL **LGT** For LIRL Rwy 15–33 call 803–286–8800.
AIRPORT REMARKS: Attended 1300–2330Z‡. Rwy 15 has 30′ drop at thld. Rwy 33 has 10′ drop at thld.
AIRPORT MANAGER: 803-286-8800
COMMUNICATIONS: CTAF 122.9
CLEARANCE DELIVERY PHONE: For CD ctc Charlotte Apch at 704-359-0241.

• • • • • • • • • • • • • • • • • • •

WATERWAY 05W–23W: 4400X300 (WATER)
WATERWAY 16W–34W: 3000X300 (WATER)
WATERWAY 11W–29W: 2245X600 (WATER)
SEAPLANE REMARKS: Waterways 05–23, 11–29 and 16–34 water lanes are not marked, lengths change with water levels ctc arpt mgr and check NOTAM′s.

LANCASTER CO–MC WHIRTER FLD (LKR)(KLKR) 4 W UTC–5(–4DT) N34°43.37′ **CHARLOTTE**
W80°51.28′ **H–9B, 12G, L–24J, 25D, 36E**
486 B NOTAM FILE AND **IAP**
RWY 06–24: H6004X101 (CONC) S–44, D–60,
2D–118 PCN 15 R/B/X/T MIRL 0.4% up NE
RWY 06: REIL. PAPI(P2L)—GA 3.0° TCH 41′. Thld dsplcd 105′. Tree.
RWY 24: REIL. PAPI(P2L)—GA 3.15° TCH 39′. Tree.
SERVICE: **FUEL** 100LL, JET A **LGT** ACTVT REIL Rwy 06 & 24; MIRL Rwy 06–24—CTAF. PAPI Rwy 06 and Rwy 24 opr consly.
AIRPORT REMARKS: Attended 1230–2000Z‡. Deer on and invof arpt. For fuel after hrs call 803–285–1513. 25′ drop, 250′ fm thr Rwy 06. Small acft must be on a tie down. Arl applicators not pmtd due to pavement conds. Lndg fee.
AIRPORT MANAGER: (803) 285-1513
WEATHER DATA SOURCES: AWOS–3 120.825 (803) 286–6444.
COMMUNICATIONS: CTAF/UNICOM 122.725
Ⓡ **CHARLOTTE APP/DEP CON** 120.05
GCO 121.725 (CHARLOTTE APCH)
CLEARANCE DELIVERY PHONE: For CD ctc Charlotte Apch at 704-359-0241.
RADIO AIDS TO NAVIGATION: NOTAM FILE CLT.
CHARLOTTE (L) (L) VORW/DME 115.0 CLT Chan 97 N35°11.42′ W80°57.11′ 175° 28.4 NM to fld. 732/5W.
DME portion unusable:
015°–050° byd 25 NM blo 3,000′
050°–100° byd 25 NM blo 2,500′
185°–202° byd 15 NM
203°–220°
270°–350° byd 20 NM blo 5,000′
VOR/DME controlled by Charlotte ATCT
VOR unusable:
203°–220°

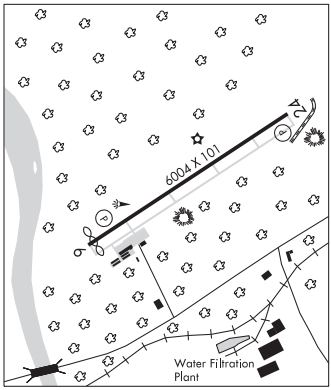

LANDRUM

FAIRVIEW (33A) 3 SE UTC–5(–4DT) N35°09.44′ W82°07.43′ **ATLANTA**
1046 NOTAM FILE AND
RWY 14–32: H2770X30 (ASPH) S–6.5 LIRL 0.4% up NW
RWY 14: Pole. Rgt tfc.
RWY 32: Pole.
SERVICE: **LGT** ACTVT LIRL Rwy 14–32—CTAF.
AIRPORT REMARKS: Unattended. Twy markings are of wrong color. Rwy 14–32 is very bumpy with excessive patches along entire sfc length. Rwy 14–32 mult asph patches and uneven sfc.. Caution should be used to land at this airfield.
AIRPORT MANAGER: 864-684-8610
COMMUNICATIONS: CTAF 122.9
CLEARANCE DELIVERY PHONE: For CD ctc Greer Apch at 864-877-8275. When Greer Apch clsd, for CD ctc Atlanta ARTCC at 770-210-7692.