ISLA DE VIEQUES

ANTONIO RIVERA RODRIGUEZ (VQS)(TJVQ) 3 SW UTC–4 N18°08.09´ W65°29.62´ **PUERTO RICO–VIRGIN ISLANDS**
48 B LRA NOTAM FILE TJSJ **L–5C, 6G, A–3G**
IAP

RWY 09–27: H4294X75 (ASPH) S–20, D–40 MIRL 0.6 % up W
RWY 09: PAPI(P4L)—GA 3.0° TCH 45´. Thld dsplcd 200´. Trees.
RWY 27: Road. Rgt tfc.

RUNWAY DECLARED DISTANCE INFORMATION
RWY 09: TORA–4294 TODA–4294 ASDA–4294 LDA–4094
RWY 27: TORA–4294 TODA–4294 ASDA–4294 LDA–4094

SERVICE: **LGT** Rwy 09 PAPI byd 9 deg R of RCL unusbl.

AIRPORT REMARKS: Attended 1000–2200Z. VFR opns only. Rising terrain south. Acft not visible from opposite rwy end. Clsd to sked air carrier oper with more than 9 psgr seats and unsked air carrier oper with more than 30 psgr seats. PPR for other B–III acft and max wingspan of 88.75 ft, ctc AMGR. AMGR aftr hrs ph 787–439–5941. Const of twy south of Rwy 09–27. Loose stones all sfcs. Ldg fee for all acft.


AIRPORT MANAGER: 787-741-0585

COMMUNICATIONS: CTAF/UNICOM 123.0
Ⓡ **SAN JUAN CERAP** 128.65

CLEARANCE DELIVERY PHONE: For CD ctc San Juan CERAP at 787-253-8664/8665

RADIO AIDS TO NAVIGATION: NOTAM FILE TIST.
ST THOMAS (L) (L) VORW/DME 108.6 STT Chan 23 N18°21.35´ W65°01.47´ 254° 29.9 NM to fld. 679/10W.
VOR unusable:
060°–070° byd 35 NM blo 2,200´
085°–115° byd 16 NM blo 7,500´
160°–175° byd 35 NM blo 2,500´
255°–265° byd 25 NM
290°–305° byd 15 NM
DME unusable:
085°–115° byd 30 NM blo 7,500´

COMM/NAV/WEATHER REMARKS: UNICOM monitored during attendance hrs.

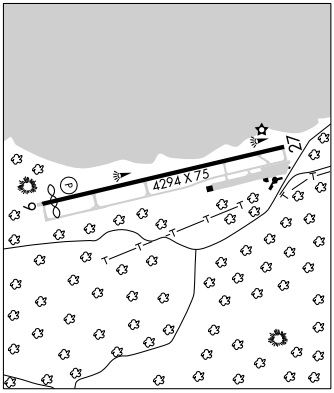

JOSE APONTE DE LA TORRE (See CEIBA on page 481)

LUIS MUNOZ MARIN INTL (See SAN JUAN on page 487)