
MARION

VAIDEN FLD (AØ8) 8 SW UTC–6(–5DT) N32°30.63′ W87°23.09′ **ATLANTA**
220 B NOTAM FILE ANB **H–6K, 9A, 12F, L–18H**
RWY 16–34: H6400X80 (ASPH) S–30, D–50 MIRL **IAP**
RWY 16: PAPI(P2L)—GA 3.0° TCH 40′. Tree.
RWY 34: PAPI(P2L)—GA 3.0° TCH 40′.
SERVICE: **LGT** All airfield lighting currently inoperable. Arpt bcn currently inoperable. Rwy 16–34 lgts lctd 10′ from rwy edge.
AIRPORT REMARKS: Unattended. Rwy 16–34, 80′ overlay, side transitions smooth. Rwy 16 and 34 markings svrly faded or obsc.
AIRPORT MANAGER: 734-250-4119
COMMUNICATIONS: CTAF 122.9
Ⓡ **ATLANTA CENTER APP/DEP CON** 132.25
CLEARANCE DELIVERY PHONE: For CD ctc Atlanta ARTCC at 770-210-7692.
RADIO AIDS TO NAVIGATION: NOTAM FILE ANB.
BROOKWOOD (L) (L) VORTACW 111.0 OKW Chan 47 N33°14.27′ W87°14.99′ 189° 44.1 NM to fld. 655/0E.
VOR unusable:
015°–035° byd 5 NM blo 4,900′
035°–070° byd 5 NM blo 3,400′
155°–165° byd 20 NM blo 4,900′
195°–205° byd 15 NM blo 9,900′
195°–205° byd 5 NM blo 4,900′
270°–320° byd 30 NM blo 4,900′
320°–015° byd 20 NM blo 4,900′
DME unusable:
344°–011° byd 34 NM

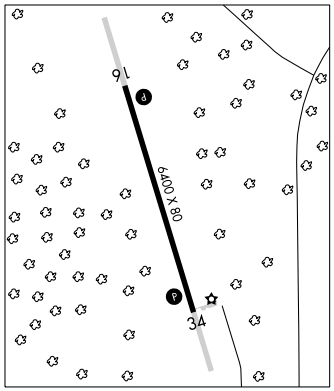

MARION CO–RANKIN FITE (See HAMILTON on page 58)

MARK REYNOLDS/NORTH MOBILE CO (See CREOLA on page 45)

MARRA N32°18.70′ W86°30.64′ NOTAM FILE MGM. **ATLANTA**
NDB (MHW) 245 MG 097° 6.0 NM to Montgomery Rgnl (Dannelly Fld). 240/1W. **L–18I**