

BAKERSFIELD

BAKERSFIELD MUNI (L45) 3 S UTC–8(–7DT) N35°19.49´ W118°59.76´ **LOS ANGELES**
378 B TPA—1178(800) NOTAM FILE RIU **L–3D, 7B**
RWY 16–34: H4000X75 (ASPH) S–20 MIRL **IAP**
RWY 16: REIL. Road. Rgt tfc.
RWY 34: REIL. PAPI(P2L)—GA 4.1° TCH 53´. P–line.
SERVICE: S4 **FUEL** 100LL, JET A **LGT** ACTVT REIL Rwy 16 and Rwy 34; MIRL Rwy 16–34—CTAF. PAPI Rwy 34 oper consly. ACTVT MIRL Rwy 16–34 three clicks for on; lgts go out after 15 minutes.
AIRPORT REMARKS: Attended 1500–0100Z‡. Full service using fuel truck. 100´ pole line 1/2 mile south of arpt.
AIRPORT MANAGER: 661-326-3781
COMMUNICATIONS: CTAF/UNICOM 122.8
Ⓡ **BAKERSFIELD APP/DEP CON** 126.45 (1400–0700Z‡)
Ⓡ **L.A. CENTER APP/DEP CON** 127.1 (0700–1400Z‡)
CLEARANCE DELIVERY PHONE: For CD ctc Los Angeles ARTCC at 661-575-2079.
RADIO AIDS TO NAVIGATION: NOTAM FILE BFL.
SHAFTER (VH) (H) VORTACW 115.4 EHF Chan 101 N35°29.07´ W119°05.84´ 139° 10.8 NM to fld. 549/14E.
VOR unusable:
029°–106° byd 40 NM
108°–131° byd 40 NM
132°–142° byd 40 NM blo 10,000´
132°–142° byd 70 NM
153°–180° byd 40 NM
232°–249° byd 40 NM
327°–347° byd 40 NM blo 9,000´
327°–347° byd 67 NM blo 18,000´

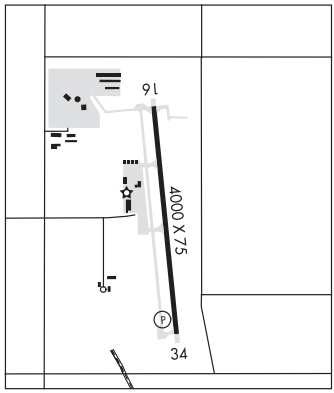

MEADOWS FLD (BFL)(KBFL) 3 NW UTC–8(–7DT) N35°26.03´ W119°03.46´ **LOS ANGELES**
510 B ARFF Index—See Remarks NOTAM FILE BFL **H–4H, L–3D, 7B**
RWY 12L–30R: H10849X150 (ASPH–GRVD) S–96, D–155, 2S–175, 2D–260, 2D/2D2–654 PCR 396 F/B/X/T HIRL **IAP, AD**
RWY 12L: PAPI(P4L)—GA 3.0° TCH 50´. RVR–TMR 0.4% down.
RWY 30R: MALSR. TDZL. PAPI(P4L)—GA 3.0° TCH 51´. RVR–TMR Thld dsplcd 3419´. Rgt tfc. 0.3% up. CL
RWY 12R–30L: H7700X100 (ASPH) S–18 PCR 127 F/B/X/T MIRL 0.3% up NW No Part 121/Part 380 Ops
RWY 12R: REIL. PAPI(P4L)—GA 3.0° TCH 25´. Rgt tfc.
RWY 30L: REIL. PAPI(P4L)—GA 3.0° TCH 25´. Thld dsplcd 1499´. Tree.
RUNWAY DECLARED DISTANCE INFORMATION
RWY 12L: TORA–10849 TODA–10849 ASDA–10849 LDA–10849
RWY 12R: TORA–7703 TODA–7703 ASDA–7703 LDA–7703
RWY 30L: TORA–7703 TODA–7703 ASDA–7703 LDA–6203
RWY 30R: TORA–10849 TODA–10849 ASDA–10849 LDA–7430
SERVICE: S4 **FUEL** 100, 100LL, JET A **OX** 4 **LGT** When ATCT clsd ACTIVATE MALSR Rwy 30R; PAPI Rwy 12L and 30R; HIRL Rwy 12L–30R; twy lgts—CTAF. Rwy 12R–30L clsd when ATCT clsd. Rwy cntrln lgts are only vsb on Rwy 30R.
NOISE: Noise sensitive areas South and East of arpt recommended turbojet trng hrs weekdays 1600–0600Z‡, weekends 2000–0600Z‡ no more than ten practice apchs per hr.
AIRPORT REMARKS: Attended continuously. Rwy 12R–30L CLOSED when twr clsd. Right base ops for Rwy 30R establish wings level on final apch no lower than 300´ AGL. Arpt ops not authorized blo 1200 RVR without SMGCS. Arpt ops not initiated blo 600 RVR or authorized blo 500 RVR. Rwy 30R 50:1 to dspld thld. Class I, ARFF Index B. Index C ARFF avbl. Landing fee chrgd to all air taxi, coml acft ops (exc flt instrn), and tsnt acft weighing more than 10000 lbs.
AIRPORT MANAGER: 661-747-4053
WEATHER DATA SOURCES: ASOS (661) 246–3170
COMMUNICATIONS: CTAF 118.1 **ATIS** 118.6 661–679–0191 **UNICOM** 122.95
Ⓡ **BAKERSFIELD APP CON** 118.9 (North) 118.8 (South) 119.075 (1400–0700Z‡)
Ⓡ **BAKERSFIELD DEP CON** 126.45 (North/South) 119.075 (1400–0700Z‡)
Ⓡ **L.A. CENTER APP/DEP CON** 127.1 (0700—1400Z‡)
BAKERSFIELD TOWER 118.1 (1400–0700Z‡) **GND CON** 121.7
AIRSPACE: CLASS D svc 1400–0700Z‡; other times CLASS E.

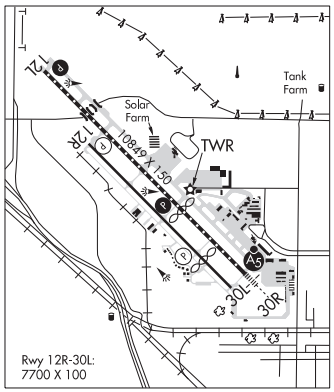


CONTINUED ON NEXT PAGE

CONTINUED FROM PRECEDING PAGE

VOR TEST FACILITY (VOT) 111.2
RADIO AIDS TO NAVIGATION: NOTAM FILE BFL.
SHAFTER (VH) (H) VORTACW 115.4 EHF Chan 101 N35º29.07´ W119º05.84´ 133º 3.6 NM to fld. 549/14E.
VOR unusable:
029º–106º byd 40 NM
108º–131º byd 40 NM
132º–142º byd 40 NM blo 10,000´
132º–142º byd 70 NM
153º–180º byd 40 NM
232º–249º byd 40 NM
327º–347º byd 40 NM blo 9,000´
327º–347º byd 67 NM blo 18,000´
ILS/DME 111.9 I–BFL Chan 56 Rwy 30R. Class IE. Unmonitored when ATCT clsd. LOC unusable byd 25º left and right of course.

BANNING MUNI (BNG)(KBNG) 1 SE UTC–8(–7DT) N33º55.35´ W116º51.06´ **LOS ANGELES L–4H**
2222 B NOTAM FILE RAL
RWY 08–26: H4955X100 (ASPH) S–12.5 MIRL 2.4% up W
RWY 26: PAPI(P2L)—GA 3.5º. Rgt tfc.
SERVICE: FUEL 100LL **LGT** ACTIVATE MIRL Rwy 08–26—CTAF.
AIRPORT REMARKS: Attended Mon–Fri 1700–2330Z‡. For arpt attendant call 951–922–3320. Fuel avbl with 24 hr self svc credit card. Fuel apn not level and acft may not fill completely. No intersection tkfs to the west. Rwy 08–26 no straight–in ldgs. Parachute jumping.
AIRPORT MANAGER: 951-922-4832
WEATHER DATA SOURCES: AWOS–3 134.625 (951) 922–4674.
COMMUNICATIONS: CTAF/UNICOM 122.8

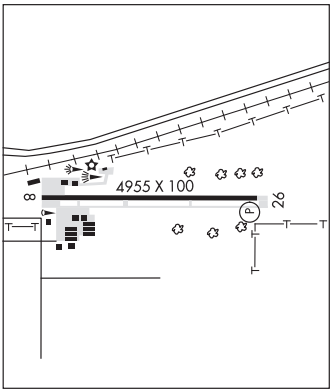

CONTINUED ON NEXT PAGE