
NEW COALINGA MUNI (C8Ø) 3 E UTC–8(–7DT) N36º09.73´ W120º17.69´ **SAN FRANCISCO**
625 B NOTAM FILE RIU **H–4H, L–3C**
RWY 12–30: H5000X100 (ASPH) S–30 MIRL 0.5% up NW **IAP**
RWY 12: REIL. PAPI(P2L)—GA 3.0º TCH 40´.
RWY 30: REIL. PAPI(P2L)—GA 3.0º TCH 40´. Rgt tfc.
RWY 01–19: H2471X60 (ASPH–GRVL) S–12.5
RWY 19: Rgt tfc.
SERVICE: **LGT** REIL Rwys 12 and 30; MIRL Rwy 12–30; Perimeter lgts H1 on dusk—0800Z‡; after 0800Z‡ ACTVT—CTAF. PAPI Rwys 12 and 30 opr consly. Rwy 30 VGSI OTS.
AIRPORT REMARKS: Attended irregularly. Rwy 01–19 clsd. Rwy 01–19 rwy sfc failed with potholes and brush. Rwy 12 markings has crack seal covers much of the runway centerline.
AIRPORT MANAGER: 559-246-6243
WEATHER DATA SOURCES: AWOS–3 119.275 (559) 935–5960.
COMMUNICATIONS: CTAF/UNICOM 122.7
Ⓡ **OAKLAND CENTER APP/DEP CON** 128.7
CLEARANCE DELIVERY PHONE: For CD ctc Oakland ARTCC at 510-745-3380.
RADIO AIDS TO NAVIGATION: NOTAM FILE PRB.
PASO ROBLES (VL) (L) VORTACW 114.3 PRB Chan 90 N35º40.35´ W120º37.63´ 013º 33.5 NM to fld. 817/16E.
TACAN AZIMUTH unusable:
120º–140º byd 27 NM blo 8,000´
DME unusable:
120º–140º byd 27 NM blo 8,000´
VOR unusable:
128º–138º byd 40 NM blo 6,000´
128º–138º byd 46 NM
139º–283º byd 40 NM
290º–295º byd 40 NM
325º–127º byd 40 NM
COMM/NAV/WEATHER REMARKS: AWOS OTS.

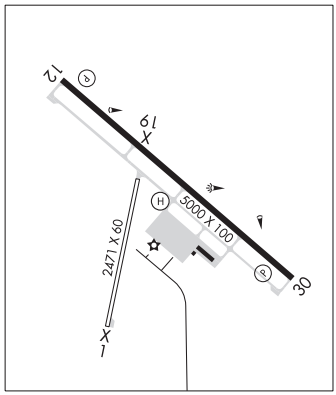

HELIPAD H1: H50X50 (ASPH) PERIMETER LGTS