

HOLLISTER**FRAZIER LAKE AIRPARK** (1C9) 8 NW UTC-8(-7DT) N36°57.17' W121°27.76'**SAN FRANCISCO**

152 NOTAM FILE OAK

RWY 05-23: 2500X100 (TURF) LIRL**RWY 05:** P-line.**RWY 23:** REIL. Rgt tfc.**SERVICE:** LGT ACTIVATE REIL Rwy 23; LIRL Rwy 05-23—CTAF. Rwy 23 REIL opr consistently during daylight hours. During ngt hrs ACTIVATE REIL Rwy 23—CTAF 7 clicks.**AIRPORT REMARKS:** Unattended. No touch and go ops. Birds frequently on and in/ovf arpt. Wildlife haz near movement area. Use at your own risk. Rwy 05-23 irregular sfc. Be alert to seaplane ldg area (water channel) 200' south of adjacent/parallel grass rwy. Berm and ditch adjacent to Rwy 05 apch end. PAEW in vicinity of Rwy 05-23 occasionally during daylight hrs. Rwy clsd by NOTAM for mowing, typically Mon. Equipment on rwy during mowing ops. Utility wires across west end of afld for apch to Rwy 05 and waterway 5W. Occasional irrigation on turf rwy at night from midnight to 1400Z±. No midfield tkfs or back-taxi on Rwy 05-23. No practice tkf and ldg Rwy 05-23 when wet or soft. Rwy 05-23 gross weight ltd to 6,700 pounds.**AIRPORT MANAGER:** 408-242-2492**COMMUNICATIONS:** CTAF/UNICOM 123.05**CLEARANCE DELIVERY PHONE:** For CD ctc NorCal Apch at 916-361-3748.

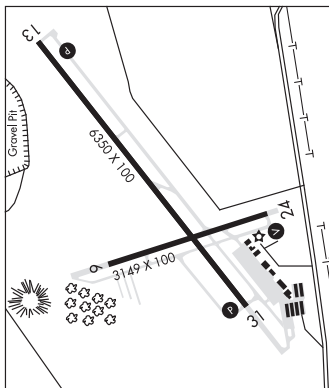
.

WATERWAY 05W-23W: 3000X60 (WATER)**WATERWAY 05W:** P-line.**WATERWAY 23W:** Rgt tfc.**SEAPLANE REMARKS:** Typical water depth 2.5'. Water depth noted as shallow as 1.5' deep. Not marked. Ramp & dock facilities avbl.**HOLLISTER MUNI** (CVH)(KCVH) 3 N UTC-8(-7DT) N36°53.60' W121°24.62'**SAN FRANCISCO**

231 B TPA—See Remarks NOTAM FILE OAK

H-3B, L-3B**RWY 13-31:** H6350X100 (ASPH) S-30, D-45 MIRL 0.4% up SE**IAP****RWY 13:** REIL. PAPI(P2L)—GA 3.0° TCH 44'.**RWY 31:** REIL. PAPI(P2L)—GA 3.0° TCH 44'.**RWY 06-24:** H3149X100 (ASPH) S-30, D-45 MIRL**RWY 06:** Hill.**RWY 24:** REIL. VASI(V2L)—GA 3.75° TCH 26'. Road.**SERVICE:** S4 FUEL 100LL, JET A LGT ACTIVATE REIL Rwy 24, Rwy 13, and Rwy 31; VASI Rwy 24; PAPI Rwy 13 and Rwy 31; MIRL Rwy 06-24 and Rwy 13-31—CTAF.**AIRPORT REMARKS:** Attended 1600-0100Z±. Fuel avbl 24 hours credit card lock system. Glider activity on and in/ovf arpt. Model acft club conducting flt ops 3 miles west northwest of arpt heading of 290° from arpt sfc to 500' AGL. Recommend pilots to begin Rwy 31 tkf roll at or byd the thld (Twy B). Caution—Watch for fire fighting acft May thru Oct. TPA—1031(800), helicopters 731(500).**AIRPORT MANAGER:** 831-636-4365**WEATHER DATA SOURCES:** AWOS-3 120.425 (831) 636-4394.**COMMUNICATIONS:** CTAF/UNICOM 123.0

® NORCAL APP/DEP CON 124.525

**CONTINUED ON NEXT PAGE**

CONTINUED FROM PRECEDING PAGE

CLEARANCE DELIVERY PHONE: For CD ctc NorCal Apch at 916-361-3748.

RADIO AIDS TO NAVIGATION: NOTAM FILE SNS.

SALINAS (VH) (H) VORTACW 117.3 SNS Chan 120 N36°39.83' W121°36.19' 017° 16.6 NM to fld. 81/17E.

VOR unusable:

010°-016° byd 22 NM blo 7,000'
010°-016° byd 26 NM blo 8,000'
016°-080° byd 22 NM blo 8,000'
109°-119° byd 40 NM blo 6,000'
109°-119° byd 58 NM
135°-250° byd 40 NM
150°-170° byd 8 NM blo 10,000'
295°-302° byd 40 NM
303°-313° byd 40 NM blo 18,000'
314°-338° byd 40 NM
339°-349° byd 40 NM blo 18,000'
350°-108° byd 40 NM

TACAN AZIMUTH unusable:

010°-080° byd 22 NM blo 8,000'
150°-200° blo 11,000'
245°-255° byd 20 NM

Aerobatic acft wi an area defined as .5 NM rds of SNS 357016.4 (5.3 NM W CVH), blo 3000', avoidance advised SR-SS

DME unusable:

010°-080° byd 22 NM blo 8,000'
150°-200° blo 11,000'

HOLLYWOOD BURBANK (See BURBANK on page 126)

HOMELAND N33°46.58' W117°11.12' NOTAM FILE RAL.

LOS ANGELES

(VL) **VORW** 112.05 HDF 316° 7.3 NM to March Arb. 1416/14E.

COPTER

VOR unusable:

017°-030° byd 35 NM blo 15,500'
031°-154° byd 40 NM
155°-155° byd 24 NM
156°-189° byd 40 NM
190°-207° byd 20 NM
208°-284° byd 40 NM
298°-016° byd 40 NM

L-4H, A

HOOPA (021) 1 SE UTC-8(-7DT) N41°02.49' W123°40.07'

KLAMATH FALLS

356 TPA-1156(800) NOTAM FILE OAK

RWY 14-32: H2325X50 (ASPH) S-10

RWY 14: Thld dsplcd 80'. Trees. Rgt tfc.

RWY 32: Thld dsplcd 80'. Trees. Rgt tfc.

AIRPORT REMARKS: Unattended. Day use only; CLOSED ngts. Wind indicator obscured by trees.

AIRPORT MANAGER: (707) 601-8035

COMMUNICATIONS: CTAF 122.9

CLEARANCE DELIVERY PHONE: For CD ctc Seattle ARTCC at 253-351-3694.

HUNTER LIGGETT (See TUSI AHP (HUNTER LIGGETT) on page 308)

HYAMPOM (H47) 1 NW UTC-8(-7DT) N40°37.54' W123°28.11'

KLAMATH FALLS

1277 TPA-2077(800) NOTAM FILE OAK

RWY 14-32: H2980X60 (ASPH) S-12 0.3% up SE

RWY 14: Rgt tfc.

RWY 32: Thld dsplcd 725'. Trees.

AIRPORT REMARKS: Unattended. Arpt CLOSED ngts. High terrain all quadrants. Intermittently clsd winters due to snow. Ctc county transportation office for information 530-623-1365.

AIRPORT MANAGER: 530-623-1365

COMMUNICATIONS: CTAF/UNICOM 122.8

CLEARANCE DELIVERY PHONE: For CD ctc Oakland ARTCC at 510-745-3380.
