

IMPERIAL BEACH NOLF (REAM FLD) (NRS)(KNRS) NAF 1 S UTC-8(-7DT) N32°33.97' W117°06.81'

LOS ANGELES
L-4H
DIAP, AD

23 B NOTAM FILE SAN Not insp.

RWY 09-27: H4998X336 (PEM) PCN 11 F/A/W/T HIRL

RWY 08-26: H2241X151 (CONC) PCN 8 R/C/W/T

SERVICE: **MILITARY—** **FUEL J5** (Avbl 1900-0500Z± Mon-Thu; 1800-0200Z± Fri.).

MILITARY REMARKS: Opr Mon-Thu 1600-0630Z (1500-0600Z DT) and Fri 1600-0200Z±. CLOSED from 0200Z± day prior until 1600Z± day following government holiday; except pre-coordinated flt of opr necessity. For CALP info ctc airfield mgr 619-545-8261. Ctc NOLF ATC DSN 577-9414/9415 for opr inquiries. **RSTD** Official Business Only — PPR fixed wing and non-tenant acft, ctc NASNI ODO DSN 735-8233/8234, C619-545-8233/8234. North Island Tenant acft and Coast Guard have priority for lcl pattern opr. Practice apch not authorized Rwy 09. **CAUTION** Extensive helicopter training.

MISC Rwy 08-26 avbl for day and night copter use only (night and SVFR use at pilots own risk).

WEATHER DATA SOURCES: ASOS (619) 437-9890 Dsn 577-9890

COMMUNICATIONS: ATIS 276.2 (1600-0630Z Mon-Thu (1500-0600Z DT) and 1600-0200Z± Fri. Clsd Fri 0200Z± day prior until 1600Z± day following govt hol.

® **SOCAL APP/DEP CON** 125.15 317.55

TOWER 120.65 239.25 (1600-0630Z Mon-Thu (1500-0600Z DT) and 1600-0200Z± Fri. Clsd from 0200Z± day prior until 1600Z± day following govt hol.)

GND CON 285.575

CLEARANCE DELIVERY PHONE: For CD when ATCT clsd ctc SoCal Apch at 800-448-3724.

AIRSPACE: CLASS D svc 1600-0630Z± Mon-Thu (1500-0600Z dt), 1600-0200Z± Fri, clsd from 0200Z± day prior til 1600Z± day following govt hol; other times CLASS G.

RADIO AIDS TO NAVIGATION: NOTAM FILE SAN.

(L) **TACAN** Chan 29 NRS (109.2) N32°33.85' W117°06.59' at fld. 21/11E.

mnt only dur fld opr hrs

TACAN AZIMUTH unusable:

225°-230°

DME unusable:

225°-230°

IMPERIAL CO (IPL)(KIPL) 1 S UTC-8(-7DT) N32°50.05' W115°34.73' -54 B NOTAM FILE IPL MON Airport

PHOENIX
H-4I, L-4I
IAP, AD

RWY 14-32: H5308X100 (ASPH-PFC) S-60, D-80, 2S-102, 2D-102,

2D/2D2-130 PCR 183 F/D/W/T MIRL

RWY 14: PAPI(P4L)—GA 3.0° TCH 45'. Fence.

RWY 32: PAPI(P4L)—GA 3.0° TCH 45'. Road. Rgt tfc.

RWY 08-26: H4501X75 (ASPH) S-50, D-50 PCR 177 F/D/W/T MIRL

No Part 121/Part 380 Ops

RWY 08: PAPI(P4L)—GA 3.0° TCH 45'. P-line.

RWY 26: PAPI(P4L)—GA 3.0° TCH 45'. Pole. Rgt tfc.

RUNWAY DECLARED DISTANCE INFORMATION

RWY 08: TORA-4501 TODA-4501 ASDA-4501 LDA-4501

RWY 14: TORA-5308 TODA-5308 ASDA-5308 LDA-5308

RWY 26: TORA-4501 TODA-4501 ASDA-4501 LDA-4501

RWY 32: TORA-5308 TODA-5308 ASDA-5308 LDA-5308

SERVICE: **FUEL** 100LL, JET A **LGT** ACTVT MIRL Rwy 08-26 and 14-32—CTAF.

NOISE: Noise sensitive area NE edge of arpt: schools and residential.

Conditions permitting, helicopter arrivals should be to Rwy 32, touchdown midfield (between Twy A4 and A3). Helicopter departures should be from Rwy 14 midfield. When conditions require Rwy 32 departures, maintain rwy centerline for 1.5 NM before initiating turn.

For helicopter turning patterns/autorotations use Rwy 08-26, max of 3 circuits. Between SS-SR avoid construction pattern circuits.

AIRPORT REMARKS: Attended 1500-0030Z±. Twy C3 clsd between Rwy 14-32 and Twy C5. In VFR conds, avoid NAF El Centro tfc; acft depg KIPL Rwy 26 make an imt right turn and stay below 1000'; ctc NAF twr 119.1 for adzy. Frequent high-speed military jet tfc transits Imperial Co tfc area westbound descending VFR to NAF El Centro. Avoid 2500' to 3500' MSL near Imperial Co. Ctc NAF Twr 119.1 for Navy tfc advisory. Radio antenna +70' located on ctl twr at midfield Rwy 14-32 and 500' west rwy centerline. PPR for non-scheduled air carrier ARFF svc, ctc arpt manager 442-264-3220. Overnight tiedown fee. Ldg fee.


AIRPORT MANAGER: 760-996-2109

WEATHER DATA SOURCES: ASOS 132.175 (760) 355-2851.

COMMUNICATIONS: CTAF/UNICOM 122.7

® **YUMA APP/DEP CON** 132.275

CLEARANCE DELIVERY PHONE: For CD ctc Yuma CERAP at 928-269-9569.

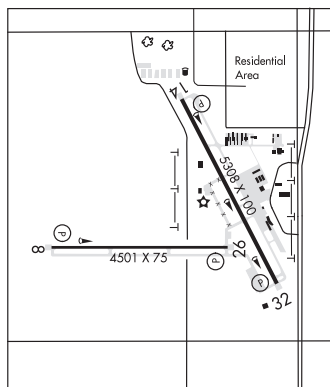

CONTINUED FROM PRECEDING PAGE

AIRSPACE: CLASS E.

RADIO AIDS TO NAVIGATION: NOTAM FILE IPL.

(VH) (H) VORTACW 115.9 IPL Chan 106 N32°44.93' W115°30.51' 311° 6.2 NM to fld. -18/14E.

VOR unusable:

001°-052° byd 40 NM

240°-252° byd 40 NM

253°-267° byd 40 NM blo 8,400'

253°-267° byd 54 NM

274°-284° byd 40 NM

INDEPENDENCE (207) 1 N UTC-8(-7DT) N36°48.98' W118°12.30'**SAN FRANCISCO**

3908 TPA-4708(800) NOTAM FILE RAL

L-9A**RWY 14-32:** H3533X60 (ASPH) S-20 MIRL**RWY 14:** Fence.**RWY 32:** Trees. Rgt tfc.**RWY 05-23:** 1498X30 (DIRT) 1.9% up SW**RWY 05:** Road.**RWY 23:** Fence.**SERVICE:** LGT ACTIVATE MIRL Rwy 14-32-CTAF.

AIRPORT REMARKS: Unattended. Rwy 05-23 clsd for public use. Rwy 05-23 unsafe for acft. Rwy 05-23 rstd can be used only during extreme crosswind conditions. Tfc pat indicators for Rwy 14-32 only. Rwy 14-32 extsv cracks on the north end of the rwy. Rwy 05-23 marked with an R on each end, no numbers or centerline markings. Rwy 05-23 undulating uneven dirt sfc. Brush in sporadic locations on rwy. Rwy 05-23 sfc uneven, rough, undulating with extsv brush. Unsafe for acft use.

AIRPORT MANAGER: 760-872-2971**COMMUNICATIONS:** CTAF 122.9**CLEARANCE DELIVERY PHONE:** For CD etc Joshua Apch at 661-277-3843.

RADIO AIDS TO NAVIGATION: NOTAM FILE BIH.

BISHOP (VL) (L) VORW/DME 113.35 BIH Chan 80(Y) N37°22.62' W118°21.99' 152° 34.5 NM to fld.
4117/15E.

VOR unusable:

136°-143° byd 40 NM

157°-164° byd 40 NM

165°-285° byd 12 NM

286°-304° byd 40 NM

305°-315° byd 35 NM

316°-342° byd 40 NM

340°-135° byd 12 NM

DME unusable:

165°-285° byd 12 NM

305°-315° byd 35 NM

340°-135° byd 12 NM