
FORT MORGAN MUNI (FMM)(KFMM) 5 N UTC–7(–6DT) N40°20.13′ W103°48.25′ **CHEYENNE**
4595 B TPA—5626(1031) NOTAM FILE DEN **H–5A, L–10F**
RWY 14–32: H5731X75 (ASPH) S–30 MIRL 1.5% up NW **IAP**
RWY 14: REIL. PAPI(P2L)—GA 3.0° TCH 28′.
RWY 32: REIL. PAPI(P2L)—GA 3.0° TCH 27′. Road.
RWY 17–35: 5216X80 (TURF–DIRT) 0.6% up N
RWY 35: Road.
RWY 08–26: 2468X100 (TURF)
RWY 26: Road.
SERVICE: **FUEL** 100LL, JET A1 **LGT** ACTIVATE REIL Rwy 14 and Rwy 32; MIRL Rwy 14–32—CTAF.
AIRPORT REMARKS: Attended Mon–Sat 1500–0000Z‡. Fuel avbl 24 hrs with credit card. Parachute Jumping. Be alert, intensive USAF student training invof Colorado Springs and Pueblo Colorado. Rwy 17–35, 21 road 100′ east of and parallel to rwy cntrln full length. NOTE: See Special Notices—Aerobatic Operations in Colorado. USAF 306 FTG Flight Training Areas, Vicinity of Colorado Springs and Pueblo Colorado.
AIRPORT MANAGER: 970-867-8414
WEATHER DATA SOURCES: AWOS–3PT 132.95 (970) 867–1992.
COMMUNICATIONS: CTAF/UNICOM 123.05
Ⓡ **DENVER CENTER APP/DEP CON** 118.475
CLEARANCE DELIVERY PHONE: For CD ctc Denver ARTCC at 303-651-4257.
RADIO AIDS TO NAVIGATION: NOTAM FILE AKO.
AKRON (VH) (H) VORW/DME 114.4 AKO Chan 91 N40°09.33′ W103°10.78′ 278° 30.6 NM to fld. 4623/13E.
VOR unusable:
228°–232° byd 40 NM

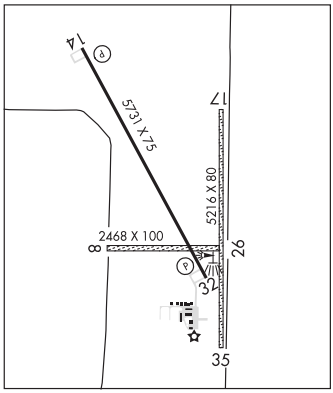

FREMONT CO (See CANON CITY on page 334)

GILL N40°30.23′ W104°33.18′ NOTAM FILE DEN. **CHEYENNE**
(VH) (DH) VORW/DME 114.2 GLL Chan 89 210° 5.4 NM to Greeley–Weld Co. 4904/13E. **H–5A, L–10F**
VOR unusable:
193°–204° byd 40 NM blo 7,800′
193°–204° byd 50 NM
226°–240° byd 40 NM
254°–263° byd 40 NM blo 16,000′

GLENWOOD SPRINGS

KGWS SUMERS AIRPARK (GWS)(KGWS) 3 S UTC–7(–6DT) N39°30.36′ W107°18.55′ **DENVER**
5921 NOTAM FILE DEN **L–9E**
RWY 15–33: H3309X50 (ASPH) 0.4% up NW
SERVICE: S4 **FUEL** 100LL, JET A **OX** 3, 4
NOISE: Noise abatement: When wind & wx permit use Rwy 33 for arr and Rwy 15 for dep. No touch and go ldgs.
AIRPORT REMARKS: Attended Mon–Fri 1500–0000Z‡. 100LL fuel avbl 24 hrs via self–svc credit card pump. Arpt Manager on call at 970–445–0965. FBO PH:970–945–3073. Wildlife on and invof arpt. 2000 ft mtns surround airport. Gusty winds frequently in vicinity of arpt. Numerous 25 ft bldgs; trees; equipment; tie downs aprxly 150 ft from cntrln—both sides of rwy full length. Rwy 32 has 20 ft hgrs & 30 ft antenna 200 ft left of cntrln at thld. Paragliding opns in vicinity one to two miles northwest of arpt up to 18,000 ft MSL. Automated super UNICOM. Click 3 times for arpt information.
AIRPORT MANAGER: 970-987-5916
COMMUNICATIONS: CTAF/AUNICOM 123.0
CLEARANCE DELIVERY PHONE: For CD ctc Denver ARTCC at 303-651-4257.
RADIO AIDS TO NAVIGATION: NOTAM FILE DEN.
RED TABLE (VH) (DH) VORW/DME 113.0 DBL Chan 77 N39°26.36′ W106°53.68′ 270° 19.7 NM to fld. 11800/12E.
VOR unusable:
040°–056° byd 40 NM
057°–074° byd 40 NM blo 16,300′
057°–074° byd 65 NM
075°–100° byd 40 NM
115°–130° byd 40 NM
160°–200° byd 40 NM
COMM/NAV/WEATHER REMARKS: Automated UNICOM, 3 clicks adzy.