
LONGMONT

VANCE BRAND (LMO)(KLMO) 3 SW UTC–7(–6DT) N40°09.86′ W105°09.82′ **CHEYENNE**
5055 B NOTAM FILE DEN **L–10F, A**
RWY 11–29: H4799X75 (CONC) S–30 MIRL 0.5% up NW **IAP**
RWY 11: VASI(V2L)—GA 3.0° TCH 24′. Tree.
RWY 29: VASI(V2L)—GA 3.0° TCH 35′. Road.
SERVICE: S4 **FUEL** 100LL, JET A, MOGAS **LGT** ACTVT MIRL Rwy 11–29 and VASI Rwy 11–29—CTAF. Rwy 11 VASI unusable byd 3.9 NM. VASI does not prvd obst clnc byd 3.9 NM from thld.
NOISE: Noise abatement proc in efct use Rwy 29 when wind pmts, avoid flt ops bfr 8 am and aft 8 pm. Adnl VNAP guidance is avbl online at longmontcolorado.gov/arpt.
AIRPORT REMARKS: Attended dalgt hrs. Parachute jumping on and invof arpt primarily of rwy, avoid overflights mid fld. Ultralight and helicopter activity on and invof arpt. Rwy 29 has +15′ highway 702′ from thld, +25′ to 35′ bldgs/tanks aprx 1300′ left of thld. NOTE: See Special Notices—Aerobatic Operations in Colorado, USAF 306 FTG Flight Training Areas, Vicinity of Colorado Springs and Pueblo Colorado.
AIRPORT MANAGER: 303-651-8431
WEATHER DATA SOURCES: AWOS–3 120.0 (303) 684–7545.
COMMUNICATIONS: CTAF/UNICOM 122.975
Ⓡ **DENVER APP/DEP CON** 125.125
CLEARANCE DELIVERY PHONE: For CD ctc Denver Apch at 303-342-1916.
RADIO AIDS TO NAVIGATION: NOTAM FILE BJC.
JEFFCO (VH) (DH) VORW/DME 115.4 BJC Chan 101 N39°54.78′ W105°08.34′ 345° 15.1 NM to fld. 5737/11E.
VOR unusable:
180°–225° byd 40 NM
226°–245° byd 36 NM blo 17,000′
246°–278° byd 30 NM blo 19,000′
279°–300° byd 34 NM blo 18,000′
301°–335° byd 40 NM
DME unusable:
246°–278° byd 30 NM

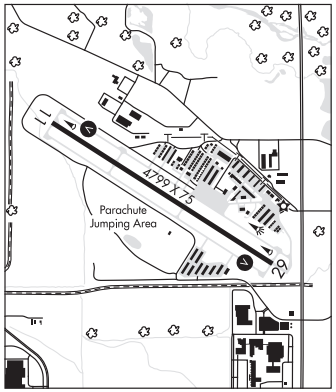

MC ELROY AIRFIELD (See KREMMLING on page 361)

MEADOW LAKE (See COLORADO SPRINGS on page 338)