
CONCHAS DAM

CONCHAS LAKE (E89) 1 SW UTC–7(–6DT) N35°22.07′ W104°10.83′ **ALBUQUERQUE**
4232 B NOTAM FILE ABQ **L–15A**
RWY 09–27: H4800X60 (ASPH) S–13 PCN 5 F/D/Y/T RWY LGTS(NSTD) 0.9% up W
RWY 09: ODALS.
RWY 27: ODALS.
SERVICE: **LGT** Rwy 09—27 edge intens rwy lgts: reflective mkrs. Rwy 09 ODALS: NSTD; one ODAL illuminates. Rwy 27 ODALS: NSTD; OTS indefly. ACTVT ODALS Rwy 09 and Rwy 27—CTAF.
AIRPORT REMARKS: Unattended. Wildlife on and invof arpt. Gate aces 4230. Twys have retro reflective mkrs. Survey mkr 275 ft fm thr 55 ft left of cntrln.
AIRPORT MANAGER: 505-365-3891
COMMUNICATIONS: CTAF 122.9
CLEARANCE DELIVERY PHONE: For CD ctc Albuquerque ARTCC at 505-856-4861.
RADIO AIDS TO NAVIGATION: NOTAM FILE TCC.
TUCUMCARI (VH) (H) VORTACW 113.6 TCC Chan 83 N35°10.93′ W103°35.91′ 279° 30.7 NM to fld. 4035/12E.
VOR unusable:
125°–174° byd 40 NM
175°–193° byd 40 NM blo 12,500′
194°–227° byd 40 NM
228°–238° byd 40 NM blo 11,000′
228°–238° byd 46 NM
239°–249° byd 40 NM
250°–261° byd 40 NM blo 7,700′
250°–261° byd 46 NM blo 18,000′
262°–273° byd 40 NM
274°–284° byd 40 NM blo 18,000′
285°–355° byd 40 NM

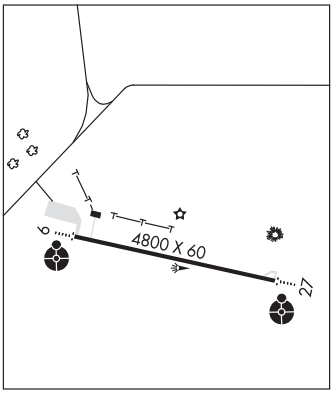

CONCHAS LAKE SPB (E61) 2 SW UTC–7(–6DT) N35°23.05′ W104°12.98′ **ALBUQUERQUE**
4201 NOTAM FILE ABQ
WATERWAY ALL–WAY: 21120X1320 (WATER)
SEAPLANE REMARKS: Unattended. Hvy boat tfc May–Oct. Water level fluctuates 4153–4201 ft; lndg haz due to exposed snags and land masses blw 4175 ft; mnt water level – 575–868–22221 or USCGS website under Conchas Lake. Ops NA north of the dam. Wind warning lgt W of dam at lodge; lgts flash grt than 20 mph wind. Exp SW wind; rcmnd lndg and tkof to the W.
AIRPORT MANAGER: 575-868-2221
COMMUNICATIONS: CTAF 122.9
CLEARANCE DELIVERY PHONE: For CD ctc Albuquerque ARTCC at 505-856-4861.

CONCHAS LAKE SPB (See CONCHAS DAM on page 440)

CONCHAS LAKE (See CONCHAS DAM on page 440)