

TRIDENT BASIN SPB (T44) 0 N UTC-9(-8DT) N57°46.85' W152°23.48'

KODIAK

00 NOTAM FILE ENA

WATERWAY 02W-20W: 4400X200 (WATER)

SERVICE: FUEL 100LL

SEAPLANE REMARKS: Attended continuously. Fuel avbl with credit card. Reef exposed at both ends of waterway on low tides.

Birds invof ldg basin. Boats occasionally use spb waterlane. Pilots arriving/departing Trident Basin must ctc Kodiak twr for ttc advisories and/or special VFR clearance. When twr clsd pilots will self announce on CTAF.

AIRPORT MANAGER: 907-486-8060

COMMUNICATIONS: CTAF 119.8 UNICOM 122.8

COMM/NAV/WEATHER REMARKS: For a toll free call to Kenai FSS dial 1-866-864-1737.

KOKHANOK (9K2)(PFKK) 2 SW UTC-9(-8DT) N59°26.00' W154°48.16'

KODIAK

115 B NOTAM FILE ILI

L-2I, 3D

RWY 07-25: 3300X75 (GRVL) MIRL

IAP

RWY 07: REIL. PAPI(P4L)—GA 3.0° TCH 20'. Tree.

RWY 25: REIL. PAPI(P4L)—GA 4.0° TCH 23'. Road.

SERVICE: LGT ACTIVATE PAPI and REIL Rwys 07 and 25, MIRL Rwy 07-25, rotating bcn and windcone—CTAF.

AIRPORT REMARKS: Unattended. Rwy not monitored, visual inspection prior to use. Horses on or invof rwy. 30' unlit twr approximately 300' north of Rwy 07-25.

AIRPORT MANAGER: 907-571-1261

COMMUNICATIONS: CTAF 122.9

Ⓡ **ANCHORAGE CENTER APP/DEP CON** 118.8

RADIO AIDS TO NAVIGATION: NOTAM FILE AKN.

KING SALMON (H) VORTAC 112.8 AKN Chan 75 N58°43.48'

W156°45.14' 038° 73.9 NM to fld. 95/16E.

TACAN antenna offset 150' se

TACAN AZIMUTH unusable:

130°-140° byd 13 NM blo 4,000'


130°-140° byd 30 NM

338°-348° byd 19 NM blo 5,000'

DME unusable:

338°-348° byd 19 NM blo 5,000'

COMM/NAV/WEATHER REMARKS: For a toll free call to Kenai FSS dial 1-866-864-1737.

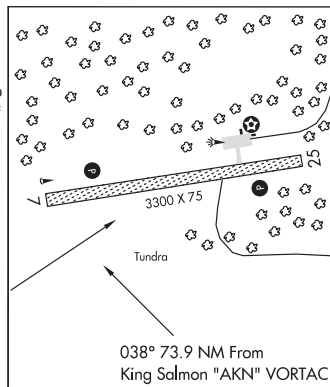

KOLIGANEK (JZZ)(PAJZ) 1 E UTC-9(-8DT) N59°43.61' W157°15.62'

KODIAK

272 B NOTAM FILE JZZ

L-3C

RWY 09-27: 3300X75 (GRVL) MIRL 1.0% up E

IAP

RWY 09: PAPI(P4R)—GA 3.0° TCH 39'. Brush.

RWY 27: PAPI(P4L)—GA 3.5° TCH 27'. Brush.

RUNWAY DECLARED DISTANCE INFORMATION

RWY 09: TORA-3300 TODA-3300 ASDA-3300 LDA-3300

RWY 27: TORA-3300 TODA-3300 ASDA-3300 LDA-3300

SERVICE: LGT ACTIVATE MIRL Rwy 09-27, PAPI Rwy 09 and Rwy 27, and rot bcn—CTAF.

AIRPORT REMARKS: Unattended. Rwy condition not monitored, recommend visual inspection prior to use. Loose rocks on surface up to 12" diameter, numerous heaves and humps and 4" deep ruts at Rwy 09 thld. Rwy sloughing off into tundra. Rwy slopes down toward west end. Rwy 09-27 thld marked with lgts.

AIRPORT MANAGER: 907-842-5511

WEATHER DATA SOURCES: AWOS-3P 118.525 (907) 596-3302. (WX CAM)

COMMUNICATIONS: CTAF 122.9

KEMUK MOUNTAIN RCO 122.55 (DILLINGHAM RADIO) Opr

1645-0845Z, other times ctc Kenai FSS.

ANCHORAGE CENTER APP/DEP CON 282.35 132.75

RADIO AIDS TO NAVIGATION: NOTAM FILE DLG.

DILLINGHAM (H) VOR/DME 116.4 DLG Chan 111 N58°59.65' W158°33.13' 026° 59.3 NM to fld. 81/15E.

COMM/NAV/WEATHER REMARKS: For a LD call to Dillingham FSS dial 907-842-5275. For a toll free call to Kenai FSS dial 1-866-864-1737.

