

CONTINUED FROM PRECEDING PAGE

AIRSPACE: CLASS D svc 1530-0500Z± 1 Oct-31 Mar, 1600-0700Z± 1 Apr-30 Sep; other times CLASS E.

RADIO AIDS TO NAVIGATION: NOTAM FILE ADQ.

(H) **VOR/DME** 117.1 ODK Chan 118 N57°46.50' W152°20.39' 239° 5.2 NM to fld. 133/14E.

VOR unusable:

190°-310° byd 15 NM blo 12,000'

DME unusable:

154°-265° byd 15 NM blo 12,000'

266°-305°

306°-341° byd 15 NM blo 12,000'

WOODY ISLAND NDB (HW) 394 RWO N57°46.49' W152°19.48' 241° 5.6 NM to fld. 24/14E.

ILS/DME 110.9 I-ADQ Chan 46 Rwy 26. Class IA. Front unusable within 2.0 DME (0.7 NM from thld). LOC unusable byd 30° r of course.

COMM/NAV/WEATHER REMARKS: For a toll free call to Kenai FSS dial 1-866-864-1737. RCO available when twr closed.

KODIAK (LILLY LAKE) SPB (9Z3) 1 NE UTC-9(-8DT) N57°48.16' W152°22.96'

KODIAK

130 LRA NOTAM FILE ENA

WATERWAY NE-SW: 2100X250 (WATER)

WATERWAY NE: Rgt tfc.

WATERWAY SW: Road.

SEAPLANE REMARKS: Unattended. Arpt clsd at ngt. Arpt CLOSED

High/Low wing except 49' and under. Ctc Kodiak Twr 119.8.

Windsock located at Kodiak Muni Arpt. Numerous unlit obstructions in vicinity. Be alert possible conflicting traffic with NE operations and lake based acft. Land around lake is private property. All docks and ramps are privately owned.

AIRPORT MANAGER: 907-486-8060

COMMUNICATIONS: CTAF 119.8 UNICOM 122.8

RADIO AIDS TO NAVIGATION: NOTAM FILE ADQ.

(H) **VOR/DME** 117.1 ODK Chan 118 N57°46.50' W152°20.39' 306° 2.2 NM to fld. 133/14E.

VOR unusable:

190°-310° byd 15 NM blo 12,000'


DME unusable:

154°-265° byd 15 NM blo 12,000'

266°-305°

306°-341° byd 15 NM blo 12,000'

COMM/NAV/WEATHER REMARKS: For toll free call to Kenai FSS dial 1-866-864-1737.

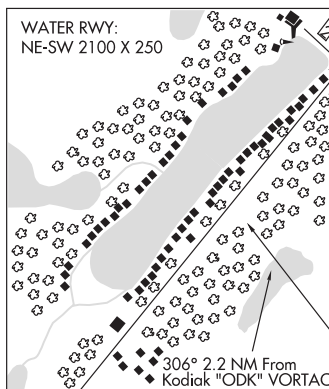

KODIAK MUNI (KDK)(PAKD) 2 NE UTC-9(-8DT) N57°48.36' W152°22.43'

KODIAK

139 NOTAM FILE ENA

RWY 02-20: H2475X40 (ASPH-TRTD)

RWY 02: Thld dspcd 240'. Tree. Rgt tfc.

RWY 20: Trees.

AIRPORT REMARKS: Attended daylight hrs. Arpt unlit and CLOSED for ngt ops.

Ctc Kodiak twr for tfc advisory, 119.8. Arpt CLOSED High/Low wing

except 49' under. Numerous unlit obstructions in vicinity. Conflicting

traffic with Lilly Lake Trident Basin and Kodiak Arpt. Rwy 02-20

surrounded by numerous businesses in close proximity. Rwy 02-20

pavement width varies from 20' wide on Rwy 20 end to 30' wide on

Rwy 02 end. Pavement is cracked length of rwy. Rwy 20 road crosses

apch 15' blo thld elev 200' from rwy thld. Rwy slopes uphill 67' from

Rwy 02 dspcd thld to Rwy 20. Rwy 02-20 NSTD markings faded to

invisible, no line of sight between rwy ends. First 350' of Rwy 02 slopes

5% uphill.

AIRPORT MANAGER: 907-486-8060

COMMUNICATIONS: CTAF 119.8 UNICOM 122.8

RADIO AIDS TO NAVIGATION: NOTAM FILE ADQ.

(H) **VOR/DME** 117.1 ODK Chan 118 N57°46.50' W152°20.39' 316° 2.2 NM to fld. 133/14E.

VOR unusable:

190°-310° byd 15 NM blo 12,000'

DME unusable:

154°-265° byd 15 NM blo 12,000'

266°-305°

306°-341° byd 15 NM blo 12,000'

COMM/NAV/WEATHER REMARKS: For a toll free call to Kenai FSS dial 1-866-864-1737.

