

**POINT BAKER SPB** (KPB)(PFKP) 0 SE UTC-9(-8DT) N56°21.11' W133°37.36'

JUNEAU

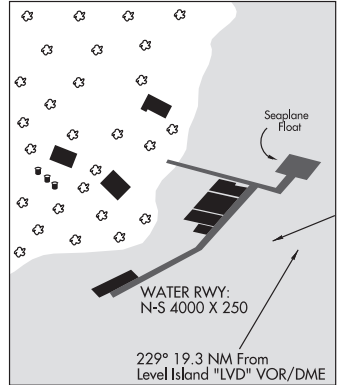
00 NOTAM FILE SIT

**WATERWAY N-S:** 4000X250 (WATER)**SEAPLANE REMARKS:** Attended daylight. Narrow and congested opr area, small islands both entrances to core. Boats tied to SPB/helicopter float/ramp. Seaplane float designed to support 22,000 lbs maximum GWT helicopters. Float deteriorated, be alert when loading near capacity.**AIRPORT MANAGER:** (907) 465-4512**COMMUNICATIONS:** CTAF 122.9**RADIO AIDS TO NAVIGATION:** NOTAM FILE SIT.**LEVEL ISLAND (H) (H) VORW/DME** 116.5 LVD Chan 112  
N56°28.06' W133°04.99' 229° 19.3 NM to fld. 98/20E.

VOR unusable:

020°-050° byd 37 NM  
270°-300° byd 25 NM blo 10,000'  
301°-321° byd 25 NM blo 7,000'  
wx cam avbl at <https://weathercams.faa.gov>

DME unusable:

020°-050° byd 25 NM blo 11,000'  
020°-050° byd 37 NM  
105°-120° byd 29 NM blo 10,000'  
121°-135° byd 35 NM blo 7,000'  
270°-300° byd 25 NM blo 10,000'  
301°-321° byd 25 NM blo 7,000'  
345°-350° byd 36 NM blo 8,000'**COMM/NAV/WEATHER REMARKS:** For a toll free call to Sitka FSS dial 1-800-478-6300.**POINT HOPE** (PHO)(PAPO) 2 SW UTC-9(-8DT) N68°20.93' W166°47.96'

CAPE LISBURNE

21 B NOTAM FILE PHO

H-1A, L-4H

**RWY 01-19:** H3992X75 (ASPH) MIRL

IAP

**RWY 01:** VASI(V4L)—GA 3.0° TCH 25'.**RWY 19:** VASI(V4L)—GA 3.0° TCH 27'.**SERVICE:** LGT ACTIVATE MIRL Rwy 01-19—CTAF.**AIRPORT REMARKS:** Unattended. Rwy condition not monitored, recommend visual inspection prior to landing. Fuel avbl emerg only. Lateral cracks 1-3" wide across width of rwy spaced 200'-500' length of rwy. NOTE: See Notices—Drone Activity at Coastal Airport Launch Sites.**AIRPORT MANAGER:** 907-442-3147**WEATHER DATA SOURCES:** AWOS-3P 118.325 (907) 368-2128. (WX CAM)**COMMUNICATIONS:** CTAF 122.8

POINT HOPE RCO 122.25 (KOTZEBUE RADIO)

ANCHORAGE CENTER APP/DEP CON 119.65 363.25

**RADIO AIDS TO NAVIGATION:** NOTAM FILE PHO.**NDB (HW) 221** PHO N68°20.68' W166°47.89' at fld.  
14/11E. unmonitored.**COMM/NAV/WEATHER REMARKS:** For a LC to Kotzebue FSS dial 907-442-3310. For a toll free call to Kotzebue FSS dial 1-800-478-7460. For a toll free call to Fairbanks FSS dial 1-866-248-6516.