

POINT HOPE (PHO)(PAPO) 2 SW UTC-9(-8DT) N68°20.89' W166°47.95'

CAPE LISBURNE

21 B NOTAM FILE PHO

H-1A, L-4H

RWY 03-21: H4000X75 (ASPH) MIRL

IAP

RWY 03: PAPI(P4R)—GA 3.0° TCH 25'.

RWY 21: PAPI(P4L)—GA 3.0° TCH 25'.

SERVICE: LGT ACTVT PAPI Rwy 03-21; MIRL Rwy 03-21—CTAF.

AIRPORT REMARKS: Unattended. Rwy cond unmnt, rcmdnd visual insp prior to lng. Fuel avbl emerg only. 1-3 in cracks acrs width spaced 200-500 ft entr length. NOTE: See Notices—Drone Activity at Coastal Airport Launch Sites.

AIRPORT MANAGER: 907-442-3147

WEATHER DATA SOURCES: AWOS-3P 118.325 (907) 368-2128. (WX CAM)

COMMUNICATIONS: CTAF 122.8

POINT HOPE RCO 122.25 (KOTZEBUE RADIO)

ANCHORAGE CENTER APP/DEP CON 119.65 363.25

RADIO AIDS TO NAVIGATION: NOTAM FILE LUR.

CAPE LISBURNE NDB/DME (HW) 385 LUR Chan 20(Y) N68°52.28'

W166°04.56' 200° 35.3 NM to fld. 61/7E.

NDB has no standby transmitter, May be shutdown without prior notice

NDB unusable:


141°-169° byd 20 NM

DME unusable:

004°-129° byd 20 NM

129°-291° byd 5 NM blo 9,000'

COMM/NAV/WEATHER REMARKS: For a LC to Kotzebue FSS dial 907-442-3310. For a toll free call to Kotzebue FSS dial 1-800-478-7460. For a toll free call to Fairbanks FSS dial 1-866-248-6516.

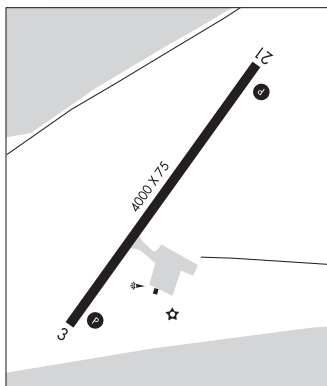

POINT LAY LRRS (PIZ)(PPIZ) P (AF) 1 S UTC-9(-8DT) N69°43.97' W163°00.32'

CAPE LISBURNE

29 B NOTAM FILE PIZ

H-1A, L-4I

RWY 05-23: 4500X100 (GRVL) MIRL

IAP

RWY 05: REIL. PAPI(P4L)—GA 3.0° TCH 35'.

RWY 23: REIL. PAPI(P4L)—GA 3.0° TCH 35'.

SERVICE: LGT ACTVT REIL Rwy 05 and Rwy 23, PAPI Rwy 05 and Rwy 23; MIRL Rwy 05-23—CTAF. ACTVT rotg bcn—CTAF.

AIRPORT REMARKS: Unattended. Cold temperature airport. Altitude correction required at or below -33C. NOTE: See Notices—Drone Activity at Coastal Airport Launch Sites.

AIRPORT MANAGER: (907) 852-0489

WEATHER DATA SOURCES: AWOS-3P 135.65 (907) 833-3112. (WX CAM)

COMMUNICATIONS: CTAF 122.8

POINT LAY RCO 122.4 (BARROW RADIO)

ANCHORAGE CENTER APP/DEP CON 119.65 363.25

RADIO AIDS TO NAVIGATION: NOTAM FILE PIZ.

NDB (HW) 362 PIZ N69°44.19' W162°59.78' at fld. 14/15E.

COMM/NAV/WEATHER REMARKS: Barrow FSS—1-800-779-7709 or 907-852-2511. For a toll free call to Fairbanks FSS call 1-866-248-6516.

