

CONTINUED FROM PRECEDING PAGE

EPHRATA (VH) (H) VORTACW 112.6 EPH Chan 73 N47°22.68' W119°25.44' 303° 36.1 NM to fld. 1250/21E.
 VOR unusable:
 010°-014° byd 40 NM
 042°-054° byd 40 NM
 214°-228° byd 40 NM blo 7,000'
 214°-228° byd 52 NM blo 10,000'
 214°-228° byd 77 NM
 229°-247° byd 40 NM
 310°-350° byd 25 NM blo 6,500'
 310°-353° byd 40 NM
 358°-004° byd 40 NM
 TACAN AZIMUTH unusable:
 280°-295° byd 25 NM blo 7,000'
 310°-350° byd 25 NM blo 6,500'
 DME unusable:
 280°-295° byd 25 NM blo 7,000'
 310°-350° byd 25 NM blo 6,500'

CHEWELAH MUNI (I19) NW UTC-8(-7DT) N48°18.84' W117°44.61'

SEATTLE
L-13B

2084 B NOTAM FILE SEA

RWY 17-35: H3537X48 (ASPH) MIRL

RWY 17: PAPI(P2R)—GA 4.0° TCH 63'. Thld dspcd 230'. Tree. Rgt tfc.

RWY 35: PAPI(P2L)—GA 3.0°. Thld dspcd 87'.

SERVICE: S2 FUEL 100LL, JET A LGT ACTIVATE MIRL Rwy 17-35—CTAF. PAPI Rwy 17 and Rwy 35 opr continuously.

AIRPORT REMARKS: Unattended. Deer and wildlife on and invof arpt. 100LL & Jet A avbl 24 hrs credit card self svc. Lodging and food avbl at arpt. All patterns to the west. Pilots bring own ropes.

AIRPORT MANAGER: (509) 936-0234


COMMUNICATIONS: CTAF 122.9

CLEARANCE DELIVERY PHONE: For CD ctc Seattle ARTCC at 253-351-3694.

RADIO AIDS TO NAVIGATION: NOTAM FILE GEG.

SPOKANE (VH) (H) VORTACW 115.5 GEG Chan 102 N47°33.90' W117°37.61' 340° 45.2 NM to fld. 2756/14E.

VOR unusable:
 007°-022° byd 26 NM blo 7,000'
 029°-041° byd 40 NM
 307°-337° byd 30 NM blo 9,000'
 342°-007° byd 18 NM blo 7,000'
 342°-007° byd 25 NM

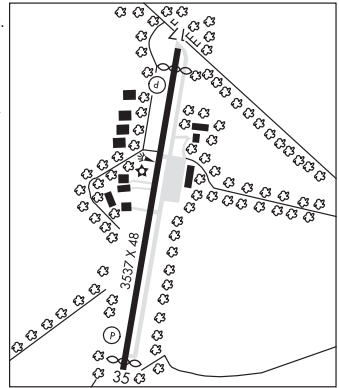

CLAYTON

CROSS WINDS (C72) 2 SE UTC-8(-7DT) N47°58.86' W117°31.73'

SEATTLE

2150 TPA—See Remarks NOTAM FILE SEA

RWY 13L-31R: 3800X125 (DIRT)

RWY 13L: P-line.

RWY 31R: Thld dspcd 170'. Road. Rgt tfc.

RWY 13R-31L: 2065X50 (DIRT)

RWY 13R: Fence. Rgt tfc.

RWY 31L: Road.

AIRPORT REMARKS: Unattended. Arpt currently clsd, open only to ski eqpt acft. Use care during high wind due to turbulence and crosswind. Rwy 13L-31R and Rwy 13R-31L not useable during heavy snow and spring mud. Rwy 13L-31R dirt is uneven and uncompacted. Rwy 13R-31L dirt is uneven and compacted. Rwy 13L-31R and Rwy 13R-31L rough with tall grass. Mole holes on rwy. Rwy 13R-31L ultralight rwy. Ultralight tfc on arpt. TPA—Ultralight—2650 (500).

AIRPORT MANAGER: (509) 671-3824

COMMUNICATIONS: CTAF 122.9

CLEARANCE DELIVERY PHONE: For CD ctc Spokane Apch at 509-742-2522