

AIRPORT/FACILITY DIRECTORY

CONTINUED FROM PRECEDING PAGE

ILS/DME 110.9 I-LIH Chan 46 Rwy 35. Class ID. LOC unusable byd 20° left of centerline. ILS/DME unmonitored when ATCT closed. DME unusable byd 20° left of course.

COMM/NAV/WEATHER REMARKS: When twr closed, A/C on ground ctc Honolulu Center (HCF) on 126.5/ HCF Apch 134.0.

HELIPAD H1: H40X40 (CONC)

HELIPAD H2: H40X40 (CONC)

HELIPAD H3: H40X40 (CONC)

HELIPORT REMARKS: Helicopter pads 1 through 20 located west of control twr.

NORTH KAUAI N22°12.55' W159°26.63'
RCO 122.3 (HONOLULU RADIO)

HAWAIIAN-MARIANA

P-2F

PORT ALLEN (PAK)(PHPA) 1 SW UTC-10 N21°53.82' W159°36.19'

HAWAIIAN-MARIANA

24 TPA—824(800) LRA NOTAM FILE LIH

RWY 09-27: H2450X60 (ASPH) S-18

RWY 09: Thld dsplcd 189'. Rgt tfc.

RUNWAY DECLARED DISTANCE INFORMATION

RWY 09: TORA-2361 TODA-2361 ASDA-2361 LDA-2361

RWY 27: TORA-2450 TODA-2450 ASDA-2450 LDA-2450

AIRPORT REMARKS: Unattended. Skydiving on and invof arpt. Daily helicopter activity on and invof arpt. Arpt restricted by owner to aircraft weighing less than 12,500 lbs. Noise abatement: Avoid overflight of the salt pond, state recreational beach park, residential and commercial areas N of airfield. No airfield security, overnight acct parking not authorized. Vehicles parked along shoreline fronting approach end Rwy 09. NOTE: See Area Notices—TRAFFIC ADVISORIES AT NON-TOWER AIRPORTS.

AIRPORT MANAGER: (808) 274-3800

COMMUNICATIONS: CTAF 122.9


LIHUE RCO 122.4 122.1R 113.5T (HONOLULU RADIO)

RADIO AIDS TO NAVIGATION: NOTAM FILE LIH.

SOUTH KAUAI (H) VORTAC 115.4 SOK Chan 101 N21°54.02'

W159°31.73' 256° 4.2 NM to fld. 602/11E.

COMM/NAV/WEATHER REMARKS: For aviation info 0800-1600Z contact Honolulu FSS on 122.6.

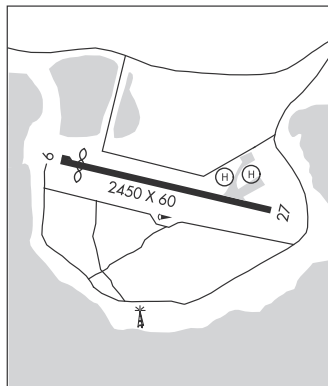

PRINCEVILLE (HI01) 3 E UTC-10 N22°12.55' W159°26.73'
344

HAWAIIAN ISLANDS

P-2F

RWY 05-23: H3560X60 (ASPH) S-30 LIRL(NSTD)

RWY 05: Trees.

RWY 23: Pole.

SERVICE: LGT NSTD LIRL OTS indef.

AIRPORT REMARKS: Unattended. Daytime VFR operations only. Tree line with trees up to 60' approximately 200' N of rwy centerline near midfield. Tree line with 20' trees 125' N and S of rwy centerline. Ctc Princeville (808) 826-3040, 1900-0300Z for ldg authorization and ops requirements. No helicopter operations permitted except for existing operations by resident tour operator. Rwy 05 rising terrain at approximately 5% slope. Acft parking not to exceed 45 minutes due to limited ramp space. Landing fee.

AIRPORT MANAGER: (808) 826-3040

COMMUNICATIONS:

NORTH KAUAI RCO 122.3 (HONOLULU RADIO)

RADIO AIDS TO NAVIGATION: NOTAM FILE LIH.

LIHUE (H) VORTAC 113.5 LIH Chan 82 N21°57.92 W159°20.29 327° 15.8 NM to fld. 110/11E.

TACAN AZIMUTH and DME unusable:

180°-240° byd 16 NM

241°-330° byd 18 NM

331°-355° byd 30 NM blo 7,500'

VOR unusable:

180°-240° byd 33 NM blo 11,500'

241°-330° byd 18 NM

331°-355° byd 30 NM blo 7,500'

SOUTH KAUAI N21°54.02' W159°31.73' NOTAM FILE LIH.

HAWAIIAN-MARIANA

(H) VORTAC 115.4 SOK Chan 101 256° 4.2 NM to Port Allen. 602/11E.

P-2F

VORTAC unusable:

060°-070° byd 30 NM blo 5,000'

305°-010° byd 15 NM blo 8,500'

RCO 122.1R 115.4T (HONOLULU RADIO)