

MELBOURNE INTL (MLB)(KMLB) 2 NW UTC-5(-4DT) N28°06.17' W80°38.72'

JACKSONVILLE

33 B Class I, ARFF Index C NOTAM FILE MLB

H-81, L-24F

RWY 09R-27L: H10181X150 (ASPH-GRVD) S-100, D-165, 2S-175,

IAP, AD

2D-300 PCN 61 F/B/W/T HIRL CL

RWY 09R: MALSR, TDZL, PAPI(P4L)—GA 3.0° TCH 83'. RVR-T

RWY 27L: REIL, PAPI(P4L)—GA 3.0° TCH 54'. RVR-R Thld dsplcd 699'.

RWY 09L-27R: H6000X150 (ASPH-GRVD) S-60, D-60

PCN 16 F/B/Y/T MIRL

RWY 09L: PAPI(P4L)—GA 3.0° TCH 39'.

RWY 27R: PAPI(P4L)—GA 3.0° TCH 40'.

RWY 05-23: H3001X75 (ASPH) S-26 PCN 9 F/A/Y/T MIRL

RWY 05: PAPI(P2L)—GA 3.0° TCH 21'.

RWY 23: PAPI(P2L)—GA 3.0° TCH 21'.

RUNWAY DECLARED DISTANCE INFORMATION

RWY 05: TORA-3000 TODA-3000 ASDA-3000 LDA-3000

RWY 09L: TORA-6000 TODA-6000 ASDA-6000 LDA-6000


RWY 09R: TORA-10181 TODA-10181 ASDA-10181 LDA-10181

RWY 23: TORA-3000 TODA-3000 ASDA-3000 LDA-3000

RWY 27L: TORA-10181 TODA-10181 ASDA-10181 LDA-9482

RWY 27R: TORA-6000 TODA-6000 ASDA-6000 LDA-6000

SERVICE: S4 **FUEL** 100LL, JET A **LGT** When twr clsd **ACTIVATE** Rwy 09R-27L HIRL, Rwy 09L-27R MIRL, Rwy 05-23 MIRL and PAPI Rwy 05, Rwy 09L, Rwy 09R, Rwy 23, Rwy 27L, Rwy 27R—CTAF.

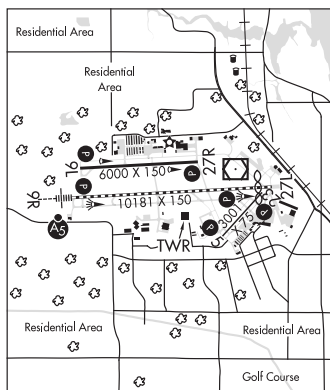

AIRPORT REMARKS: Attended continuously. Bird activity on and in/ovf the arpt. Sfc condition no reported 0400-1100Z† (2300-0600 lcl). Touch and go ops rstd after 0200Z† or 2 hrs after SS (whichever is later). Unctl areas incl Twy V West of Rwy 05, Twy C North of Twy K, Twy S North of S1 and Twy H and Twy G. Rwy 09R RVR unavailable 0500-1100Z†. Rwy 27L RVR unavailable 0500-1100Z†. Rwy 09R-27L 400' blast pad both rwy ends. U.S. CSTMS user fee arpt.

AIRPORT MANAGER: 321-723-6227

WEATHER DATA SOURCES: ASOS (321) 951-7575 LAWR5.

COMMUNICATIONS: CTAF 118.2 ATIS 132.55 UNICOM 122.95

RCO 122.1R 110.0T (SAINT PETERSBURG RADIO)

Ⓡ ORLANDO APP/DEP CON 132.65

TOWER 118.2 124.05 (1100-0500Z†)

GND CON 121.9 **CLNC DEL** 121.9 132.65 (when twr clsd)

AIRSPACE: CLASS D svc 1100-0500Z†; other times CLASS G.

RADIO AIDS TO NAVIGATION: NOTAM FILE MLB.

(L) **VOR/DME** 110.0 MLB Chan 37 N28°06.32' W80°38.12' at fld. 30/7W.

ILS 108.3 I-MLB Rwy 09R. Unmonitored when ATCT clsd.

MERRITT ISLAND (COI)(KCOI) 0 S UTC-5(-4DT) N28°20.50' W80°41.13'

JACKSONVILLE

6 B LRA NOTAM FILE PIE

L-24F

RWY 11-29: H3601X75 (ASPH) S-22 PCN 23 F/A/X/T MIRL

IAP

RWY 11: PAPI(P2L)—GA 3.0° TCH 30'. Bldg.

RWY 29: PAPI(P2L)—GA 3.0° TCH 31'. Boat.

SERVICE: S4 **FUEL** 100LL, JET A **LGT** **ACTIVATE** rotating bcn and MIRL

Rwy 11-29—CTAF.

AIRPORT REMARKS: Attended 1300-0100Z†. Banner towing in/ovf arpt. 24 hr helicopter ops SW ramp. Patrick Air Force Base (COF) Class D airspace is in close proximity to Merritt Island Arpt and (COF) crossing Rwy 11-29 has same orientation as Merritt Island Arpt.

AIRPORT MANAGER: 321-267-8780

WEATHER DATA SOURCES: AWOS-3 119.025 (321) 986-8864.

COMMUNICATIONS: CTAF/UNICOM 122.975

Ⓡ ORLANDO APP/DEP CON 134.95

CLEARANCE DELIVERY PHONE: For CD ctc orlando Apch at 407-852-7553

RADIO AIDS TO NAVIGATION: NOTAM FILE ORL.

ORLANDO (H) VORTACW 112.2 ORL Chan 59 N28°32.56'

W81°20.10' 109° 36.4 NM to fld. 102/OE. **HIWAS.**

TACAN AZIMUTH unusable:

066°-084°

246°-289° byd 17 NM blo 2,000'

246°-289° byd 28 NM blo 2,500'

