

COLUMBIA (O22) 1 SW UTC-8(-7DT) N38°01.83' W120°24.87'
 2121 B TPA—See Remarks NOTAM FILE RIU

SAN FRANCISCO
 L-3B
 IAP

RWY 17-35: H4673X75 (ASPH) S-30 MIRL 1.0% up N

RWY 17: REIL. VASI(V2L)—GA 4.55° TCH 56'. Thld dsplcd 598'.
 Ground. Rgt tfc.

RWY 35: REIL. VASI(V2L)—GA 4.0° TCH 54'. Thld dsplcd 384'. Trees.


RWY 11-29: 2607X50 (TURF) 0.9% up W

RWY 11: Trees. Rgt tfc.

RWY 29: Trees.

SERVICE: S4 **FUEL** 100LL, JET A **OX**2, 4 **LGT** Rwy 35 VASI unusable
 byd 5° left and 5° right of rwy centerline. **ACTIVATE** MIRL Rwy 17-35
 and REIL Rwy 17 and Rwy 35—**CTAF**. VASI Rwy 17 and Rwy 35 opr
 continuously.

AIRPORT REMARKS: Attended 1600-0100Z±. **CAUTION:** Rwy 11 departures
 prohibited due to conflict with main rwy. Varying wind direction and
 velocity may be encountered at mid point of Rwy 17-35 due to terrain
 features and wind flow patterns. Rwy 29 not recommended for use
 during winter months Nov through Mar. Turf twy north side of Rwy
 11-29 not recommended for use Nov-Mar. All jet acft are requested to
 land Rwy 35 and depart Rwy 17 and weather permitting. Arpt
 has two rotating beacons, one on the arpt and one 6500' SE threshold
 Rwy 35. Calfire Air Tanker ops from arpt during fire season. Ldg fee for
 all commercial operators regardless of size and corporate acft over 12,500 pounds gross ldg weight. Avoid flights over
 Columbia State Park NE of arpt, and Highway 49 bridge 5 NM southwest of arpt and vicinity. Helicopter parking area
 300' by 120' (4 positions). TPA Rwy 11-29 2921(800).

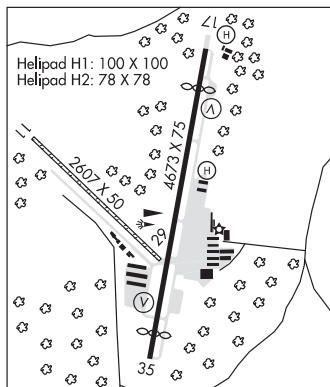

AIRPORT MANAGER: (209) 533-6684

WEATHER DATA SOURCES: AWOS-3 124.65 (209) 536-9384.

COMMUNICATIONS: **CTAF/UNICOM** 122.975

NORCAL APP/DEP CON 125.1 (North/West)

OAKLAND CENTER APP/DEP CON 121.25 (East/South)

CLEARANCE DELIVERY PHONE: For CD etc NorCal Apmh at 916-361-0516.

RADIO AIDS TO NAVIGATION: NOTAM FILE RIU.

LINDEN (H) VOR/DME 114.8 LIN Chan 95 N38°04.47' W121°00.23' 078° 28.1 NM to fld. 266/17E.

DME unusable:

191°-235°

HELIPAD H1: H100X100 (ASPH)

HELIPAD H2: H78X78 (ASPH)

COLUSA CO (O08) 3 S UTC-8(-7DT) N39°10.74' W121°59.60'
 49 B TPA—849(800) NOTAM FILE RIU

SAN FRANCISCO
 L-26, 3A
 IAP

RWY 13-31: H3034X59 (ASPH) S-10 MIRL

RWY 13: PAPI(P2L)—GA 3.0° TCH 25'.

RWY 31: PAPI(P2L)—GA 3.0° TCH 43'. Road. Rgt tfc.

SERVICE: S4 **FUEL** 100LL **LGT** **ACTIVATE** MIRL Rwy 13-31 **CTAF**.

AIRPORT REMARKS: Attended dawn-dusk. Fuel avbl by credit card 24 hrs. Be
 alert to bldg 120' above ground level, 1000' West. Birds on and invof
 of arpt.

AIRPORT MANAGER: (530) 458-0500

COMMUNICATIONS: **CTAF/UNICOM** 122.8

OAKLAND CENTER APP/DEP CON 132.2

CLEARANCE DELIVERY PHONE: For CD etc Oakland ARTCC at 510-745-3380.

RADIO AIDS TO NAVIGATION: NOTAM FILE RIU.

WILLIAMS (L) VORTACW 114.4 ILA Chan 91 N39°04.27'

W122°01.64' 356° 6.7 NM to fld. 49/18E. **HIWAS**.

