

NAKNEK**NAKNEK** (5NK) 1 N UTC-9(-8DT) N58°44.08' W157°01.51'

70 NOTAM FILE ENA

RWY 08-26: 1950X50 (GRVL)**RWY 08:** Brush.**RWY 26:** Brush.**RWY 14-32:** 1836X45 (GRVL) 3.0% up SE**RWY 14:** Brush.**RWY 32:** Brush.**SERVICE:** S3 FUEL 100LL LGT Airport unlit.

AIRPORT REMARKS: Unattended. Rwy condition not monitored, recommend visual inspection prior to using. Windsock unreliable. Acft on east side of Rwy 14-32 tied down in safety area. Road parallel to and 45' east of Rwy 32 centerline. Uncontrolled vehicular t/c on rwys. No line of sight between rwys or waterways. Float acft departing northwest lake to East, cross arpt at low alt. Acft not visible until airborne. Rwy 08-26 rocks exceeding 2" diameter and ruts 6". Rwy 08 slopes downhill to east. Rwy 14-32 rocks exceeding 2"-3" in diameter and 3" ruts. First 200' Rwy 32 soft when wet. First 400' Rwy 32 slopes downhill.

AIRPORT MANAGER: 907-246-3325**COMMUNICATIONS:** CTAF 122.9**RADIO AIDS TO NAVIGATION:** NOTAM FILE AKN.**KING SALMON (H) VORTACW** 112.8 AKN Chan 75 N58°43.48' W156°45.14' 258° 8.6 NM to fld. 95/16E.

TACAN antenna offset 150' se

TACAN AZIMUTH unusable:

130°-140° byd 13 NM blo 4,000'

130°-140° byd 30 NM

332°-348° byd 19 NM blo 5,000'

DME unusable:


332°-348° byd 19 NM blo 5,000'

COMM/NAV/WEATHER REMARKS: For a toll-free call to Kenai FSS dial 1-888-864-1737.

.

WATERWAY 08W-26W: 2000X300 (WATER)

SEAPLANE REMARKS: Unattended. E apch to lake over Rwy 14-32 Naknek arpt and Tibbetts arpt. Ramp. No line of sight between rwys or waterways. Rwy 08W-26W not on arpt property and is not owned or opr by the state of Alaska.

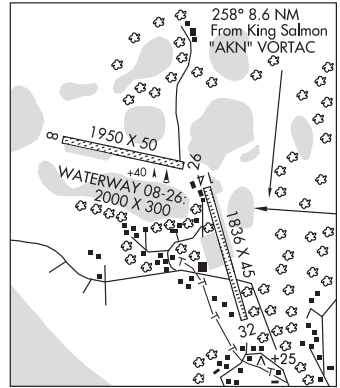

KODIAK

TIBBETTS (4AK9) PVT 0 SE UTC-9(-8DT) N58°44.06' W157°00.43'

50 NOTAM FILE

RWY 16-34: 1700X60 (GRVL-DIRT)**RWY 16:** Trees.**RWY 34:** Wire.**SERVICE:** S2

AIRPORT REMARKS: Attended daylight. Company equipment only. Spherical markers on power line in approach Rwy 34. Hump midway Rwy 16-34. Rwy soft during Spring thaw.

AIRPORT MANAGER: (907) 439-3853**COMMUNICATIONS:** CTAF 122.9**COMM/NAV/WEATHER REMARKS:** For a toll-free call to Kenai FSS dial 1-866-864-1737.

KODIAK

NANCY LAKE SPB (78Z) 0 NW UTC-9(-8DT) N61°42.20' W150°00.43'

214 NOTAM FILE ENA

WATERWAY N-S: 6000X600 (WATER)

SEAPLANE REMARKS: Unattended. No acft svcs avbl. Nancy Lake State Recreation Site has public access and camping facilities. Has dock, no dock mooring avbl but planes can heel-up away from public boat ramp and beach area. All other docks on lake are private.

AIRPORT MANAGER: 907-745-3975**COMMUNICATIONS:** CTAF 122.8**COMM/NAV/WEATHER REMARKS:** For a toll free call to Kenai FSS dial 1-866-864-1737.

ANCHORAGE

NANWAK N60°23.12' W166°12.86' NOTAM FILE MYU.**NDB/DME (HW)** 323 AIX Chan 76 232° 1.8 NM to Mekoryuk. 38/13E.

NDB/DME unusable:

115°-225° byd 30 NM

RCO (KENAI RADIO)

BETHEL

L-3B