

**VALDEZ PIONEER FLD** (VDZ)(PAVD) 3 E UTC-9(-8DT) N61°08.05' W146°14.69'

121 B LRA ARFF Index—See Remarks NOTAM FILE VDZ

**RWY 06-24:** H6500X150 (ASPH-GRVD) S-75, D-200, 2D-300

PCN 54 F/B/X/T HIRL 1.1% up E

**RWY 06:** MALSR. PAPI(P4L)—GA 3.0° TCH 29'. Trees. Rgt tfc.

**RWY 24:** REIL. Trees.

**RUNWAY DECLARED DISTANCE INFORMATION**

**RWY 06:** TORA-6500 TODA-6500 ASDA-6500 LDA-6500

**RWY 24:** TORA-6500 TODA-6500 ASDA-6500 LDA-6500

**SERVICE:** S2 FUEL 100LL, JET A, B LGT ACTIVATE HIRL Rwy 06-24, MALSR and PAPI Rwy 06 and REIL Rwy 24—CTAF.

**AIRPORT REMARKS:** Attended May-Sep 1600-0330Z†, Oct-Apr

1500-0330Z†. Fuel sales by PPR only. For Jet B 907-834-6933. For

100LL 907-831-0643. Cold temperature restricted airport. Altitude

correction required at or below -11C. Arpt maintenance duty hrs:

1500-0330Z† Mon-Fri, 1700-0330Z† Sat-Sun. Be alert, during

strong northerly winds the winds at midfld and at the east end of the

rwy may be significantly higher than the winds detected at the AWOS

site. Class I, ARFF Index A. CLOSED to air carrier ops with more than

30 pax seats exc with PPR in writing to Arpt Manager, PO Box 507

Valdez, AK 99686, 24 hrs in advance, FAX 907-835-5849. Snow

removal, wildlife control, cond reporting, and other afld maint svcs only

avbl and valid dur arpt main duty hrs. Ctc arpt mgmt for any after hours req for afld svcs. Arpt sand larger gradation than

FAA recommended/see AC 150/5200-30. Southwest section of ramp (1675 x 200 feet) not maintained Nov 1 to Apr 15.

Be alert: See Special Notices—PORT VALDEZ AREA.

**AIRPORT MANAGER:** 907-835-5658

**WEATHER DATA SOURCES:** AWOS-3P 118.8 (907) 835-5578. (WX CAM)

**COMMUNICATIONS:** CTAF 122.9

RCO 122.2 (JUNEAU RADIO)

**ANCHORAGE CENTER APP/DEP CON** 119.3 269.4

**RADIO AIDS TO NAVIGATION:** NOTAM FILE VDZ.

**MINERAL CREEK NDB (MHW)** 524 MNL N61°07.45' W146°21.13' 060° 3.2 NM to fld. 16/19E.


NDB unusable:

320°-010° byd 15 NM

**LDA/DME** 109.5 I-VDZ Chan 32 Rwy 06. LOC and DME unusable byd 25° rgt of course all dist and alts. LOC and

DME unusable byd 10° left of course all dist and alts. LOC and DME unusable byd 11.2 NM blo 4,635'.

**COMM/NAV/WEATHER REMARKS:** For a toll free call to Juneau FSS dial 1-866-297-2236.

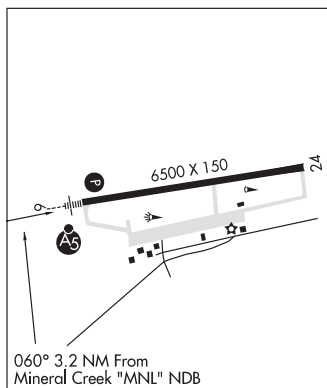

**VALLEY FLYING CROWN** (See WASILLA on page 261)

**VENETIE** (VEE)(PAVE) 1 E UTC-9(-8DT) N67°00.52' W146°21.98'

574 B NOTAM FILE FAI

**RWY 04-22:** 4000X75 (GRVL) MIRL

**RWY 04:** Road.

**RWY 22:** Trees.

**SERVICE:** LGT ACTIVATE MIRL Rwy 04-22 and rot bcn—CTAF. Rotating bcn OTS indef. Twy lgts OTS indef.

**AIRPORT REMARKS:** Unattended. Cold temperature restricted airport. Altitude

correction required at or below -42C. Maint in winter variable. Rwy

04-22 sfc slippery when wet, sfc uneven and sparsely graveled. Rwy 04

road transits rwy approximately 300' from thld. PPR before landing

phone 907-849-8165. Construction equipment and persons operating

on and invof rwy.

**AIRPORT MANAGER:** 907-849-8165

**COMMUNICATIONS:** CTAF 122.9

**ANCHORAGE CENTER APP/DEP CON** 135.0

**RADIO AIDS TO NAVIGATION:** NOTAM FILE FYU.

**FORT YUKON (H) VORTACW** 114.4 FYU Chan 91 N66°34.46'


W145°16.60' 296° 36.8 NM to fld. 449/20E.

VOR unusable:

001°-360° byd 15 NM

249°-259° byd 10 NM blo 4,900'

**COMM/NAV/WEATHER REMARKS:** For a toll free call to Fairbanks FSS dial 1-866-248-6516.

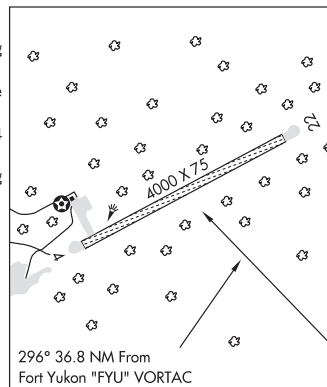

**VISNAW LAKE SPB** (See WASILLA on page 261)