

**VALDEZ PIONEER FLD** (VDZ)(PAVD) 3 E UTC-9(-8DT) N61°08.05' W146°14.69'

ANCHORAGE

121 B LRA ARFF Index—See Remarks NOTAM FILE VDZ

H-1B, L-1A, 3E, 4H

**RWY 06-24:** H6500X150 (ASPH-GRVD) S-75, D-200, 2D-300

IAP

PCN 54 F/B/X/T HIRL 1.1% up E

**RWY 06:** MALS. PAPI(P4L)—GA 3.0° TCH 29'. Trees. Rgt tfc.

**RWY 24:** REIL. Trees.

**RUNWAY DECLARED DISTANCE INFORMATION**

**RWY 06:** TORA-6500 TODA-6500 ASDA-6500 LDA-6500

**RWY 24:** TORA-6500 TODA-6500 ASDA-6500 LDA-6500

**SERVICE:** S2 FUEL 100LL, JET A, B LGT ACTIVATE HIRL Rwy 06-24, MALS. and PAPI Rwy 06 and REIL Rwy 24—CTAF.

**AIRPORT REMARKS:** Attended May-Sep 1600-0330Z, Oct-Apr

1500-0330Z. Fuel sales by PPR only. For Jet B 907-834-6933. For 100LL 907-831-0643. Cold temperature restricted airport. Altitude correction required at or below -11C. Arpt maint duty hrs:

1500-0330Z Mon-Fri, 1700-0130Z Sat-Sun. Be alert, during strong northerly winds the winds at midfld and at the east end of the rwy may be significantly higher than the winds detected at the AWOS site. Class I, ARFF Index A. CLOSED to air carrier ops with more than 30 pax seats exc with PPR in writing to Arpt Manager, PO Box 507 Valdez, AK 99686, 24 hrs in advance, FAX 907-835-5849. Snow removal, wildlife ctl, cond rprtng, and other afld maint svcs only avbl and valid dur arpt maint duty hrs. Ctc arpt mgmt for any after hrs req for afld svcs. Arpt sand larger gradation than FAA recommended/see AC 150/5200-30. SW section of ramp (1675 x 200 ft) not maintained Nov 1 to Apr 15. Be alert: See

Special Notices—PORT VALDEZ AREA.

**AIRPORT MANAGER:** 907-835-5658

**WEATHER DATA SOURCES:** AWOS-3P 118.8 (907) 835-5578. (WX CAM)

**COMMUNICATIONS:** CTAF 122.9

RCO 122.2 (JUNEAU RADIO)

ANCHORAGE CENTER APP/DEP CON 119.3 269.4

**RADIO AIDS TO NAVIGATION:** NOTAM FILE VDZ.


**MINERAL CREEK NDB (MHW)** 524 MNL N61°07.45' W146°21.13' 060° 3.2 NM to fld. 16/19E.

NDB unusable:

320°-010° byd 15 NM

**LDA/DME** 109.5 I-VDZ Chan 32 Rwy 06. LOC and DME unusable byd 25° rgt of course all dist and alts. LOC and DME unusable byd 10° left of course all dist and alts. LOC and DME unusable byd 11.2 NM blo 4,635'.

**COMM/NAV/WEATHER REMARKS:** For a toll free call to Juneau FSS dial 1-866-297-2236.

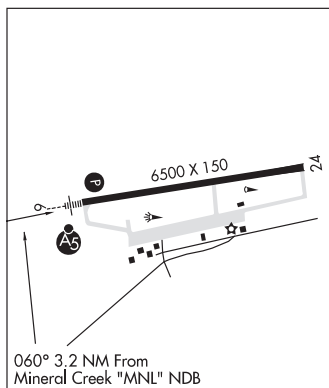

**VALLEY FLYING CROWN** (See WASILLA on page 271)

**VENETIE** (VEE)(PAVE) 1 E UTC-9(-8DT) N67°00.52' W146°21.98'

FAIRBANKS

574 B NOTAM FILE FAI

H-1B, L-4J

**RWY 04-22:** 4000X75 (GRVL) MIRL

IAP

**RWY 04:** Road.

**RWY 22:** Trees.

**SERVICE:** LGT ACTIVATE MIRL Rwy 04-22 and rot bcn—CTAF. Rotating bcn OTS indef. Twy lgts OTS indef.

**AIRPORT REMARKS:** Unattended. Cold temperature restricted airport. Altitude correction required at or below -42C. Maint in winter variable. Rwy 04-22 sfc slippery when wet, sfc uneven and sparsely gravelled. Rwy 04 road transits rwy approximately 300' from thld. PPR before landing phone 907-849-8165. Construction equipment and persons operating on and invof rwy.

**AIRPORT MANAGER:** 907-849-8165

**COMMUNICATIONS:** CTAF 122.9

ANCHORAGE CENTER APP/DEP CON 135.0

**RADIO AIDS TO NAVIGATION:** NOTAM FILE FYU.

**FORT YUKON (H) VORTACW** 114.4 FYU Chan 91 N66°34.46'


W145°16.60' 296° 36.8 NM to fld. 449/20E.

VOR unusable:

001°-360° byd 15 NM

249°-259° byd 10 NM blo 4,900'

**COMM/NAV/WEATHER REMARKS:** For a toll free call to Fairbanks FSS dial 1-866-248-6516.

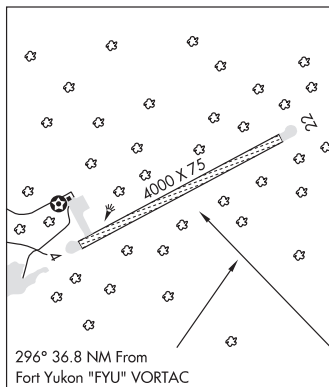

**VISNAW LAKE SPB** (See WASILLA on page 271)