42 ALASKA

ANAKTUVUK PASS (AKP)(PAKP) 0 SE UTC-9(-8DT) N68°08.02′ W151°44.60′

2106 B NOTAM FILE AKP

RWY 02–20: 4800X100 (GRVL) MIRL 1.1% up NE

RWY 02: REIL. PAPI(P2L)—GA 3.0° TCH 41′. Brush. RWY 20: REIL. PAPI(P2L)—GA 3.0° TCH 40′. Brush.

SERVICE: LGT ACTIVATE MIRL Rwy 02–20, REIL and PAPI Rwys 02 and 20, and rotating bcn—CTAF.

AIRPORT REMARKS: Attended continuously. Rwy 02–20 Be Alert: rwy located in mountain valley. High terrain in all quadrants causing turbulent winds. Rwy 02–20 recommend visual inspection prior to use. Cold temperature airport. Altitude correction required at or below –2C.

AIRPORT MANAGER: (907) 852-0489

WEATHER DATA SOURCES: AWOS-3P 135.75 (907) 661-3020. (WX CAM)

COMMUNICATIONS: CTAF/UNICOM 122.8

ANAKTUVUK PASS RCO 122.15 (FAIRBANKS RADIO)

R ANCHORAGE CENTER APP/DEP CON 124.6 352.0


RADIO AIDS TO NAVIGATION: NOTAM FILE BTT.

BETTLES (H) (H) VORW/DME 116.0 BTT Chan 107 N66°54.30′ W151°32.15′ 336° 74.1 NM to fld. 637/20E.

VOR AZIMUTH & DME unusable:

047°-077° byd 24 NM

COMM/NAV/WEATHER REMARKS: For a toll free call to Fairbanks FSS dial 1–866–248–6516

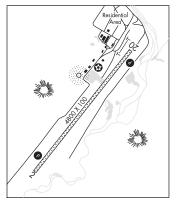

ANCHOR POINT

ANCHOR RIVER AIRPARK (AKØØ) PVT 1 NW UTC-9(-8DT) N59°46.98′ W151°51.18′

KODIAK

POINT RAPPOW

H-1A, L-4I

IAP

120 TPA—920(800) NOTAM FILE Not insp. **RWY 16–34**: 2500X75 (GRVL)

RWY 16: Trees. Rgt tfc.

RWY 34: Trees.

AIRPORT REMARKS: Unattended. Dalgt VFR ops only. Rising trn N. 100 ft trees surround rwy. Winter maint not available. Rwy cond unmnt; vis insp rcmdd prior to use.


AIRPORT MANAGER: 612-282-1978

COMMUNICATIONS: CTAF 122.9

RADIO AIDS TO NAVIGATION: NOTAM FILE HOM.

HOMER (H) (H) VORW/DME 114.6 HOM Chan 93 N59°42.57′ W151°27.40′ 275° 12.8 NM to fld. 1626/15E.

COMM/NAV/WEATHER REMARKS: Local call to Homer FSS dial 235–8588. For a toll free call to Kenai FSS dial 1–866–864–1737.

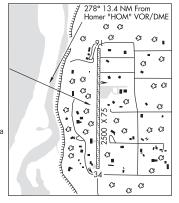

ANCHOR RIVER AIRPARK (See ANCHOR POINT on page 42)

ANCHORAGE

ALASKA RGNL HOSPITAL HELIPORT (20K) 2 E UTC-9(-8DT) N61°12.76′ W149°49.60′

ANCHORAGE

137 B NOTAM FILE ENA

HELIPAD H1: H175X175 (ASPH)

SERVICE: FUEL 100LL, JET A LGT No perimeter lights avbl.

HELIPORT REMARKS: Special Air Traffic Rules—Part 93, see Regulatory Notices. Attended Mon—Fri 1630–0200Z‡. Heli on Merrill Field Arpt. Inbound Medevac 15 min prior to arr—130.45 or 907–258–3822/800–478–9111. Training invof heli; reqs time to secure area. Perimeter mkgs 115′ X 115′. Recommend approach from W–NE. Rwy H1 building E SW, 8′ fence W. Lgt poles 85′ SE and 110′ to NE.

AIRPORT MANAGER: 907-343-6301

COMMUNICATIONS: CTAF 126.0 UNICOM 122.95

COMM/NAV/WEATHER REMARKS: For a toll free call to Kenai FSS dial 1-866-864-1737.