

AKRON—CANTON RGNL (CAK)(KCAK) P (ARNG) 10 SE UTC-5(-4DT) N40°54.90' W81°26.62'

DETROIT

1226 B LRA ARFF Index—See Remarks NOTAM FILE CAK MON Airport

H-10G, L-29B

RWY 05-23: H8204X150 (ASPH-GRVD) S-120, D-160, 2S-175,

IAP, AD

2D-250 PCR 410 F/B/XU HIRL

RWY 05: MALSR. PAPI(P4L)—GA 3.0° TCH 50'. RVR-TR 0.5% up.

RWY 23: MALSR. PAPI(P4L)—GA 3.0° TCH 47'. RVR-TR 0.6% down.

RWY 01-19: H7601X150 (ASPH-GRVD) S-120, D-160, 2S-175,

2D-250 PCR 410 F/B/XU HIRL

RWY 01: MALSR. RVR-TR

RWY 19: MALSR. PAPI(P4L)—GA 3.0° TCH 53'. RVR-TR Thld dsplcd 601'.

LAND AND HOLD—SHORT OPERATIONS

LDG RWY	HOLD—SHORT POINT	AVBL LDG DIST
RWY 05	01-19	5723
RWY 19	05-23	3100

RUNWAY DECLARED DISTANCE INFORMATION


RWY 01: TORA-7601 TODA-7601 ASDA-7007 LDA-7007

RWY 05: TORA-8204 TODA-8204 ASDA-8204 LDA-8204

RWY 19: TORA-7601 TODA-7601 ASDA-7601 LDA-7007

RWY 23: TORA-8204 TODA-8204 ASDA-8204 LDA-8204

SERVICE: S4 **FUEL** 100LL, JET A **OX** 1, 2 **MILITARY—FUEL** A, A+ (C330-494-6104) (NC-100LL).

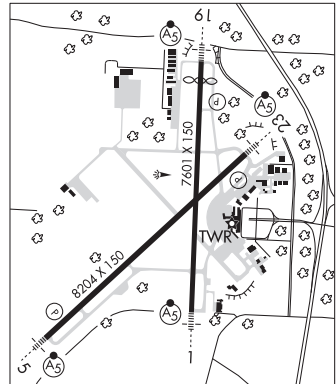

AIRPORT REMARKS: Attended continuously. All acft taxiing on Air Camis Ramp and north hangar areas not visible from twr. Deer and birds on and invof arpt. Class I, ARFF Index B, ARFF svc not avbl 0100-0500 local (0600-1000Z±) daily. One hour PPR for unsked air carrier ops, call arpt manager 330-499-4059. Twy E east of Twy B clsd to acft over 118' wingspan. Non-commercial landing fee: multi-engine only. Flight Notification Service (ADCUS) avbl. NOTE: See Special Notices—Arrival Alert.

AIRPORT MANAGER: 330-754-5233

WEATHER DATA SOURCES: ASOS (330) 227-8682

COMMUNICATIONS: ATIS 121.05 UNICOM 122.95

④ **CLEVELAND APP/DEP CON** 118.6 (187°-006°) 125.5 (007°-186°) (1100-0600Z±)

④ **CLEVELAND CENTER APP/DEP CON** 134.9 (0600-1100Z±) ctc Cleveland ARTCC at 440-774-0223.

TOWER 134.75 **GND CON** 121.7 **CLNC DEL** 132.05

ARNG OPS 40.1 138.55 226.9

CLEARANCE DELIVERY PHONE: For CD ctc Cleveland ARTCC at 440-774-0223.

AIRSPACE: CLASS C svc ctc **APP CON** svc 1100-0600Z±; other times CLASS D.

VOR TEST FACILITY (VOT) 110.6

RADIO AIDS TO NAVIGATION: NOTAM FILE CAK.

(L) (L) **VORW/DME** 114.4 ACO Chan 91 N41°06.47' W81°12.09' 228° 16.0 NM to fld. 1197/4W.

DME unusable:

Byd 10 NM

ILS 109.5 I-CAK Rwy 01. Class IA.

ILS/DME 108.3 I-EQX Chan 20 Rwy 05. Class IE.

ILS 109.5 I-RGO Rwy 19. Class IE.

ILS/DME 108.3 I-GGZ Chan 20 Rwy 23. Class IE. DME unusable byd 3° r of course.

MAYFIELD (1D4) 5 SE UTC-5(-4DT) N40°59.55' W81°25.91'

DETROIT

1100 NOTAM FILE CLC

RWY 09-27: 2315X110 (TURF) 0.3% up E

RWY 09: Thld dsplcd 180'. Trees.

RWY 27: Thld dsplcd 590'. Trees. Rgt tfc.

AIRPORT REMARKS: Attended irregularly. Deer, birds, and wildlife on and invof airport. Student ops NA; ngt ops NA. Rwy 09-27 rolling trrn upslp to the West; West end 12' hyr than East end. Open to the public, wx and conds prmtg, ldg fees. No prkg, fees may apply. No UAS, or similar acft pmtd. No unauthorized vehicles, no trespassing. Rwy 09-27 mkd with yellow tires and cones at rwy end and dthr only. Rwy 09-27 thr and dthr mrks not vsb fm 1000 ft AGL; no bdry mrks.

AIRPORT MANAGER: 330-699-3066

COMMUNICATIONS: CTAF 122.9

CLEARANCE DELIVERY PHONE: For CD ctc Cleveland Apch at 216-352-2323, when Apch clsd ctc Cleveland ARTCC at 440-774-0223/0490.

ALDERMAN (See ST CLAIRSVILLE on page 306)

ALEXANDER SALAMON (See WEST UNION on page 320)