154 CALIFORNIA

LODI

KINGDON AIRPARK (02Ø) 4 SW UTC-8(-7DT) N38°05.50′ W121°21.56′

SAN FRANCISCO L-2F, 3A

15 TPA—815(800) NOTAM FILE RIU

RWY 12–30: H3705X60 (ASPH) RWY LGTS(NSTD)

RWY 12: Thid dsplcd 295'. Fence.

RWY 30: TRCV(TRIL)—GA 4.5° TCH 16', Thid dspicd 490', Road.

SERVICE: FUEL 100LL LGT Rwy 30 VASI OTS indef. For LIRL Rwy 12-30 key 122.8 5 times.

AIRPORT REMARKS: Attended irregularly on call. Ctc arpt manager at 209–986–0797. Self–fueling fac avbl 24/7. Rwy 12–30 northwest 1000′ rough surface. Acft parked 115′ left of Rwy 30 centerline southeast end of rwy prior to dsplcd thld. Rwy 12–30 NSTD edge lights 40′ from edge of rwy, Rwy 12 lighted thld relocated 295′; Rwy 30 lighted thld relocated 490′ for ngt ops. 3215′ of Rwy 12–30 usable at ngt. Rwy 12–30 markings extremely faded, Rwy 30 dsplcd thld marked with thld bar only, no numbers, no centerline.

AIRPORT MANAGER: 209-986-0797

COMMUNICATIONS: CTAF/UNICOM 122.8

CLEARANCE DELIVERY PHONE: For CD ctc NorCal Apch at 916-361-0516.

RADIO AIDS TO NAVIGATION: NOTAM FILE RIU.

LINDEN (H) VORW/DME 114.8 LIN Chan 95 N38°04.47′ W121°00.23′ 257° 16.9 NM to fld. 266/17E.

DME unusable: 191°-235°

LODI (103) 4 N UTC-8(-7DT) N38°12.15′ W121°16.15′

60 B TPA—860(800) NOTAM FILE RIU

RWY 08-26: H3547X40 (ASPH) S-30 LIRL(NSTD)

RWY 08: Thid dsplcd 515'. Pole.

RWY 26: Thild dsplcd 388'. Pole. Rgt tfc. **RWY 12–30:** H1979X25 (ASPH–GRVD) S–30

RWY 12: Thid dsplcd 182'. Tree. Rgt tfc.

RWY 30: Thid dsplcd 102'. Tree.

SERVICE: S4 FUEL 100LL, JET A 0X 3 LGT Rwy 08–26 NSTD LIRL located 30 ' from pavement edge. EOR lights located at both dsplcd thlds to Rwy 08–26. Rwy 08 edge lgts extended approximately 400 ' west of thld.

AIRPORT REMARKS: Attended 1700Z‡-dusk. Parachute Jumping. Automated credit card fuel system 24 hrs a day.

AIRPORT MANAGER: 209-369-9126

COMMUNICATIONS: CTAF 122.9

® NORCAL APP CON 125.1

® NORCAL DEP CON 125.1 (Southbound) 125.25 (Northbound)

CLEARANCE DELIVERY PHONE: For CD ctc NorCal Apch at 916-361-0516.


RADIO AIDS TO NAVIGATION: NOTAM FILE RIU.

LINDEN (H) VORW/DME 114.8 LIN Chan 95 N38°04.47′ W121°00.23′ 284° 14.7 NM to fld, 266/17E.

DME unusable: 191°–235°

- - - - - - - SAN FRANCISCO

SAN FRANCISCO L-2F, 3A

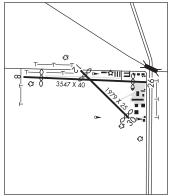

LODI AIRPARK (L53) 3 SW UTC-8(-7DT) N38°05.05′ W121°18.98′

SAN FRANCISCO

25 TPA—825(800) NOTAM FILE RIU

RWY 07-25: H1875X22 (ASPH)

RWY 07: Road.

AIRPORT REMARKS: Attended Jan-Sep 1600-0100Z‡; Oct-Dec Mon-Fri 1600-2000Z‡. 380 apron extends east from end of Rwy 25. Rwy 25 first 1200 ft is 36 ft wide, remainder is 22 ft wide.

AIRPORT MANAGER: (209) 327-3311 COMMUNICATIONS: CTAF 122.9

CLEARANCE DELIVERY PHONE: For CD ctc NorCal Apch at 916-361-0516.