

**DOUGLAS**

**COCHISE COLLEGE** (P03) 7 W UTC-7 N31°22.28' W109°41.40'

**PHOENIX**  
H-4K, L-5D

4146 B NOTAM FILE PRC

**RWY 05-23:** H5551X60 (ASPH) MIRL 0.7% up SW

**RWY 05:** PAPI(P4L)—GA 3.0°. Road.

**RWY 23:** PAPI(P4L)—GA 3.0°. Thld dsplcd 450'. Road.

**RUNWAY DECLARED DISTANCE INFORMATION**

**RWY 05:** TORA-5441 TODA-5551 ASDA-5441 LDA-5441

**RWY 23:** TORA-5551 TODA-5551 LDA-5103

**SERVICE:** FUEL 100LL LGT ACTIVATE MIRL Rwy 05-23—CTAF.

**AIRPORT REMARKS:** Attended Mon-Fri 1330-2330Z. 100LL available in emerg only. Wildlife on or in/ovf arpt. Unmanned aerial vehicle operating on and in/ovf arpt. University security 520-417-4022.

**AIRPORT MANAGER:** 520-417-4114


**COMMUNICATIONS:** CTAF/UNICOM 122.8

**CLEARANCE DELIVERY PHONE:** For CD ctc Albuquerque ARTCC at 505-856-4861.

**RADIO AIDS TO NAVIGATION:** NOTAM FILE DUG.

**DOUGLAS (L) VORTACW** 108.8 DUG Chan 25 N31°28.36' W109°36.12' 204° 7.6 NM to fld. 4131/13E.

DME & TACAN AZIMUTH unusable:  
045°-065° byd 26 NM blo 10,000'  
065°-095° byd 28 NM blo 9,500'  
355°-010° byd 35 NM blo 11,300'

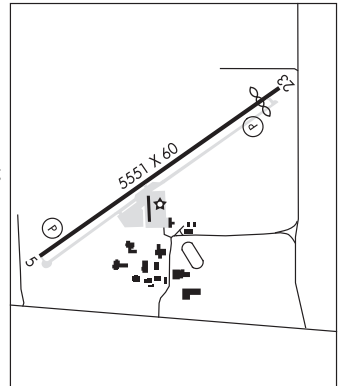

**DOUGLAS MUNI** (DGL)(KDGL) 2 E UTC-7 N31°20.56' W109°30.39'

**PHOENIX**  
H-4K, L-5D

4173 B AOE LRA NOTAM FILE PRC

**RWY 03-21:** H5760X75 (ASPH) MIRL

**RWY 03:** PAPI(P4L)—GA 4.0° TCH 40'. Brush. Rgt tfc.

**RWY 21:** PAPI(P4L)—GA 4.0° TCH 50'. Brush.

**RWY 18-36:** 4095X100 (DIRT)

**RWY 18:** Brush.

**RWY 36:** Brush. Rgt tfc.

**SERVICE:** FUEL 100LL, JET A LGT PAPI Rwy 21 OTS indef. Rwy 03 PAPI OTS indef. Rwy 21 PAPI OTS indef.

**AIRPORT REMARKS:** Attended Mon-Fri 1400-0100Z, 24 hr 100LL avbl with major credit card. For svc after hours call 520-368-6015. Rwy 03-21 has 1" - 6" cracks across rwy. Rwy 18-36 has +4' brush, rocks and uneven surface for 3/4 of rwy length. Rwy 18-36 CLOSED indef. Rwy 21 50' twr 1350' from thld 550' left lgtd. Mountains 1 1/2 miles east. Rwy 18-36 brush on both sides 70 ft from centerline full length of rwy. Rwy 18-36 surface rough and rutted. Rwy 18-36 +3 ft bump 300 ft from Rwy 18 thld. Rwy 18-36, 2 ft bump crossing twy to Rwy 03-21. Personnel on ATVS near acft opr areas-unrstd. Flight notification svc avbl. Extsv contrr act in cntr of airfield assocd with the bdr wall const. Const eqpt and mobile bldgs lctd on cntr fld acft ramp and on ptn of Rwy 18-36 (indefly clsd) S of cntr twy.

**AIRPORT MANAGER:** (520) 368-6015

**COMMUNICATIONS:** CTAF/UNICOM 122.8

**RCO** 122.6 (PRESCOTT RADIO)

**RADIO AIDS TO NAVIGATION:** NOTAM FILE DUG.

**(L) VORTACW** 108.8 DUG Chan 25 N31°28.36' W109°36.12' 135° 9.2 NM to fld. 4131/13E.

DME & TACAN AZIMUTH unusable:  
045°-065° byd 26 NM blo 10,000'  
065°-095° byd 28 NM blo 9,500'  
355°-010° byd 35 NM blo 11,300'

