

**EAGLE AIRPARK** (See BULLHEAD CITY on page 32)

**ELOY MUNI** (E60) 3 NW UTC-7 N32°48.40' W111°35.20'  
1511 B TPA—2311(800) NOTAM FILE PRC

**RWY 02-20:** H3901X75 (ASPH) MIRL

**RWY 02:** REIL. PAPI(P2L). Brush.

**RWY 20:** REIL. PAPI(P2L). Brush. Rgt tfc.

**SERVICE:** S4 **FUEL** 100LL, JET A **LGT** REIL Rwy 02 and Rwy 20 opr continuously. PAPI Rwy 02 and Rwy 20 opr continuously.

**AIRPORT REMARKS:** Attended 1400-2300Z. Self-fueling avbl 24 hrs with major credit card. Parachute Jumping. Seasonal crop dusting operations. Apch from west and do not overfly arpt, extremely heavy parachute jumping activity over east side of arpt SR-SS. When wind 10 knots or less dep Rwy 02 and land Rwy 20. Rwy 02-20 centerline obscured by rubber deposits. Delineator reflector system on twy, many missing.

**AIRPORT MANAGER:** (520) 464-3429


**COMMUNICATIONS:** CTAF/UNICOM 122.8

**CLEARANCE DELIVERY PHONE:** For CD ctc Albuquerque ARTCC at 505-856-4861.

**RADIO AIDS TO NAVIGATION:** NOTAM FILE PRC.

**STANFIELD (H) VORTAC** 114.8 TFD Chan 95 N32°53.15'  
W111°54.52' 094° 17.0 NM to fld. 1316/12E.

PHOENIX  
L-5B, A

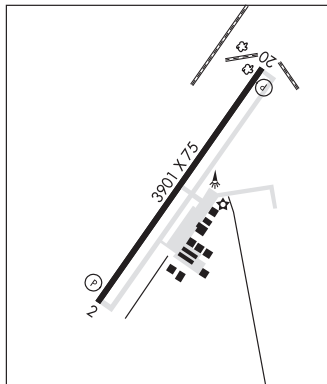**ERIC MARCUS MUNI** (See AJO on page 30)**ESTRELLA SAILPORT** (See MARICOPA on page 55)**FALCON FLD** (See MESA on page 56)

**FLAGSTAFF PULLIAM** (FLG)(KFLG) 4 S UTC-7 N35°08.42' W111°40.15'  
7015 B TPA—See Remarks Class I, ARFF Index B NOTAM FILE FLG

**RWY 03-21:** H8800X150 (ASPH-GRVD) S-30, D-95, 2S-120, 2D-140  
PCN 37 F/D/W/T HIRL

**RWY 03:** PAPI(P4L)—GA 3.0° TCH 52'.

**RWY 21:** MALSR. PAPI(P4L)—GA 3.0° TCH 51'. Thld dspld 1800'.

**RUNWAY DECLARED DISTANCE INFORMATION**

**RWY 03:** TORA-8800 TODA-8800 ASDA-8800 LDA-8800

**RWY 21:** TORA-8800 TODA-8800 ASDA-8800 LDA-7000

**SERVICE:** S4 **FUEL** 100LL, JET A **OX 2** **LGT** When twr closed  
ACTIVATE HIRL Rwy 03-21, MALSR Rwy 21—CTAF. PAPI Rwy 03  
and PAPI Rwy 21 opr continuously.

**AIRPORT REMARKS:** Attended 1300-0600Z. Full and self-service fuel avbl 24 hrs. Rwy 03-21 windshear and turbulence at both ends of rwy when sfc winds exceed 10 Kts. Toll to Prescott. Use for FSS also. ILS unmonitored when twr clsd. Snow removal equipment may be on rwy. Equipment has 2-way radio and monitors frequency 134.55 when twr clsd. Arpt may be CLOSED during snow removal. For current snow removal equipment activity ctc 134.55. Calm wind conditions use Rwy 21. Noise Abatement: Avoid overflight of village 3 miles south. TPA—8004(989) conventional acft, 7504(489) helicopter, 8504(1489) high performance.

**AIRPORT MANAGER:** (928) 213-2933

**WEATHER DATA SOURCES:** AWOS-3 125.8 (928) 779-2439.

**COMMUNICATIONS:** CTAF 134.55 ATIS 125.8 UNICOM 122.95

**RCO** 123.65R (PRESCOTT RADIO)


**KAYENTA RCO** 122.45 (PRESCOTT RADIO)

**MINGUS MOUNTAIN RCO** 122.3 (PRESCOTT RADIO)

Ⓡ **PHOENIX APP/DEP CON** 126.375

**TOWER** 134.55 1300-0400Z 1 Apr-30 Sep, 1400-0200Z 1 Oct-31 Mar **GND CON** 121.9

PHOENIX  
H-4J, L-9G  
IAP, AD

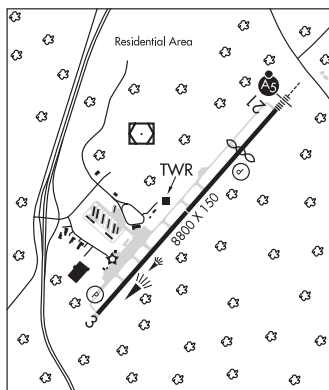

CONTINUED ON NEXT PAGE

## CONTINUED FROM PRECEDING PAGE

**AIRSPACE: CLASS D** svc 1300-0400Z 1 Apr-30 Sep, 1400-0200Z 1 Oct-31 Mar; other times CLASS G.

**RADIO AIDS TO NAVIGATION:** NOTAM FILE FLG.

(H) **VOR/DME** 113.85 FLG Chan 85(Y) N35°08.83' W111°40.45' at fld. 7026/14E.

VOR/DME unusable:

335°-030° byd 19 NM blo 24,000'

DME unusable:

230°-255° byd 20 NM blo 15,000'

**ILS** 110.5 I-FLG Rwy 21. Glideslope unusable byd 5° right of LOC course. LOC unusable inside of flg 0.8 DME. Unmonitored when ATCT clsd.

**FLYING J RANCH** (See PIMA on page 65)

**FORT HUACHUCA** N31°35.13' W110°20.34' NOTAM FILE FHU.

**PHOENIX**

(T) **TACAN** 111.6 ARH Chan 53 at Sierra Vista Muni-Libby AAF. 4660/12E. unmonitored when twr clsd.

**H-4K, L-5C**

TACAN unusable:

105°-250° byd 10 NM

120°-300° byd 20 NM

military use: No NOTAM MP 1200-1500Z 1st Thursday of month

**GILA BEND AF AUX** (GXF)(KGXF) AF 3 S UTC-7 N32°53.27' W112°43.18'

**PHOENIX**

883 B NOTAM FILE GXF Not insp.

**H-4J, L-5B**

**AIRSPACE: CLASS D** svc 1430-0630Z Mon-Fri, 1500-2359Z wkend, clsd hol; other times CLASS G.

**GILA BEND MUNI** (E63) 2 E UTC-7 N32°57.61' W112°40.42'

**PHOENIX**

789 B TPA-1589(800) NOTAM FILE PRC

**H-4J, L-5B, A**

**RWY 04-22:** H5200X75 (ASPH) S-12.5 MIRL 0.3% up NE

**RWY 04:** PAPI(P2L)-GA 3.0° TCH 40'. Brush.

**RWY 22:** PAPI(P2L)-GA 3.0° TCH 40'. Brush.

**SERVICE:** FUEL 100LL LGT ACTIVATE MIRL Rwy 04-22-CTAF.

**AIRPORT REMARKS:** Unattended. 24 hr self svc avbl with major credit card after Sep 1, 2014. Rwy 04-22 primary sfc: +5'/-20' brush and trees, 100'-125' south of runway cntrln. Area besides rwy narrows to 30' at culvert. NOTE: See Special Notices-Restricted Area R-2305, Gila Bend, Arizona, Transit Information.

**AIRPORT MANAGER:** (623) 810-4662

**COMMUNICATIONS:** CTAF/UNICOM 122.8

**RCO** 122.1R (PRESCOTT RADIO)

**CLEARANCE DELIVERY PHONE:** For CD ctc Luke Apch at 623-856-7361. If una, ctc Phoenix Apch at 602-306-2565.

**RADIO AIDS TO NAVIGATION:** NOTAM FILE PRC.

(H) **VORTAC** 116.6 GBN Chan 113 N32°57.38'

W112°40.46' at fld. 790/14E.

TACAN AZIMUTH unusable:

360°-010° byd 25 NM

