

PINAL AIRPARK (MZJ)(KMZJ) 7 NW UTC-7 N32°30.59' W111°19.52'

1893 B TPA—See Remarks NOTAM FILE MZJ

RWY 12-30: H6849X150 (ASPH) S-68, D-100, 2D-270,

2D/2D2-500 MIRL 0.3% up SE

RWY 30: Rgt t/c.

SERVICE: S4 **FUEL** 100LL, **JET A** OX 1, 2

AIRPORT REMARKS: Attended 1400-2230Z. For fuel and gnd support services after hrs and hols 24 hr PPR call 520-682-4181 x5755; call-in fee applicable. Parachute Jumping. Rwy 12-30, double/triple dual tandem wheel acft max 500,000 lbs, except PPR: 520-682-4181 extension 5755. Be alert to 10' open channel 1000' from Rwy 12 end. Numerous controlled vehicles crossing Rwy 12-30. Wildlife on or invof arpt. Rwy 12 preferred calm wind rwy. Rwy 20 ft paved shoulders. Extensive military helicopter training 1400-0600Z except holidays. Extensive military parachute training high and low levels all hours. Parachute jump areas located southwest of Rwy 12-30. Unicorn monitored intermittently during normal business hours. TPA-3002(1109) fixed wing acft; 2602(709) rotary wing acft. Twy C clsd indef. Acft storage/overnight fee ctc 520-682-4181 extension 5755. PPR for transient acft to National Guard Complex/Silver Bell National Guard Heliport phone DSN 853-5931, C520-750-5931 (National Guard ops). Note: See Special Notices—Glider Operations Northwest of Tucson, Arizona.

AIRPORT MANAGER: 520-866-6545

WEATHER DATA SOURCES: AWOS-3PT 130.375 (520) 682-3519.

COMMUNICATIONS: CTAF/UNICOM 123.05

CLEARANCE DELIVERY PHONE: For CD ctc Tucson Apch at 520-829-6121.

RADIO AIDS TO NAVIGATION: NOTAM FILE TUS.

TUCSON (H) VORTACW 116.0 TUS Chan 107 N32°05.71' W110°54.89' 308° 32.4 NM to fld. 2671/12E.

VOR unusable:

050°-080° byd 30 NM blo 11,500'

350°-020° byd 30 NM blo 13,000'

TACAN AZIMUTH unusable:

050°-080° byd 30 NM blo 11,500'

155°-165° byd 35 NM blo 13,000'

350°-020° byd 30 NM blo 13,000'


DME unusable:

050°-080° byd 30 NM blo 11,500'

155°-165° byd 35 NM blo 13,000'

350°-020° byd 30 NM blo 13,000'

PHOENIX
H-4J, L-5C

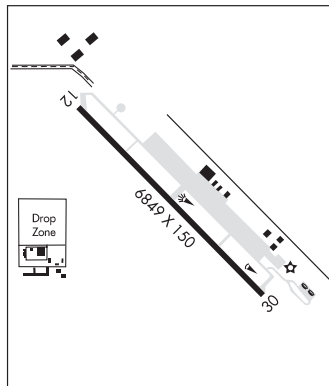

MARBLE CANYON (L41) 1 SW UTC-7 N36°48.65' W111°38.67'

3603 NOTAM FILE PRC

RWY 03-21: H3715X35 (ASPH)

AIRPORT REMARKS: Attended dalgt hours. Rwy 03 centerline only, no numbers or thld. Rwy 21 centerline only, no numbers or thld. No line of sight btn rwy ends. Rwy 03-21 3530 ft resurfaced, centerline marked. Additional 206 ft of pavement not resurfaced on Rwy 03 thld end. First 1000 ft Rwy 03 rough and rutted. Resurfaced portion of Rwy 03-21 is tight with no loose material, but is somewhat rough. Brush along both sides of rwy within primary sfc. Arpt unfenced. Cliffs west, northwest, northeast and east of arpt. Landing fee-\$5 single, \$10 twin, \$5 for helicopter. Pilots should monitor 122.9 within 5 NM of arpt. Phone to cancel flight plans across road at restaurant/motel.

AIRPORT MANAGER: 714-366-6036

COMMUNICATIONS: CTAF 122.9

CLEARANCE DELIVERY PHONE: For CD ctc Los Angeles ARTCC at 661-575-2079.

RADIO AIDS TO NAVIGATION: NOTAM FILE PGA.

PAGE (L) VOR/DME 117.6 PGA Chan 123 N36°55.86'

W111°26.85' 220° 11.9 NM to fld. 4250/13E.

VOR/DME unusable:

105°-230° byd 30 NM blo 11,000'

230°-245° byd 30 NM blo 12,000'

LAS VEGAS
L-8G

