

SELLS (E78) 2 NW UTC-7 N31°55.96' W111°53.66'
2409 NOTAM FILE PRC

PHOENIX
H-4I, L-5B

RWY 04-22: H5830X60 (ASPH) S-12.5

RWY 04: Trees.

RWY 22: Trees.

AIRPORT REMARKS: Unattended. Rwy 04-22 +3'' wide cracks (longitudinal and transverse) full length of rwy. Isolated holes less than 1-2 sq ft in rwy. Rwy 04-22 width 60' in some areas narrower due to bushes growing thru pavement. Livestock on and invof arpt. Rwy 04-22 15' to 18' trees and brush in primary sfc entire length of rwy, both sides. Rwy 04-22 3' ditches along rwy edges. Rwy 04-22 marked with 6" yellow centerline stripe only, markings faded. No rwy numbers. U.S. border patrol has 1500 gallon Jet A tanker truck parked 16' from the pavement edge near mid-point of rwy.

AIRPORT MANAGER: (520) 383-5546

COMMUNICATIONS: CTAF 122.9

CLEARANCE DELIVERY PHONE: For CD ctc Albuquerque ARTCC at 505-856-4861.

RADIO AIDS TO NAVIGATION: NOTAM FILE TUS.

TUCSON (H) VORTAC 116.0 TUS Chan 107 N32°05.71' W110°54.89' 247° 50.9 NM to fld. 2671/12E. **HIWAS.**

VOR unusable:

050°-080° byd 30 NM blo 11,500'

350°-020° byd 30 NM blo 13,000'

TACAN AZIMUTH unusable:

050°-080° byd 30 NM blo 11,500'

155°-165° byd 35 NM blo 13,000'


350°-020° byd 30 NM blo 13,000'

DME unusable:

050°-080° byd 30 NM blo 11,500'

155°-165° byd 35 NM blo 13,000'

350°-020° byd 30 NM blo 13,000'

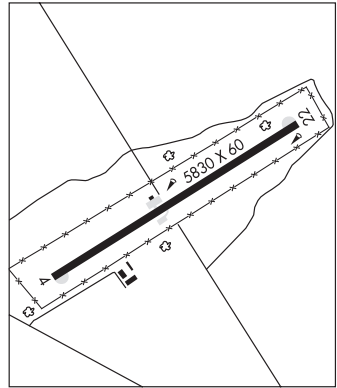

SHOW LOW RGNL (SOW)(KSOW) 2 E UTC-7 N34°15.93' W110°00.34'
6415 B TPA-7215(800) Class III, ARFF Index A NOTAM FILE SOW

PHOENIX
H-4K, L-5C, 8G
IAP

RWY 07-25: H7200X100 (ASPH) S-35, D-60 PCN 7 F/D/X/T MIRL

RWY 07: REIL. PAPI(P2L)—GA 3.0° TCH 49'. Thld dsplcd 700'.

RWY 25: REIL. PAPI(P2L)—GA 3.0° TCH 49'. Rgt tfc.

RWY 04-22: H3938X60 (ASPH)

RWY 04: Rgt tfc.

RUNWAY DECLARED DISTANCE INFORMATION

RWY 04: TORA-3938 TODA-3938 ASDA-3938 LDA-3938

RWY 07: TORA-7200 TODA-7200 ASDA-7200 LDA-6500

RWY 22: TORA-3938 TODA-3938 ASDA-3938 LDA-3938

RWY 25: TORA-7200 TODA-7200 ASDA-7200 LDA-7200

SERVICE: FUEL 100LL, JET A **LGT** ACTIVATE REIL Rwy 07 and Rwy 25, PAPI Rwy 07 and Rwy 25, MIRL Rwy 07-25—CTAF.

AIRPORT REMARKS: Attended 1400-0200Z. Self svc fuel avbl continuous. Military tfc invof arpt. Simultaneous ops Rwy 22 and Rwy 25 prohibited. Rwy 04-22 and Rwy 07-25 not connected by pavement at AER 22. Overnight transient fees and commercial opr ldg fees applicable.

AIRPORT MANAGER: (928) 532-4190

WEATHER DATA SOURCES: AWOS-3 118.075 (928) 532-0379.

COMMUNICATIONS: CTAF/UNICOM 123.0

CLEARANCE DELIVERY PHONE: For CD ctc Albuquerque ARTCC at 505-856-4861.

RADIO AIDS TO NAVIGATION: NOTAM FILE SJN.

ST JOHNS (H) VORTAC 112.3 SJN Chan 70 N34°25.44' W109°08.61' 246° 43.9 NM to fld. 6840/12E.

NDB (MHW) 206 SOW N34°16.04' W110°00.49' at fld. 6403/10E. NOTAM FILE SOW.

